

**FIELD DELINEATION AND CONFIRMATION SAMPLING REPORT**

**FORMER CACTUS PIPE AND SUPPLY FACILITY  
815 DORSETT STREET  
HOUSTON, HARRIS, TEXAS**

**Terracon Project No. 92097378  
March 19, 2010**

*Prepared for:*



**Railroad Commission of Texas  
1701 N. Congress  
Austin, Texas 78711-2967**

*Prepared by:*

**Terracon**  
Consulting Engineers & Scientists

**11555 Clay Road, Suite 100  
Houston, Texas 77043**

March 19, 2010

Railroad Commission of Texas  
1701 N. Congress  
Austin, Texas 78711-2967  
Attn: Mr. Peter Fisher

Telephone: (512) 463-6832  
Fax: (512) 463-2388

Re: Field Delineation and Confirmation Sampling Report  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, Harris County, Texas  
Terracon Project No. 92097378

Dear Mr. Fisher:

Terracon is pleased to submit the Field Delineation and Confirmation Sampling Report for the above referenced site (Hardcopy and CD). Terracon's activities were performed in accordance with the approved Work Order for this project dated September 9, 2009.

We appreciate the opportunity to perform these services for the Railroad Commission of Texas. Please contact either of the undersigned at (713) 690-8989 if there are any questions regarding the information provided in the report.

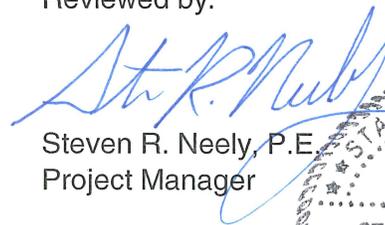
Sincerely,  
**Terracon Consultants, Inc.**

Prepared by:

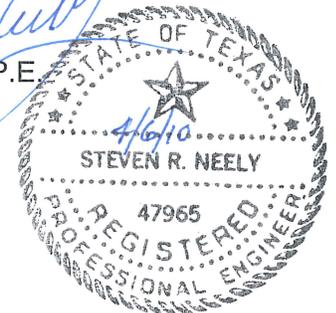


Arun Neupane  
Senior Staff Environmental Scientist

Reviewed by:



Steven R. Neely, P.E.  
Project Manager



CC: District 3 - Oil and Gas Division (Hardcopy and CD)

**TABLE OF CONTENTS**

	Page No.
<b>1.0 INTRODUCTION.....</b>	<b>1</b>
1.1 Background and Scope .....	1
<b>2.0 NORM AREAS.....</b>	<b>2</b>
2.1 Surface delineation of NORM areas .....	2
2.2 Excavation and additional delineation of NORM affected soil .....	2
2.3 NORM excavation confirmation samples .....	3
<b>3.0 LEAD AND TPH AREAS.....</b>	<b>4</b>
3.1 Field delineation of Lead and TPH affected soil .....	4
3.2 Excavation and additional delineation of lead and TPH affected soil .....	5
3.3 Lead and TPH excavation confirmation samples .....	6
<b>4.0 BACKFILLING AND SITE RESTORATION.....</b>	<b>8</b>
<b>5.0 SUMMARY.....</b>	<b>8</b>
<b>6.0 LIMITATIONS.....</b>	<b>9</b>

**FIGURES**

- Figure 1 - Site Vicinity Map
- Figure 2 - Site Plan
- Figure 3 - Final Limit of NORM Excavated Areas
- Figure 4 - Final Limit of Lead and TPH Excavated Areas

**TABLES**

- Table 1 - Summary of Soil Analytical Results-NORM
- Table 2 - Summary of Soil Analytical Results-Lead
- Table 3 - Summary of Soil Analytical Results-Arsenic, Barium, and Cadmium
- Table 4 - Summary of Soil Analytical Results-TPH

## **APPENDICES**

- Appendix A: Site Photographs
- Appendix B: Analytical Laboratory Reports
- Appendix C: Waste Manifests (under separate cover)

# FIELD DELINEATION AND CONFIRMATION SAMPLING REPORT

## FORMER CACTUS PIPE AND SUPPLY FACILITY 815 DORSETT STREET HOUSTON, HARRIS COUNTY, TEXAS

Terracon Project No. 92097378

### 1.0 INTRODUCTION

#### 1.1 Background and Scope

The former Cactus Pipe and Supply Facility (hereinafter referred to as 'site') is located at 815 Dorsett Street in Houston, Texas. The site is an approximately 14.94-acre parcel owned by the City of Houston (COH) and bounded by Dorsett Street to the west, Market Street to the south, and commercial businesses to the north and east. The southwestern portion of the site is adjacent to an active City of Houston (COH) Sanitary Sewer Facility (COH Pump Station) that is separated from the site by a fence. Figure 1 presents a Site Vicinity Map. Figure 2 presents a Site Plan that shows the pertinent structures, labeled excavation areas, and the site boundary.

The RRC undertook a partial clean up of the site in September 2009 based on the findings of previous site assessment activities at the site. In November 2008, Terracon Consultants, Inc (Terracon) completed a site assessment that included review of previous site investigations by others (ESA - Report No. 92087239, dated November 21, 2008), which identified the following areas requiring remediation:

- Eight areas affected by oil and gas Naturally Occurring Radioactive Material (NORM)
- Twenty seven areas affected by oil and gas waste (Lead, TPH, arsenic, barium and cadmium)

Terracon's work was performed in accordance with the approved Work Order for the site dated September 9, 2009. The objectives were to: 1) field stake the 8 NORM affected areas (NORM Areas) and 27 Lead and/TPH affected areas (Lead/TPH Areas) identified from the ESA activities to assist the remediation subcontractor (USA Environment, L.P) identify these areas for excavation; 2) delineate the final field determined extent of NORM and Lead/TPH affected areas using field instruments and/or laboratory samples; and 3) collect confirmation samples upon completion of excavation activities to ensure adequate removal of NORM and Lead/TPH affected soil.

## **2.0 NORM AREAS**

### **2.1 Surface delineation of NORM areas**

Arun Neupane of Terracon met with the representatives of USA Environmental, L.P. (USA) and the RRC on September 2009 to assess site-clearing needs and to test the use of GPS in locating previously identified NORM areas. A georeferenced site map indicating locations of the eight previously identified NORM areas was loaded in to a Trimble Geo XT GPS Unit (GPS). The GPS Unit was used to navigate to area NA-1 where USA's radiation safety officer accompanied Terracon's on-site representative to this location and USA performed a preliminary NORM survey of the area using their gamma ray scintillator. Gamma radiation exposure rates (NORM readings) up to 100 micro Roentgens per hour ( $\mu\text{R/hr}$ ) were detected at this location verifying the previously identified NORM impacted area was found. This method of field locating the previously identified NORM-impacted areas from the ESA was replicated to identify areas for excavation. All NORM areas were surface delineated in this manner and the area was outlined with paint and/or stakes to assist the excavation crew. These areas were labeled Norm Area -1 through 9 (NA-1 through NA-9) and are shown on Figure 2. While delineating NA-8, a separate nearby area (exhibiting NORM readings up to 200  $\mu\text{R/hr}$ ) was discovered. This area was brought to RRC's attention and designated "NA-7".

The above described procedure delineated the surface area of each NORM impacted area. Many of these areas grew in size as discussed below as the underlying soil was exposed during excavation.

### **2.2 Excavation and additional delineation of NORM affected soil**

USA excavated the NORM impacted areas using a track-mounted excavator (trackhoe). To facilitate shallow excavation (typically 6 inches at a time) a four-inch metal plate was welded across the teeth of the excavator bucket. After the initial 6-inch excavation in each area, USA's radiation safety officer surveyed the bottom of the excavation and sidewalls for NORM and the NORM readings were recorded. A second round of excavation (over-excavation) took place at the bottom of the excavation and/or the sidewalls where NORM readings exceeded 30  $\mu\text{R/hr}$ . Once it was confirmed that the bottom and the sidewalls were below 30  $\mu\text{R/hr}$ , excavation was stopped and the final limit of the excavation recorded using GPS.

Care was exercised to not over-excavate; therefore the excavation depth varied within each excavation. Typically, the excavation depths varied between 0.5 to 2.5 feet below ground surface (bgs). The approximate excavation depths for the NORM impacted areas are presented in Table 1 and their horizontal extent shown on Figure 3.

The soils at a depth of 0.5 to 1 foot bgs typically exhibited NORM readings higher than at the

ground surface. As a result, all of the NORM excavation areas expanded into larger areas than initially indicated by the surface readings.

NORM impacted soils were fully delineated on all sides within each NORM excavation except areas NA-7 and NA-9. NORM area NA-9, located at the southwestern corner of the site, adjoins the COH Pump Station to the west. Excavation was continued up to the fence that separates this area from the COH Pump Station property. NORM readings up to 100  $\mu\text{R/hr}$  were detected under the fence (western sidewall of excavation NA-9). Similarly, NORM readings up to 50  $\mu\text{R/hr}$  were detected in NA-7 along the southern sidewall of this excavation, where it abuts the Manufacturing Building. Due to the presence of the concrete building slab, excavation NA-7 was terminated at the edge of the building.

The excavation limitations at NA-7 and NA-9 were discussed with the on-site RRC representative and it was decided to collect a sample from the western sidewall of NA-9 for NORM analysis for future use.

NORM excavated soils were stockpiled in approximately 10-cubic-yard stockpiles next to their excavation on visqueen plastic. USA performed the stockpiling, and characterization of NORM waste. Waste Manifests for the NORM affected soil are included in Appendix C. A total of 565 cubic yards (truck yards) of NORM affected soil was removed from the site and transported to a certified disposal facility in Idaho.

### **2.3 NORM excavation confirmation samples**

The confirmation-sampling program for NORM consisted of collecting one or more confirmation samples from each excavation for laboratory analyses. The confirmation samples were analyzed for Ra-226 using EPA test method 901.1M. The number of confirmation samples collected from each excavation area was based on the size of the excavation. One confirmation sample was collected from each of the NORM areas NA-1 and NA-3 through NA-8. Two or more confirmation samples were collected from NORM areas NA-7 and NA-9. All confirmation samples were collected from the bottom of the excavation, except for sample NA-9(3), which was collected from the sidewall under the fence line that separates this excavation from the adjacent COH Pump Station.

The confirmation samples were collected using a stainless steel hand auger or a shovel, placed in clean laboratory-supplied Murenelli containers, and shipped to American Radiation Services (ARS) in Port Allen, Louisiana for radiochemistry analysis. The results of the radiochemistry analysis are provided in Table 1. A copy of the analytical report and chain-of-custody form is included in Appendix B.

The results of the radiochemistry analysis showed that all confirmation samples exhibited Radium-226 radioactivity concentration below 30 pCi/g, with the exception of sample NA-9(3). As discussed above, sample NA-9 was collected from the western sidewall abutting the adjacent COH Pump Station site. Based on these results it appears that the NORM affected soil extends onto the adjacent COH Pump Station site to an approximate depth of at least 2 feet bgs.

### **3.0 LEAD AND TPH AREAS**

Most of the areas previously identified as being affected had elevated lead concentrations exceeding the PCL. Areas identified as being TPH affected (and arsenic, barium, and cadmium affected) were limited. These lead and/or TPH affected areas collectively comprised the 27 areas identified for remediation.

#### **3.1 Field delineation of Lead and TPH affected soil**

As with the NORM affected areas, efforts first focused on field staking the 27 locations designated for excavation in Terracon's November 2008 report. The site was overgrown at the time of excavation and there was little evidence remaining of the previous boring locations. To field establish the areas requiring excavation, a georeferenced site map with the lead and TPH affected areas to be excavated was loaded in a GPS unit. Many of the 27 locations (points) were navigated to within 3-4 feet, where the pin flags from the previous investigations were found in some instances. The 27 locations were marked with paint and/or stakes. Due to overgrown vegetation, in some of the areas it proved more efficient to mobilize USA's excavation/land clearing crew together with the GPS.

An InnoVex XRF Analyzer (XRF) was used to assist with field delineation of the lead affected areas. An organic vapor monitor (OVM) equipped with a photoionization detector (PID) was used for field delineation of the TPH affected areas. Other field screening methods like observation for color and odor were also used as a part of TPH delineation. The field delineation instruments were calibrated in accordance with the instrument manufacturer's recommendations prior to the start of the fieldwork. In order to establish that data obtained from the XRF was reliable, USA collected two soil samples with known XRF readings and analyzed each for lead. One of the two samples was collected from an area that was relatively unaffected. USA's measured lead concentrations for these two samples were 326 mg/Kg and 3,777 mg/Kg. These analytical results corresponded closely with the XRF values which were 261 ppm and 3,426 ppm, respectively.

As was experienced with the NORM excavations, the soils at a depth of 0.5 to 1 feet bgs typically exhibited higher concentrations than at the ground surface. As a result, final excavation areas were typically larger than initially indicated by the surface readings.

The clean up level for lead was 500 mg/Kg, which is the Texas Risk Reduction Program (TRRP)

health-based ( $T^{Tot}Soil_{Comb}$ ) PCL for lead. Soils that exhibited a reading above 500 mg/Kg when scanned using the XRF were excavated and removed or identified as affected soils during the delineation process.

### **3.2 Excavation and additional delineation of lead and TPH affected soil**

Once the lead and TPH areas were marked in the field, excavations began, generally centered on these locations. For the larger anticipated areas of excavation, test pits were first excavated in a concentric pattern around the marked location to assist with delineation. This approach also helped plan and stage the stockpiles in a manner that allowed access for the machinery and haul trucks.

Terracon's on-site representative assisted the excavation crew by delineating the required limits and depth of excavation based on the field screening methods discussed above. The XRF was used to scan the soil for lead at typically 4 to 6 spots at the ground surface and on the sidewalls. Initial excavation in each marked area included removal of first layer of soil (typically 0.5 to 1 foot bgs), followed by XRF screening to assess the need for further excavation. Excavation continued until lead concentration readings dropped below 500 mg/Kg.

As some of the excavation areas expanded in size, they overlapped others, resulting in 15 contiguous excavation areas (designated e1 through e15 on Figures 2 and 4). The depth of excavation varied from 1 to 2.5 feet bgs, and is tabulated by area on Figure 4.

Excavation "e1" was the largest, with a final surface area of approximately 24,000 square feet. Typically, a reddish brown layer of fill material extended from 0.5 to 1.5 feet bgs in excavation "e1", followed by a hardened dark gray cement-like material at a depth between 1.5 to 2.5 bgs. Both of these layers exhibited very high concentrations of lead (up to 5000 mg/kg) when scanned using the XRF. Similar surface lithology was also encountered in other excavations, but to a lesser extent. The high lead concentrations in area "e1" continued laterally towards the south and the north as shown on Figure 4 by dotted line, but were not excavated. The area to the south was a busy route into the property for trucks that hauled off the stockpiled soil and delivered backfill. The RRC decided to forego excavating these areas at this time.

Similarly, excavation "e14", which was a shallower excavation than "e1", could not be completed to the north (see Figure 4). Like for excavation "e1", the approximate extent of the area north of excavation "e14" was delineated using test pits. As with the area south of e1, this area was also the truck route for accessing stockpiles and delivering backfill material to the northern and eastern excavations, and the RRC decided to forego further excavation at this time.

Excavations "pr" and "pr1", located in the northeastern portion of the site where the pipe racks are located were the shallowest of the 15 excavations for lead and TPH. Excavation was limited to the

open space between the pipe racks, since the pipe racks are still there. Lead was detected at some of the pipe rack locations (at concentrations up to 10,000 mg/Kg) and typically extended approximately 0.5 to 1.00 feet bgs.

Excavations "e10" and "e11" were conducted inside the Rattler Building 2; however, these excavation areas were limited due to interference by the building structure and the presence of concrete slabs in this area. Based on our field observations it appears that lead and TPH affected soils are still present in this area and extend under the concrete slabs. Sidewall samples were collected from the limits of excavations "e10" and "e11" as an indication of what may continue beyond the currently delineated extent. A summary of the laboratory results are presented in Table 2.

Excavated lead affected soils were stockpiled next to excavations in approximately 20-cubic-yard stockpiles.

USA performed the stockpiling, characterization, and off-site disposal/recycling of the lead and TPH affected soil. Waste Manifests are included in Appendix C. A total of 6,780 cubic yards (truck yards) of lead and TPH affected soil was removed from the site and transported to Houston Product Processor's (HPP) facility in Houston.

It should be noted that the random, end-dumped piles of fill material present at the site (further described in Terracon's site assessment report for this project) have not been removed. Excavation avoided these areas as it was the determination of the RRC that these soil mounds were outside their jurisdiction, which is limited to the cleanup of Oil and Gas waste and of Oil and Gas NORM waste.

### **3.3 Lead and TPH excavation confirmation samples**

The confirmation sampling program for lead, TPH, and other metals (arsenic, barium, and cadmium) consisted of collecting at least one sample from the bottom and the sidewalls of each excavation for laboratory analyses. The number of confirmation samples collected was higher for the larger excavations. The confirmation samples were analyzed for Lead using EPA test method 6020 and for TPH using TCEQ test method 1005. Select confirmation samples were analyzed for arsenic, barium and cadmium where these were the constituent of concern using test method 6020.

The confirmation samples were collected using a stainless steel hand auger or a shovel, placed in clean laboratory-supplied glass jars, and transported to Anacon's laboratory in Houston, Texas for analysis on an expedited turn around. The results of the confirmation analysis for lead, other metals (As, Ba, Cd), and TPH are summarized in Tables 2, 3, and 4, respectively. A copy of the analytical reports and chain-of-custody forms are included in Appendix B.

## Lead

Lead was detected above the cleanup level of 500 mg/Kg in 17 of the 168 confirmation samples collected at the site. The excavations that exhibited these elevated concentrations of lead were e1, e10, e11, e13, e14, e15, and pr1. The laboratory results were discussed with the RRC and it was concluded that, two of these excavations (pr1 and e14) were considered accessible enough to over-excavate where the exceedences were observed.

In excavation "pr1", lead was detected at concentrations exceeding the cleanup level in confirmation samples pr1-1 (929 mg/kg), pr1-7 (614 mg/kg), and pr1-9 (2,630 mg/kg). The areas represented by these samples were over-excavated until XRF scan readings showed lead concentration below 500 mg/Kg. Over-excavation confirmation samples were collected and analyzed from these three location and the results showed a drop in lead concentrations below 500 mg/Kg: pr1-1A (16.1 mg/kg), pr1-7A (7.46 mg/kg), and pr1-9A (11.9 mg/kg).

In excavation "e4", lead was detected at a concentration of 819 mg/Kg in confirmation sample e14-b4. The area represented by this sample was over-excavated until XRF scan reading showed a lead concentration below 500 mg/Kg. An over-excavation confirmation sample (e14-b4A) was collected and analyzed from this location and the result showed a drop in lead concentration to 6.79 mg/Kg.

In excavations "e10" and "e11", lead was detected at concentrations exceeding the clean up level at 571 mg/Kg and 2070 mg/Kg in confirmation samples e10-e1 and e11-e1, respectively. Excavations "e10" and "e11" were within Rattler Building 2, and therefore, could not be over-excavated as explained earlier.

In excavation "e15", lead was detected at a concentration exceeding the clean up level at 834 mg/Kg in one of the ten confirmation samples collected. Excavation "e15" adjoins the northern side of the Manufacturing Building, and therefore, could not be over-excavated as explained earlier.

The remaining confirmation samples that exceeded the cleanup level were in excavations "e13" and "e1". The areas represented by these confirmation samples were not over-excavated because they are located within the areas delineated for possible future excavation north and south of excavation area "e1" as discussed in Section 3.2 (marked by dotted lines on Figure 4).

## TPH

The clean up level established for TPH was 4,280 mg/Kg, which is the site-specific TRRP Tier 1 PCL for the total TPH mixture, calculated during Terracon's November 2008 ESA.

Confirmation samples for TPH exceeded the site-specific cleanup level in four of the samples: e10-e1 (15,698 mg/Kg), e11-e1 (23,183 mg/Kg), e11-w1 (4,640 mg/Kg), e15-s3 (6,075 mg/Kg). As discussed earlier, these samples were collected from excavations within the Rattler Building 2, adjacent to the north side of the Manufacturing Building, and therefore, could not be over-excavated due to building interference as explained in Section 3.2. These sample results are an indication of TPH contamination that may continue in the Manufacturing Building.

#### Other Metals (As, Ba, Cd)

The clean up levels established for arsenic, barium, and cadmium were 24 mg/Kg, 8000 mg/Kg, and 52 mg/Kg, respectively. Like with lead, these are the health-based ( $T^{ot}Soil_{Comb}$ ) PCLs established under TRRP to protect potential receptors from the combined exposures due to the inhalation of volatile emissions and particulates, dermal contact, and/or ingestion.

Barium and cadmium were not detected in confirmation samples at concentration exceeding their clean up level. Arsenic was detected at a concentration exceeding its clean up level at 47 mg/Kg in one confirmation sample, e9-w6, collected from the western edge of excavation "e9". The detected concentration for arsenic exceeded its cleanup level of 22 mg/Kg. As discussed earlier in Section 2.3, excavation "e9" adjoins the COH Pumping Station site to the west, and therefore, over-excavation in this direction was not undertaken.

#### **4.0 BACKFILLING AND SITE RESTORATION**

Upon receipt of passing confirmation sample results, the NORM excavations and lead and TPH excavations were backfilled with clean imported select fill material. The backfill material was compacted by USA using a dozer. It should be noted that although some of the sidewalls confirmation samples from these excavations exceeded the clean up levels as discussed earlier, none of the bottom samples did. Therefore, if further remedial excavation is planned in the future, it only needs to continue laterally.

#### **5.0 SUMMARY**

The cleanup work completed can be summarized as follows:

- Nine areas were delineated and excavated for NORM affected soils. A total of 565 cubic yards (truck yards) of NORM affected soil was characterized and disposed of by USA at a permitted facility in Idaho.
- NORM impacted soils were fully delineated on all sides within each NORM excavation except areas NA-7 and NA-9. NORM area NA-9, located at the southwestern corner of the

site, adjoins the COH Pump Station to the west. Excavation was continued up to the fence that separates this area from the COH Pump Station property. NORM readings up to 100  $\mu\text{R/hr}$  were detected under the fence (western sidewall of excavation NA-9). Similarly, NORM readings up to 50  $\mu\text{R/hr}$  were detected in NA-7 along the southern sidewall of this excavation, which abuts the Manufacturing Building. Due to the presence of the concrete building slab, excavation NA-7 was terminated at the edge of the building.

- Seventeen contiguous areas were delineated and excavated for soils affected with lead, TPH, and other metals (arsenic, barium, and cadmium). A total of 6,780 cubic yards (truck yards) of lead and TPH affected soil was disposed of by USA at HPP's waste recycling facility in Houston Texas.
- In addition to the NORM affected soil discussed under bullet 1 above that could not be excavated, certain metals and TPH affected soil (in excavation areas "e1", "e9", "e10", "e11", "e13" and "e15") similarly could not be excavated. This was due to either having reached the site boundary (in the case of "e1" and "e9"), disrupting needed access routes to the site ("e1"), or interference from the existing buildings (in the case of "e10", "e11" and "e15").
- All excavations were backfilled with clean imported select fill compacted with a dozer.

## 6.0 LIMITATIONS

Terracon's services were performed in a manner consistent with generally accepted practices of the profession following the scope of services requested by the RRC

Findings, conclusions, and recommendations resulting from these services are based upon information derived from the most recent on-site activities and other services performed under our authorized scope of work; such information is subject to change over time. Certain indicators of the presence of hazardous substances, petroleum products, or other constituents may have been latent, inaccessible, unobservable, nondetectable or not present during these services, and we cannot represent that the Site contains no hazardous substances, toxic materials, petroleum products, or other latent conditions beyond those identified during this site investigation. Subsurface conditions may vary from those encountered at specific borings or sampling points during other surveys, tests, assessments, investigations or exploratory services; the data, interpretations, and our recommendations are based solely upon data obtained at the time and within the scope of these services.

This report was prepared for the exclusive use of the RRC, and no other party shall have any right to rely on any services provided by Terracon without prior written consent.

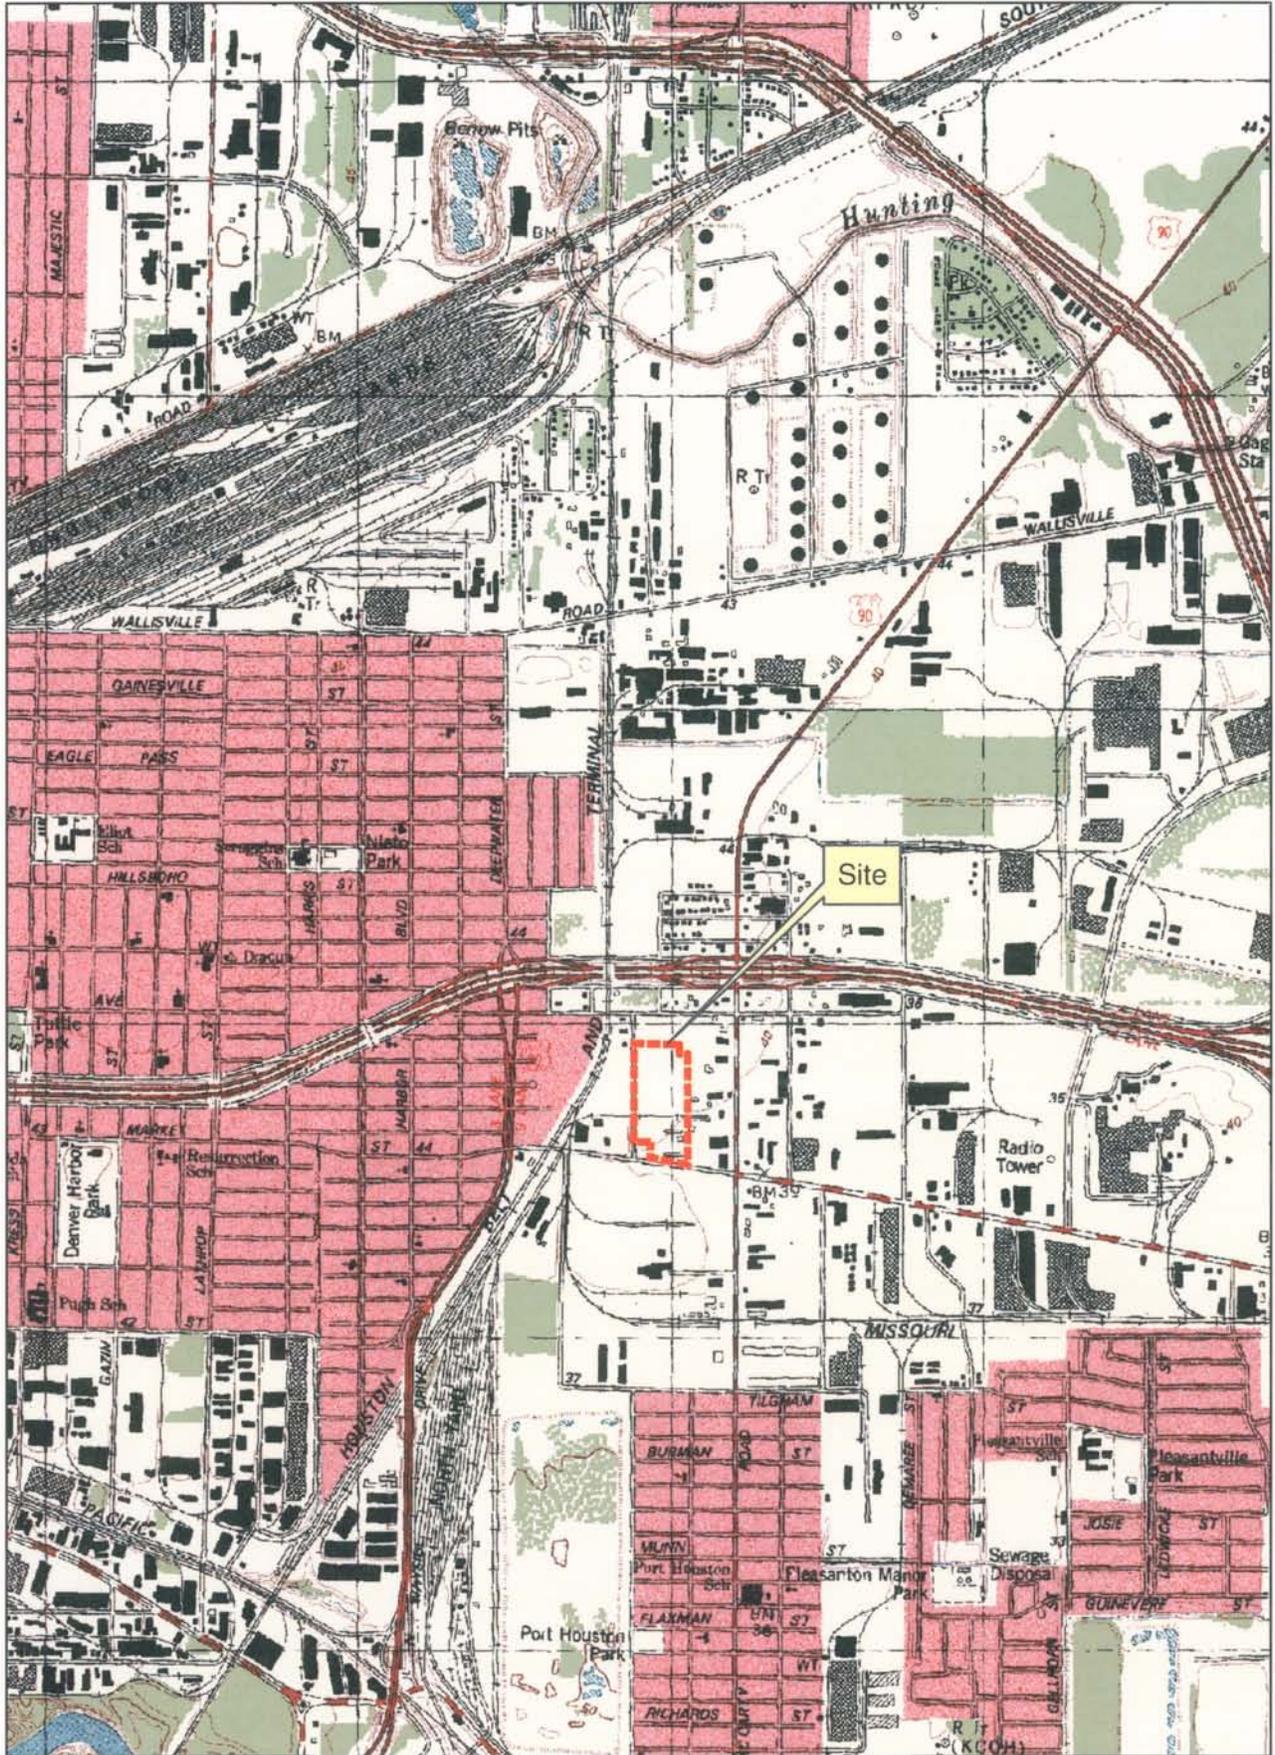
## **FIGURES**

**Figure 1 – Site Vicinity Map**

**Figure 2 – Site Plan**

**Figure 3 - Final Limit of NORM Excavated Areas**

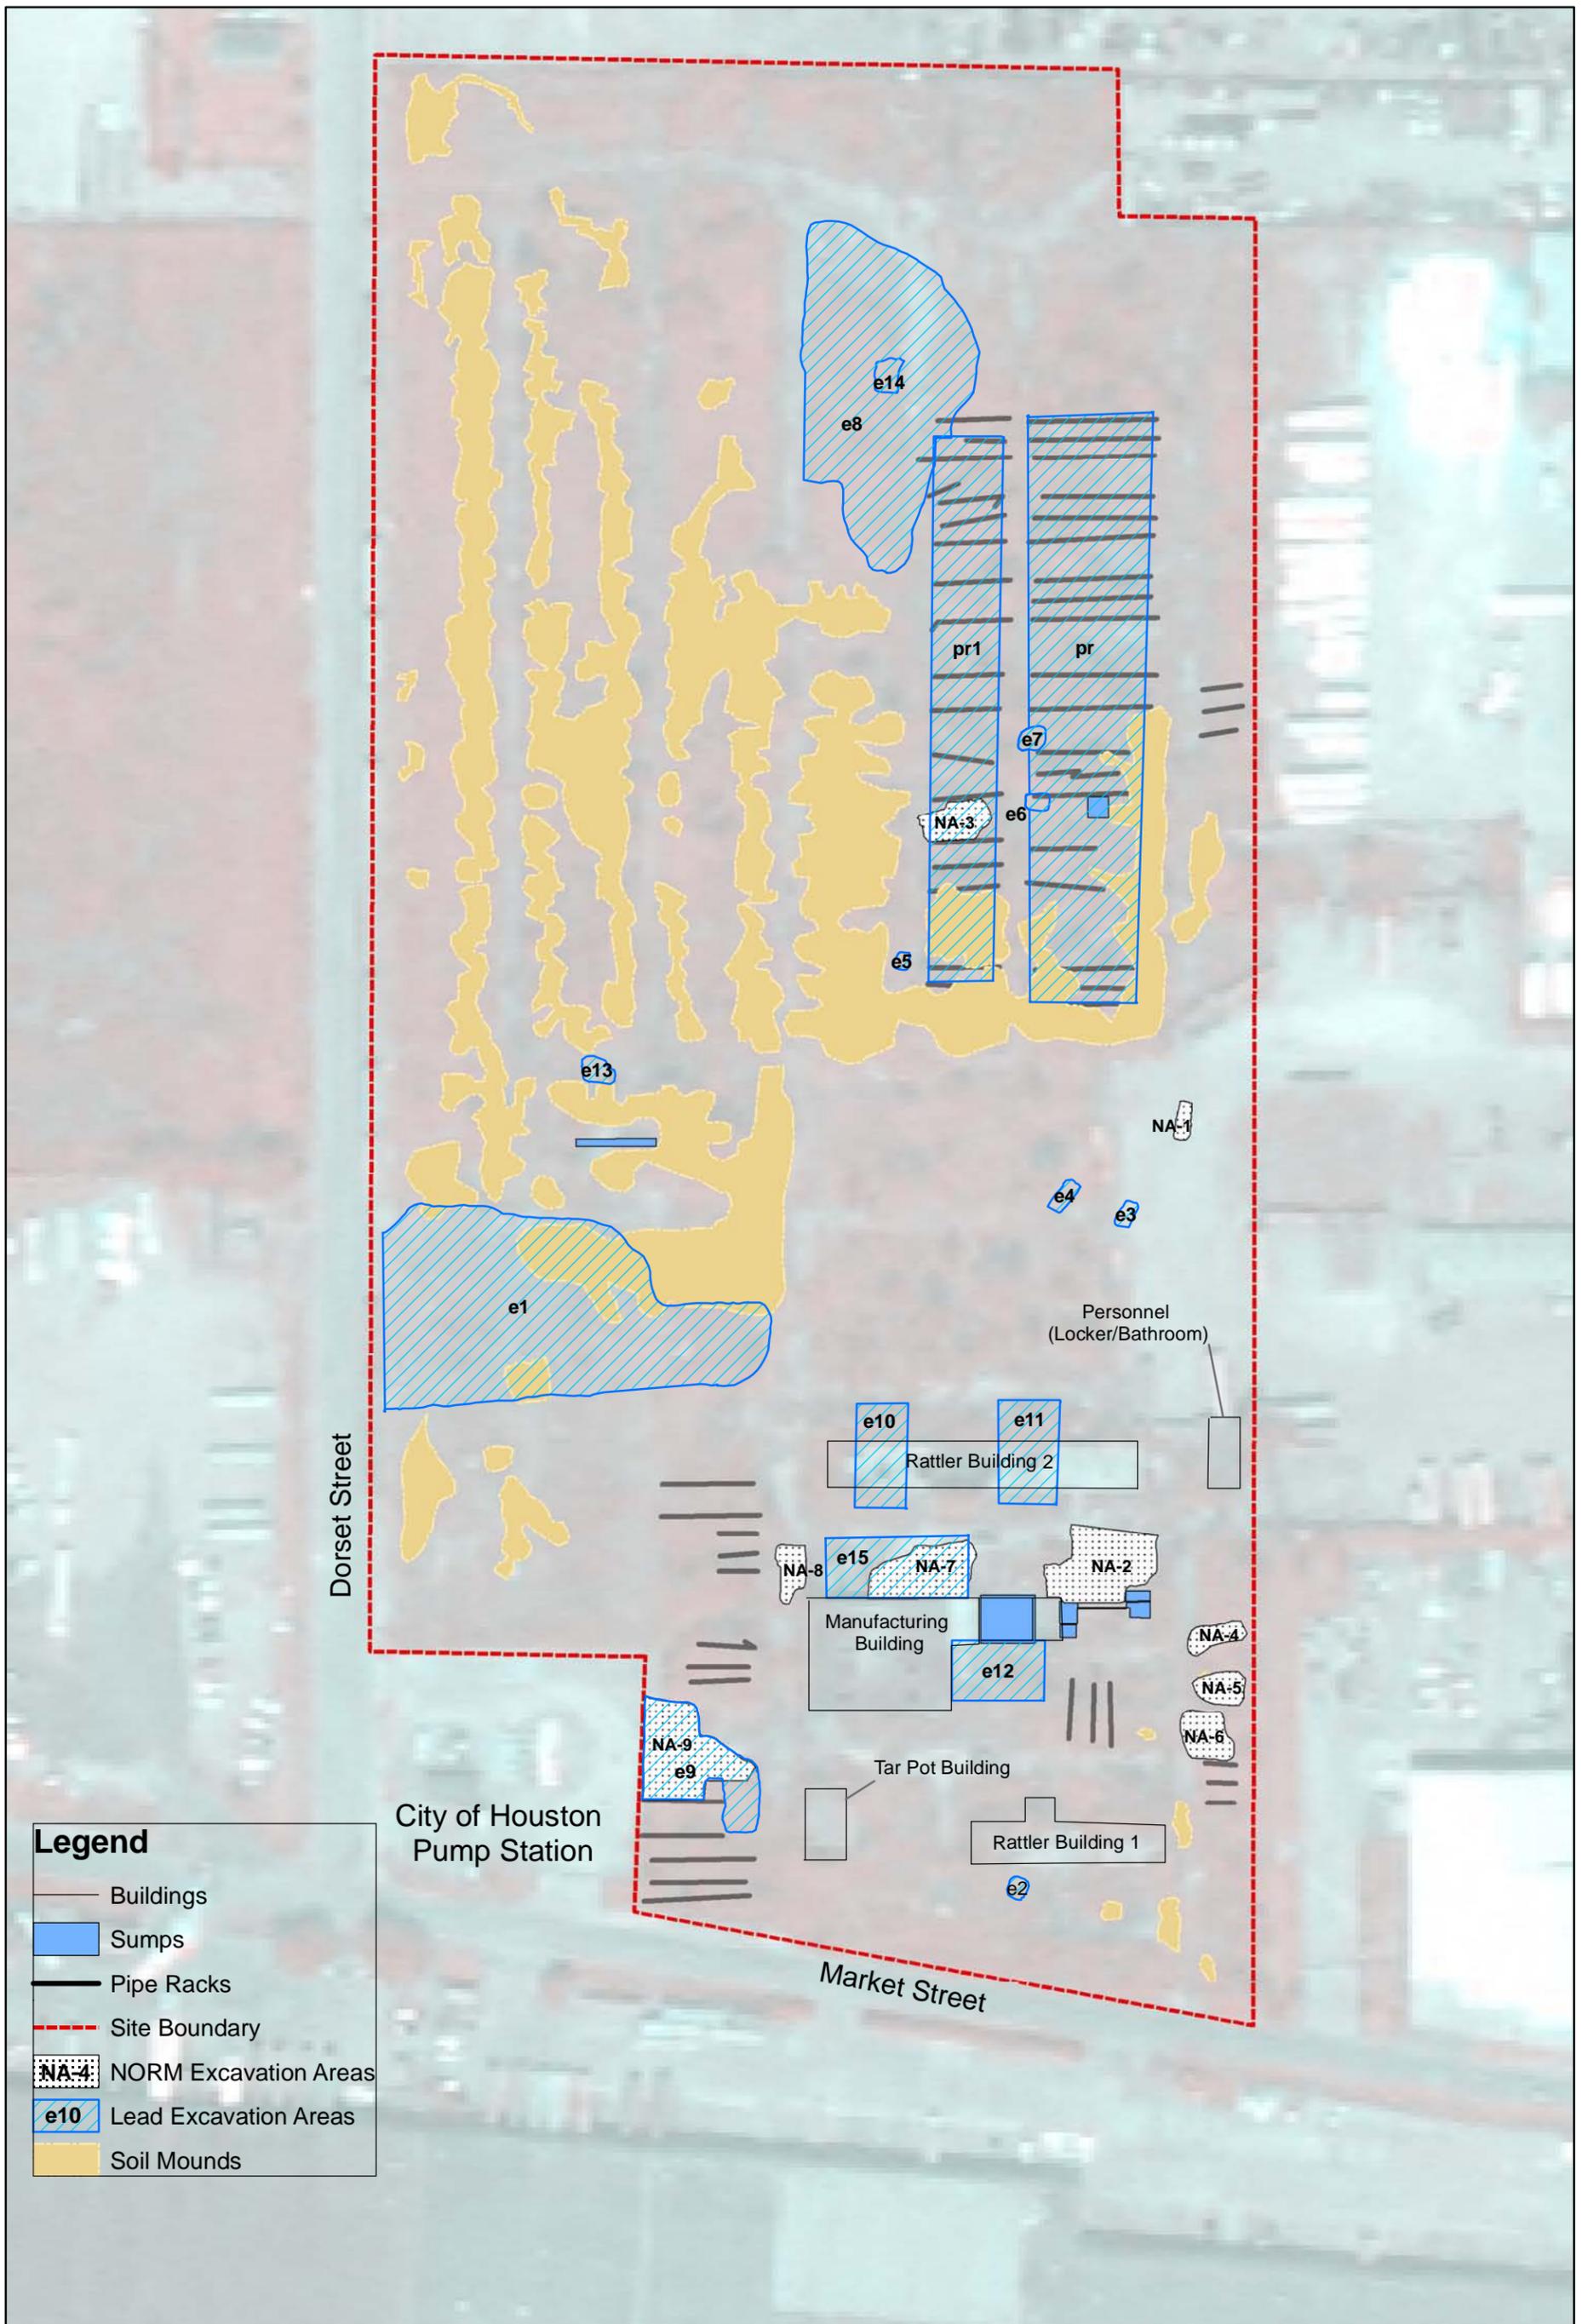
**Figure 4 - Final Limit of Lead and TPH Excavated Areas**



USGS Topographic Quadrangle Map  
 Settegast, Texas  
 USGS (1982)  
 Terracon No. 92097378



Figure 1  
 Site Vicinity Map  
 Former Cactus Pipe & Supply Facility  
 815 Dorset Street  
 Houston, Harris County, Texas



**Legend**

-  Buildings
-  Sumps
-  Pipe Racks
-  Site Boundary
-  NA-4 NORM Excavation Areas
-  e10 Lead Excavation Areas
-  Soil Mounds

0 25 50 100  
 Feet  
 1 inch = 100 feet



Terracon No.	92097378	CHECKED BY:	AN
		SCALE:	1 inch = 100 feet
		DATE:	12-8-2009

**Figure 2  
 Site Plan**  
 Former Cactus Pipe & Supply Facility  
 815 Dorsett Street  
 Houston, Harris County, Texas



**Legend**

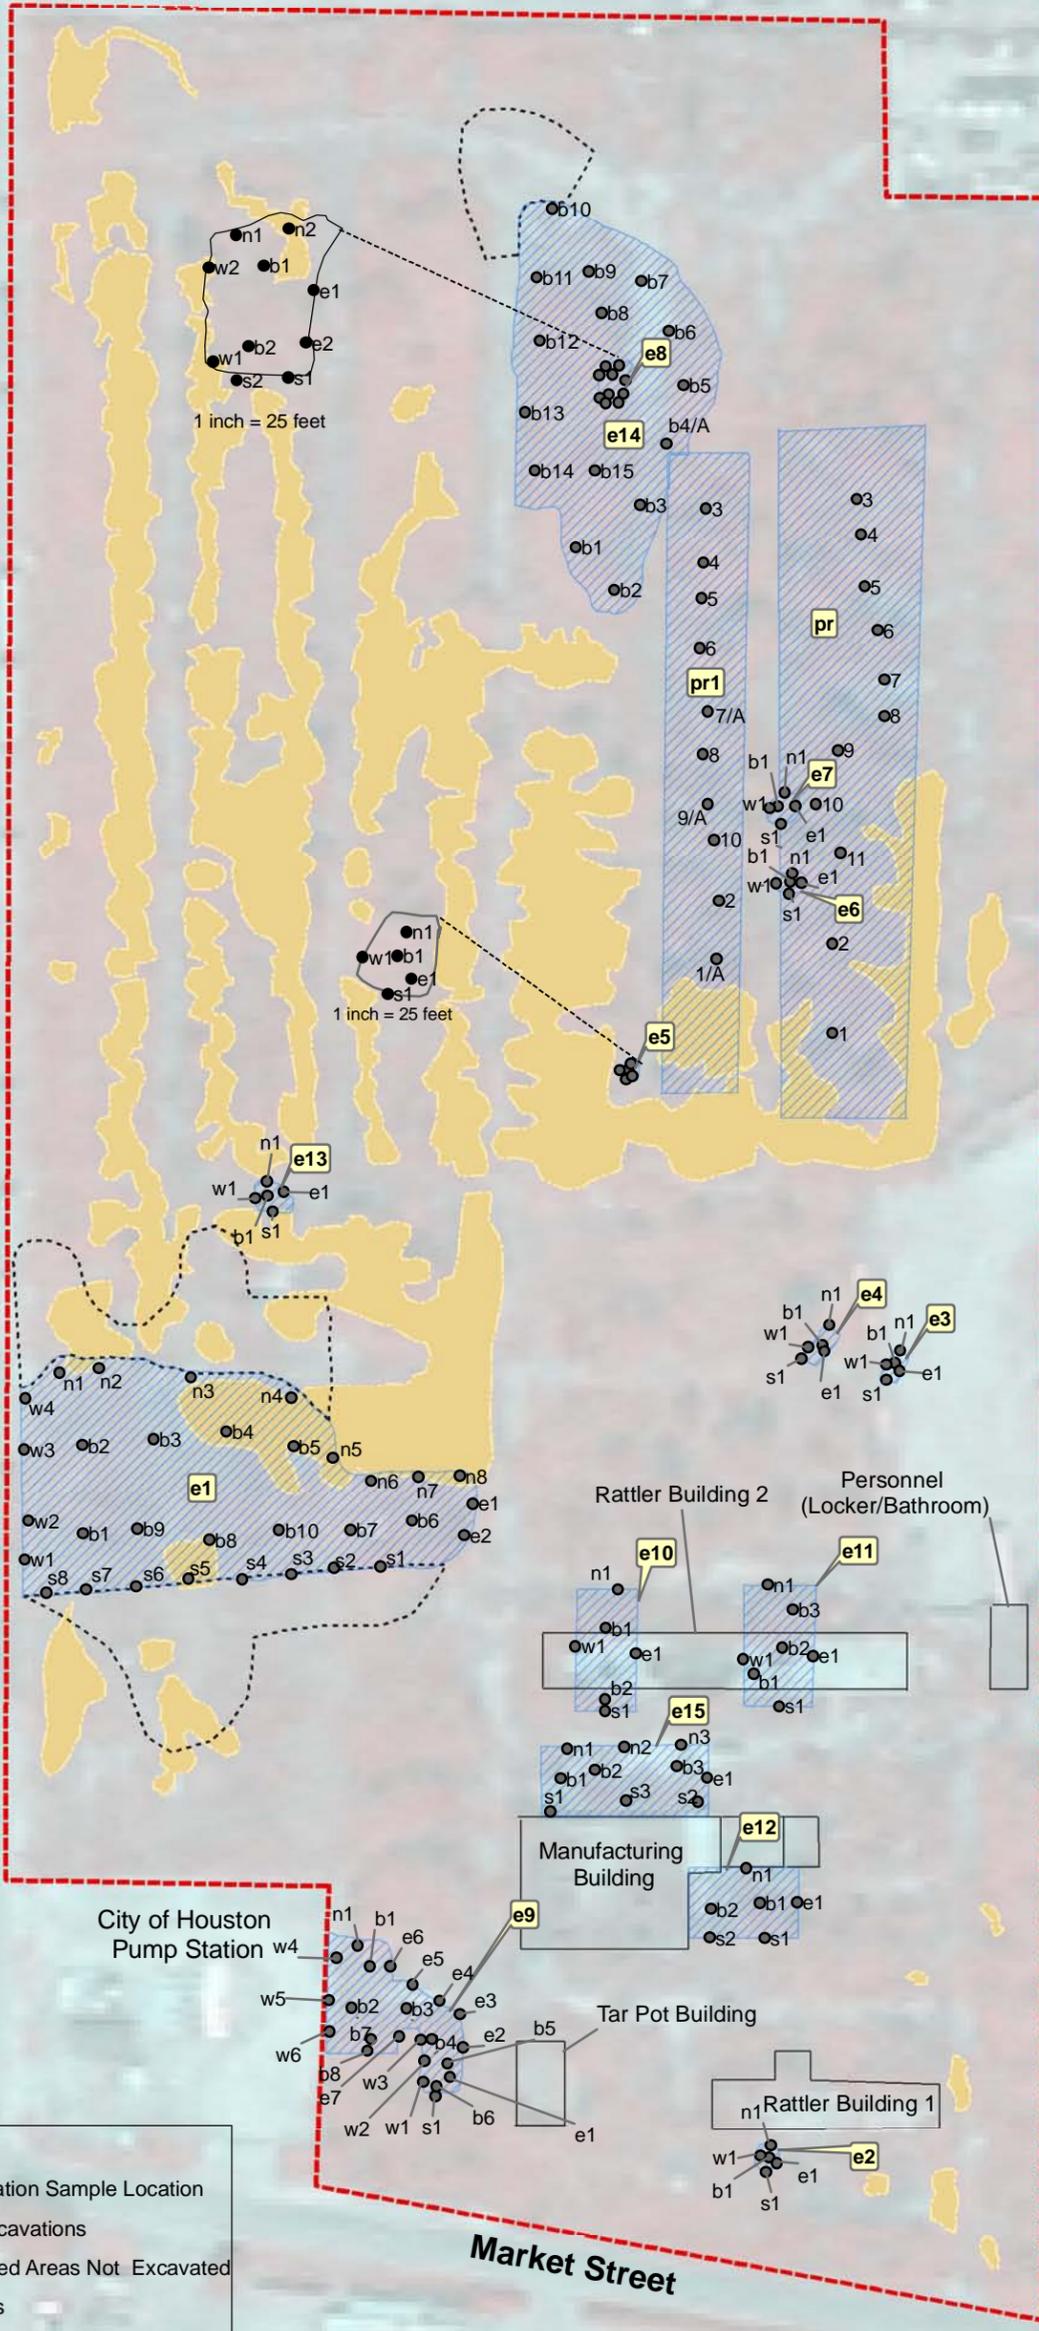
- NORM Excavation Areas
- NORM Sample Points
- Buildings
- Pipe Racks
- Soil Mounds

0 25 50 100  
 Feet  
 1 inch = 100 feet



		CHECKED BY: AN	
		SCALE: 1 inch = 100 feet	
		DATE: 12-8-2009	
Terracon No.	92097378		

**Figure 3**  
**Final limit of NORM excavated areas**  
 Former Cactus Pipe & Supply Facility  
 815 Dorsett Street  
 Houston, Harris County, Texas

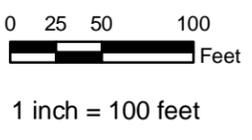


Excavation	Approximate Depth (ft)	Final Area (sq.ft)
e1	2.5	23,699
e2	2.5	154
e3	2.5	159
e4	2.5	216
e5	2.5	97
e6	2.5	158
e7	2.5	223
e8	2.5	318
e9	2.5	3,763
e10	1.5	2,208
e11	1.5	2,569
e12	2.5	2,297
e13	2.5	290
e14	1 to 1.5	17,293
e15	2.5	2,813
pr	1 to 1.5	28,103
pr1	1 to 1.5	15,044

**Legend**

- Confirmation Sample Location
- ▨ Lead Excavations
- ⋯ Delineated Areas Not Excavated
- ▭ Buildings
- Soil Mounds

Note: Sample IDs shown in the map are abbreviated: actual IDs are preceded by the excavation number ("n1" in excavation "e1" is the sample "n1-e1")



Terracon No. 92097378

CHECKED BY:	AN
SCALE:	1 inch = 100 feet
DATE:	12-8-2009

**Figure 4**  
Final limit of lead and TPH excavated areas

Former Cactus Pipe & Supply Facility  
815 Dorsett Street  
Houston, Harris County, Texas

## **TABLES**

**Table 1 - Summary of Soil Analytical Results-NORM**

**Table 2 - Summary of Soil Analytical Results-Lead**

**Table 3 - Summary of Soil Analytical Results-Arsenic, Barium, and Cadmium**

**Table 4 - Summary of Soil Analytical Results-TPH**

**TABLE 1**

**Summary of Soil Analytical Results (NORM)  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

Sample Location *	Sample Date	Radioactivity Concentration (in pCi/g) (EPA 901.1 M)			Approximate Depth of Excavation (ft)
		Ra-226	Ra-228	Total Activity	
NA-1	05/22/09	1.119	0.765	1.884	0.5 to 2.5
NA-2(1)	05/22/09	7.447	0.811	8.258	0.5 to 2.5
NA-2(2)	05/22/09	2.706	0.864	3.57	
NA-3	05/22/09	2.113	0.839	2.952	0.5 to 2.5
NA-4	05/26/09	1.800	0.879	2.679	1.5
NA-5	05/28/09	2.394	0.966	3.36	0.5 to 2
NA-6	05/26/09	1.293	0.774	2.067	0.5 to 1
NA-7	05/28/09	1.727	0.736	2.463	1.5 to 2
NA-8	06/01/09	1.568	0.897	2.465	2 to 2.5
NA-9 (1)	05/26/09	1.800	0.944	2.744	2
NA-9 (2)	05/26/09	1.973	0.460	2.433	
*NA-9 (3)	05/26/09	<b>104.24</b>	1.955	106.195	
<b>RRC action level for delineation</b>		<b>30</b>	<b>30</b>	<b>150</b>	

Notes:

Value in **Bold Type** indicates exceedence of RRC action level for field delineation.

\* Sample collected from the bottom of excavation unless otherwise noted.

\*\* Soil sample NA-9(3) was collected from the sidewall under the fence line that separated this excavation from the adjacent COH Pump Station.

TABLE 2

Summary of Soil Analytical Results - Lead  
 Former Cactus Pipe and Supply Facility  
 815 Dorsett Street  
 Houston, TX

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	Lead (EPA 8020)
E1-B1	10/19/09	5.56
E1-B2	10/19/09	6.74
E1-B3	10/19/09	6.23
E1-B4	10/19/09	8.11
E1-B5	10/19/09	4.51
E1-B6	10/19/09	5.70
E1-B7	10/19/09	6.4
E1-B8	10/19/09	5.72
E1-B9	10/19/09	20.9
E1-B10	10/19/09	11.3
E1-N1	10/19/09	442
E1-N2	10/19/09	432
E1-N3	10/19/09	468
E1-N4	10/19/09	<b>1270</b>
E1-N5	10/19/09	<b>1160</b>
E1-N6	10/19/09	463
E1-N7	10/19/09	72.9
E1-N8	10/19/09	336
E1-S1	10/19/09	<b>541</b>
E1-S2	10/19/09	<b>1540</b>
E1-S3	10/19/09	<b>1240</b>
E1-S4	10/19/09	<b>3110</b>
E1-S5	10/19/09	48.2
E1-S6	10/19/09	80.5
E1-S7	10/19/09	<b>894</b>
E1-S8	10/19/09	<b>899</b>
E1-W1	10/19/09	51.4
E1-W2	10/19/09	129
E1-W3	10/19/09	5.67
E1-W4	10/19/09	351
E2-B1	10/15/09	8.79
E2-N1	10/15/09	26.3
E2-S1	10/15/09	5.80
E2-E1	10/15/09	79.6
E2-W1	10/15/09	28.3
E3-B1	10/15/09	6.57
E3-N1	10/15/09	6.44
E3-S1	10/15/09	6.76
E3-E1	10/15/09	25.2
E3-W1	10/15/09	9.29
E4-B1	10/15/09	7.13
E4-N1	10/15/09	6.55
E4-S1	10/15/09	10.9
E4-E1	10/15/09	4.95
E4-W1	10/15/09	5.76
E5-B1	10/15/09	7.60
E5-N1	10/15/09	8.31
E5-S1	10/15/09	94.7
E5-E1	10/15/09	260
E5-W1	10/15/09	126
E6-B1	10/15/09	7.22
E6-N1	10/15/09	8.51
E6-S1	10/15/09	9.80
E6-E1	10/15/09	6.15
E6-W1	10/15/09	7.99
E7-B1	10/15/09	5.79
E7-N1	10/15/09	11.1
E7-S1	10/15/09	4.26
E7-E1	10/15/09	5.66
E7-W1	10/15/09	6.03
E8-B1	10/15/09	6.44
E8-B2	10/16/09	5.78
E8-N1	10/15/09	4.97
E8-N2	10/16/09	4.83
E8-S1	10/15/09	5.51
E8-S2	10/16/09	8.68
E8-E1	10/15/09	5.20
E8-E2	10/15/09	4.39
E8-W1	10/15/09	29.6

TABLE 2

**Summary of Soil Analytical Results - Lead  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	Lead (EPA 8020)
E8-W2	10/15/09	5.89
E9-B1	10/16/09	10.7
E9-B2	10/16/09	99.2
E9-B3	10/16/09	14.6
E9-B4	10/16/09	81.8
E9-B5	10/16/09	8.87
E9-B6	10/16/09	48.0
E9-B7	10/16/09	289
E9-N1	10/16/09	86.8
E9-S1	10/16/09	24.1
E9-S2	10/16/09	41.7
E9-E1	10/16/09	66.9
E9-E2	10/16/09	123
E9-E3	10/16/09	140
E9-E4	10/16/09	14.6
E9-E5	10/16/09	28.2
E9-E6	10/16/09	129
E9-E7	10/16/09	57.3
E9-W1	10/16/09	88.8
E9-W2	10/16/09	93.4
E9-W3	10/16/09	103
E9-W4	10/16/09	51.8
E9-W5	10/16/09	135
E9-W6	10/16/09	284
E10-B1	10/20/09	18.3
E10-B2	10/20/09	12.7
E10-N1	10/20/09	93.9
E10-S1	10/20/09	<b>653</b>
E10-E1	10/20/09	<b>571</b>
E10-W1	10/20/09	5.88
E11-B1	10/20/09	5.05
E11-B2	10/20/09	4.85
E11-B3	10/20/09	19.0
E11-N1	10/20/09	30.8
E11-S1	10/20/09	451
E11-E1	10/20/09	<b>2070</b>
E11-W1	10/15/09	20.9
E11-W2	10/15/09	420
E12-B1	10/20/09	6.15
E12-B2	10/20/09	11.8
E12-N1	10/20/09	44.9
E12-S1	10/20/09	7.52
E12-S2	10/20/09	68.6
E12-E2	10/21/09	6.75
E13-B1	10/21/09	8.74
E13-N1	10/21/09	182
E13-S1	10/21/09	<b>715</b>
E13-E1	10/21/09	493
E13-W1	10/21/09	9.40
E14-B1	10/21/09	196
E14-B2	10/21/09	141
E14-B3	10/21/09	176
E14-B4	10/21/09	<b>819</b>
E14-B4A	11/05/09	6.79
E14-B5	10/21/09	8.22
E14-B6	10/21/09	125
E14-B7	10/21/09	7.00
E14-B8	10/21/09	9.99
E14-B9	10/21/09	5.58
E14-B10	10/21/09	5.44
E14-B11	10/21/09	23.2
E14-B12	10/21/09	102
E14-B13	10/21/09	129
E14-B14	10/21/09	118
E14-B15	10/21/09	20.9
E15-B1	10/21/09	8.63
E15-B2	10/21/09	29.1
E15-B3	10/21/09	4.83

**TABLE 2**

**Summary of Soil Analytical Results - Lead  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	Lead (EPA 8020)
E15-N1	10/21/09	55.5
E15-N2	10/21/09	368
E15-N3	10/21/09	14.1
E15-S2	10/21/09	76.1
E15-S3	10/21/09	<b>834</b>
E15-E1	10/21/09	14.0
E15-W1	10/21/09	7.02
PR1-1	10/20/09	<b>929</b>
PR1-1A	11/05/09	16.1
PR1-2	10/20/09	194
PR1-3	10/20/09	410
PR1-4	10/20/09	9.77
PR1-5	10/20/09	169
PR1-6	10/20/09	9.96
PR1-7	10/20/09	<b>614</b>
PR1-7A	11/05/09	7.46
PR1-8	10/20/09	7.97
PR1-9	10/20/09	<b>2630</b>
PR1-9A	11/05/09	11.9
PR1-10	10/20/09	14.0
PR2-1	10/19/09	361
PR-2	10/20/09	134
PR-3	10/20/09	174
PR-4	10/20/09	151
PR-5	10/20/09	30.5
PR-6	10/20/09	75.3
PR-7	10/20/09	5.24
PR-8	10/20/09	231
PR-9	10/20/09	117
PR-10	10/20/09	6.59
PR-11	10/20/09	26.1
<b>TCEQ TRRP Tier1 Health-Based PCL for a 0.5 Acre source-area Residential Site</b>		<b>500</b>

Notes:

Values in **Bold Type** indicate exceedence of TCEQ TRRP Tier 1 Health-Based PCL for lead.

- TCEQ - Texas Commission on Environmental Quality
- EPA - Environmental Protection Agency
- TRRP - Texas Risk Reduction Program
- PCL - Protective Concentration Level
- Health Based PCL - PCL for Total Soil Combined Exposure Pathway (<sup>Tot</sup>Soil<sub>Comb</sub>)

**TABLE 3**

**Summary of Soil Analytical Results - Arsenic, Barium, and Cadmium  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	Arsenic (EPA 6020)	Barium (EPA 6020)	Cadmium (EPA 6020)
E1-W1	10/19/09	NA	NA	1.10
E3-B1	10/15/09	NA	NA	<0.100
E3-N1	10/15/09	NA	NA	<0.100
E3-S1	10/15/09	NA	NA	<0.100
E3-E1	10/15/09	NA	NA	0.23
E3-W1	10/15/09	NA	NA	<0.100
E9-B1	10/16/09	0.555	93.7	NA
E9-B2	10/16/09	5.05	529	NA
E9-B3	10/16/09	1.36	123	NA
E9-B4	10/16/09	2.66	176	NA
E9-B5	10/16/09	0.927	99.4	NA
E9-B6	10/16/09	1.11	81.9	NA
E9-B7	10/16/09	3.89	348	NA
E9-N1	10/16/09	5.43	454	NA
E9-S1	10/16/09	4.32	133	NA
E9-S2	10/16/09	4.09	416	NA
E9-E1	10/16/09	2.01	144	NA
E9-E2	10/16/09	2.69	211	NA
E9-E3	10/16/09	3.41	321	NA
E9-E4	10/16/09	1.04	78.0	NA
E9-E5	10/16/09	1.59	176	NA
E9-E6	10/16/09	7.23	682	NA
E9-E7	10/16/09	2.89	411	NA
E9-W1	10/16/09	2.69	255	NA
E9-W2	10/16/09	2.73	186	NA
E9-W3	10/16/09	2.66	353	NA
E9-W4	10/16/09	3.36	355	NA
E9-W5	10/16/09	9.36	1140	NA
E9-W6	10/16/09	<b>147</b>	2180	NA
<b>TCEQ TRRP Tier1 Health-Based PCL for a 0.5 Acre source-area Residential Site</b>		<b>24</b>	<b>8000</b>	<b>52</b>

Notes

Values in **Bold Type** indicate exceedence of TCEQ TRRP Tier 1 Health-Based PCL for the metal.

- TCEQ - Texas Commission on Environmental Quality
- EPA - Environmental Protection Agency
- TRRP - Texas Risk Reduction Program
- PCL - Protective Concentration Levels
- Health Based PCL - PCL for Total Soil Combined Exposure Pathway ( $^{Tot}Soil_{Comb}$ )
- < - not detected at concentrations above the sample detection limit (SDL)
- NA - not analyzed

**TABLE 4**

**Summary of Soil Analytical Results - TPH  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	TPH (TX 1005)		
		C <sub>6</sub> to C <sub>12</sub> Carbon Range	C <sub>12</sub> to C <sub>35</sub> Carbon Range	Total TPH
E2-B1	10/15/09	<50.0	<50.0	<50.0
E2-N1	10/15/09	<50.0	<50.0	<50.0
E2-S1	10/15/09	<50.0	<50.0	<50.0
E2-E1	10/15/09	<50.0	<50.0	<50.0
E2-W1	10/15/09	<50.0	<50.0	<50.0
E7-B1	10/15/09	<50.0	<50.0	<50.0
E7-N1	10/16/09	<50.0	<50.0	<50.0
E7-S1	10/16/09	<50.0	<50.0	<50.0
E7-E1	10/16/09	<50.0	<50.0	<50.0
E7-W1	10/16/09	<50.0	<50.0	<50.0
E10-B1	10/20/09	<50.0	<50.0	<50.0
E10-B2	10/21/09	<50.0	<50.0	<50.0
E10-N1	10/20/09	<50.0	<50.0	<50.0
E10-S1	10/20/09	<50.0	627	627
E10-E1	10/20/09	398	15300	<b>15698</b>
E10-W1	10/20/09	<50.0	<50.0	<50.0
E11-B1	10/20/09	<50.0	2230	2230
E11-B2	10/20/09	<50.0	<50.0	<50.0
E11-B3	10/21/09	<50.0	<50.0	<50.0
E11-N1	10/22/09	<50.0	<50.0	<50.0
E11-S1	10/20/09	<50.0	<50.0	<50.0
E11-E1	10/20/09	383	22800	<b>23183</b>
E11-W1	10/20/09	<50.0	4680	<b>4680</b>
E11-W2	10/21/09	<50.0	<50.0	<50.0
E12-B1	10/20/09	<50.0	<50.0	<50.0
E12-B2	10/20/09	<50.0	<50.0	<50.0
E12-S1	10/20/09	<50.0	<50.0	<50.0
E12-E2	10/21/09	<50.0	<50.0	<50.0
E15-B1	10/21/09	<50.0	<50.0	<50.0
E15-B2	10/21/09	<50.0	<50.0	<50.0
E15-B3	10/21/09	<50.0	<50.0	<50.0
E15-N1	10/21/09	<50.0	<50.0	<50.0
E15-N2	10/21/09	<50.0	<50.0	<50.0
E15-N3	10/22/09	<50.0	788	788
E15-S1	10/21/09	<50.0	<50.0	<50.0
E15-S2	10/21/09	81.0	2650	2731

**TABLE 4**

**Summary of Soil Analytical Results - TPH  
Former Cactus Pipe and Supply Facility  
815 Dorsett Street  
Houston, TX**

(all concentrations are in milligrams per kilogram)

Sample Location	Sample Date	TPH (TX 1005)		
		C <sub>6</sub> to C <sub>12</sub> Carbon Range	C <sub>12</sub> to C <sub>35</sub> Carbon Range	Total TPH
E15-S3	10/21/09	305	5770	<b>6075</b>
E15-E1	10/21/09	<50.0	1570	1570
E15-W1		<50.0	<50.0	<50.0
E9-E1	10/16/09	2.01	144	146.01
E9-E2	10/16/09	2.69	211	213.69
E9-E3	10/16/09	3.41	321	324.41
E9-E4	10/16/09	1.04	78.0	79.04
E9-E5	10/16/09	1.59	176	177.59
E9-E6	10/16/09	7.23	682	689.23
E9-E7	10/16/09	2.89	411	413.89
E9-W1	10/16/09	2.69	255	257.69
E9-W2	10/16/09	2.73	186	188.73
E9-W3	10/16/09	2.66	353	355.66
E9-W4	10/16/09	3.36	355	358.36
E9-W5	10/16/09	9.36	1140	1149.36
E9-W6	10/16/09	147	2180	2327
<b>Calculated TRRP Tier 1 Residential PCL (Surface Soil) - <sup>TOT</sup>Soil<sub>COMB</sub><sup>1</sup></b>				<b>4,280</b>

Notes:

Values in **Bold Type** indicate exceedence of site-specific Total TPH PCL.

1 - The PCL is the lowest of four site-specific TPH-Mixture Specific values calculated during the preceeding site assessment conducted by Terracon. Appendix B includes excerpts from that report that contain the relevent worksheets for this calculation.

- TPH - Total Petroleum Hydrocarbons
- TRRP - Texas Risk Reduction Program
- PCL - Protective Concentration Levels

## **APPENDIX A**

### **Site Photographs**



Photo 1 Shallow NORM Excavation



Photo 2 Approximate 10 cubic yard stockpiles for NORM



Photo 3 NORM stockpiles lined with polythene sheets



Photo 4 NORM survey conducted by USA crew at NA-7



Photo 5 NORM meter displaying an elevated value



Photo 6 NORM area NA-9 with COH Pump Station property on right



**Photo 7** Portion of Lead Excavation e1 showing clean soil at final depth



**Photo 8** Excavation e1 showing bentonite-like material at 1-1.5 feet bgs



**Photo 9** Excavation e1 showing property line fence to right



**Photo 10** View of excavation depth



**Photo 11** View of test pit showing reddish brown material and XRF



**Photo 12** Loading of affected soils for off-site disposal



**Photo 13** View of backfill material



**Photo 14** View of backfilled material being compacted.

**APPENDIX B**

**ANALYTICAL LABORATORY REPORTS**



2609 North River Road, Port Allen, Louisiana 70767  
(800) 401-4277 -- FAX (225) 381-2996

## American Radiation Services, Inc.

### Laboratory Analysis Report

**ARS1-09-02455**

*Prepared for:*

**Anacon, Inc.**

**Melissa Knight**

**730 FM 1959**

**Houston, TX 77034**

**melissa.knight@anaconlab.com**

**aneupane@terracon.com**

**Phone: 281-922-7000**

**Fax: 281-481-0089**

  
Project Manager Review

  
Management Review

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the client.

Contact Person: Questions regarding this analytical report should be addressed to:

**Project Manager**

**ProjectManagers@amrad.com**

**Phone: 225.381.2991**

**Fax: 225.381.2996**

**LELAP Cert# 01949**

**NELAP Cert# E87558**



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

ARS Sample Delivery Group: ARS1-09-02455  
 Client Sample ID: NA-1  
 Sample Collection Date: 09/17/09  
 Sample Matrix: Soil/Solid

Request or PO Number: 0909224MK  
 ARS Sample ID: ARS1-09-02455-001  
 Date Received: 09/18/09  
 Report Date: 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	0.047	0.323	0.567	0.284	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
K-40	1.742	0.726	1.070	0.535		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
SC-46	-0.010	0.042	0.075	0.037	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
CO-60	-0.006	0.042	0.077	0.038	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
CS-137	0.011	0.038	0.067	0.033	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
TL-208*	0.297	0.075	0.074	0.037		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
PB-210	0.678	0.681	1.080	0.540	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
BI-212	0.333	0.343	0.561	0.281	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
BI-214*	0.546	0.124	0.113	0.057		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
PB-214	0.729	0.173	0.149	0.075		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
RA-226	1.119	0.857	1.560	0.780	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
RA-228*	0.765	0.191	0.241	0.121		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
Th-228*	0.785	0.111	0.114	0.057		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
U-235	0.018	0.238	0.419	0.210	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A
Total Gamma	9.771	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:02	JLA	N/A

**NOTES:**

  
 Project Manager Review

*Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.*

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02455  
**Client Sample ID:** NA-3  
**Sample Collection Date:** 09/17/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0909224MK  
**ARS Sample ID:** ARS1-09-02455-002  
**Date Received:** 09/18/09  
**Report Date:** 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.064	0.248	0.434	0.217	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
K-40	3.149	0.674	0.476	0.238		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
SC-46	-0.009	0.032	0.056	0.028	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
CO-60	-0.002	0.033	0.061	0.030	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
CS-137	-0.004	0.313	0.047	0.023	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
TL-208*	0.254	0.066	0.063	0.031		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
PB-210	0.968	0.898	1.220	0.610	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
BI-212*	0.736	0.365	0.365	0.183		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
BI-214*	0.920	0.154	0.111	0.056		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
PB-214	1.059	0.165	0.134	0.067		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
RA-226	2.113	1.002	1.280	0.640		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
RA-228*	0.839	0.180	0.158	0.079		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
Th-228*	0.688	0.108	0.098	0.049		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
U-235	0.093	0.205	0.350	0.175	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
Total Gamma	11.813	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A

**NOTES:**

  
 Project Manager Review

**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

ARS Sample Delivery Group: ARS1-09-02455  
 Client Sample ID: NA-2 (1)  
 Sample Collection Date: 09/17/09  
 Sample Matrix: Soil/Solid

Request or PO Number: 0909224MK  
 ARS Sample ID: ARS1-09-02455-003  
 Date Received: 09/18/09  
 Report Date: 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.116	0.420	0.603	0.302	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
K-40*	1.120	0.626	0.959	0.480		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
SC-46	-0.001	0.041	0.072	0.036	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
CO-60	0.007	0.047	0.082	0.041	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
CS-137	0.120	0.050	0.055	0.028		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
TL-208*	0.295	0.089	0.082	0.041		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
PB-210	2.498	1.110	1.380	0.690		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
BI-212	0.113	0.363	0.647	0.324	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
BI-214	5.196	0.437	0.170	0.085		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
PB-214	5.899	0.583	0.199	0.100		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
RA-226	7.447	1.843	2.160	1.080		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
RA-228*	0.811	0.217	0.200	0.100		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
Th-228*	0.824	0.158	0.161	0.081		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
U-235	0.175	0.355	0.597	0.299	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A
Total Gamma	28.613	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:04	JLA	N/A

**NOTES:**

  
 Project Manager Review

*Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.*

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

ARS Sample Delivery Group: ARS1-09-02455  
 Client Sample ID: NA-4  
 Sample Collection Date: 09/17/09  
 Sample Matrix: Soil/Solid

Request or PO Number: 0909224MK  
 ARS Sample ID: ARS1-09-02455-004  
 Date Received: 09/18/09  
 Report Date: 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.107	0.334	0.497	0.249	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
K-40*	2.254	0.712	0.881	0.441		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
SC-46	-0.004	3.775	0.059	0.029	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
CO-60	0.004	0.038	0.072	0.036	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
CS-137	-0.010	1.248	0.073	0.037	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
TL-208*	0.255	0.062	0.055	0.027		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
PB-210	0.590	0.683	1.190	0.595	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
BI-212	0.436	0.309	0.467	0.234	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
BI-214*	0.984	0.153	0.104	0.052		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
PB-214	1.131	0.174	0.154	0.077		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
RA-226*	1.800	1.025	1.280	0.640		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
RA-228	0.879	0.162	0.160	0.080		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
Th-228*	0.887	0.131	0.116	0.058		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
U-235	-0.098	0.662	0.378	0.189	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
Total Gamma	10.637	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:07	JLA	N/A
<b>NOTES:</b>										

*[Signature]*  
 Project Manager Review

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

ARS Sample Delivery Group: ARS1-09-02455  
 Client Sample ID: NA-5  
 Sample Collection Date: 09/17/09  
 Sample Matrix: Soil/Solid

Request or PO Number: 0909224MK  
 ARS Sample ID: ARS1-09-02455-005  
 Date Received: 09/18/09  
 Report Date: 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.047	0.308	0.500	0.250	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
K-40	3.283	0.801	0.630	0.315		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
SC-46	-0.013	0.046	0.081	0.040	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
CO-60	0.012	0.042	0.076	0.038	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
CS-137	0.022	0.038	0.065	0.033	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
TL-208*	0.211	0.066	0.088	0.044		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
PB-210	0.561	0.893	1.290	0.645	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
BI-212*	0.935	0.382	0.339	0.170		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
BI-214*	0.687	0.159	0.140	0.070		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
PB-214	0.782	0.157	0.135	0.068		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
RA-226*	2.394	1.227	1.490	0.745		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
RA-228*	0.996	0.232	0.215	0.108		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
Th-228*	0.958	0.140	0.116	0.058		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
U-235	-0.055	2.206	0.444	0.222	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A
Total Gamma	11.623	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 11:13	JLA	N/A

**NOTES:**

  
 Project Manager Review

*Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.*

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02455  
**Client Sample ID:** NA-6  
**Sample Collection Date:** 09/17/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0909224MK  
**ARS Sample ID:** ARS1-09-02455-006  
**Date Received:** 09/18/09  
**Report Date:** 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	0.005	0.249	0.443	0.222	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
K-40	3.775	0.691	0.538	0.269		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
SC-46	-0.005	0.030	0.054	0.027	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
CO-60	0.007	0.030	0.054	0.027	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
CS-137	0.000	0.033	0.060	0.030	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
TL-208*	0.259	0.056	0.055	0.027		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
PB-210	0.965	0.725	1.070	0.535	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
BI-212*	0.924	0.304	0.279	0.140		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
BI-214*	0.708	0.133	0.102	0.051		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
PB-214	0.767	0.148	0.122	0.061		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
RA-226*	1.293	1.105	1.480	0.740	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
RA-228*	0.774	0.153	0.169	0.085		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
Th-228	0.835	0.110	0.112	0.056		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
U-235	0.014	0.221	0.386	0.193	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A
Total Gamma	12.967	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:12	JLA	N/A

**NOTES:**

  
 Project Manager Review

*Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.*

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767


1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02455  
**Client Sample ID:** NA-8  
**Sample Collection Date:** 09/17/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0909224MK  
**ARS Sample ID:** ARS1-09-02455-007  
**Date Received:** 09/18/09  
**Report Date:** 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.147	0.314	0.535	0.268	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
K-40	2.694	0.811	0.913	0.457		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
SC-46	-0.004	0.032	0.059	0.029	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
CO-60	0.014	0.044	0.078	0.039	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
CS-137	-0.013	0.080	0.071	0.036	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
TL-208*	0.297	0.067	0.061	0.030		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
PB-210	0.932	0.653	0.957	0.479	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
BI-212*	0.774	0.372	0.362	0.181		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
BI-214*	0.613	0.136	0.127	0.064		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
PB-214*	0.727	0.125	0.140	0.070		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
RA-226	1.568	0.849	1.130	0.565		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
RA-228*	0.897	0.178	0.216	0.108		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
Th-228*	0.850	0.122	0.104	0.052		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
U-235	-0.020	0.430	0.345	0.173	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
Total Gamma	10.140	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:21	JLA	N/A
<b>NOTES:</b>										

**Project Manager Review**



**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02455  
**Client Sample ID:** NA-2 (2)  
**Sample Collection Date:** 09/17/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0909224MK  
**ARS Sample ID:** ARS1-09-02455-008  
**Date Received:** 09/18/09  
**Report Date:** 09/22/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	0.172	0.255	0.426	0.213	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
K-40	3.071	0.659	0.486	0.243		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
SC-46	0.012	0.031	0.053	0.027	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
CO-60	0.002	0.038	0.070	0.035	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
CS-137	0.011	0.037	0.064	0.032	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
TL-208*	0.207	0.066	0.066	0.033		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
PB-210	1.382	0.831	1.090	0.545		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
BI-212	0.154	0.339	0.605	0.303	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
BI-214*	0.711	0.142	0.125	0.063		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
PB-214	0.841	0.158	0.123	0.062		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
RA-226*	2.706	1.130	1.440	0.720		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
RA-228*	0.864	0.205	0.154	0.077		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
Th-228	0.792	0.130	0.127	0.064		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
U-235	0.079	0.242	0.417	0.209	U	pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A
Total Gamma	11.589	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	09/21/09 12:22	JLA	N/A

**NOTES:**

  
 Project Manager Review

**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.

LELAP Certificate# 01949

NELAP Certificate # E87558



## QC Results per Analytical Batch

Analytical Batch	<b>ARS1-B09-03717</b>
SDG	<b>ARS1-09-02455</b>
Analysis	<b>Gamma Spec (Short) in (Soil, Sludge, Was</b>
Analysis Test Method	<b>ARS-007/EPA 901.1M</b>
Analysis Code	<b>GAM-A-020</b>
Report Units	<b>pCi/g</b>

### Acceptable QC Performance Ranges

QC Sample Type	Performance Items and Ranges		
Laboratory Control Sample	Recovery (%):	> 75	< 125
Matrix Spike	Recovery (%):	> 30	< 110
Duplicate	Replicate Error Ratio (RER):		< 1
	Duplicate Error Ratio (DER):		< 3
	Relative Percent Difference (RPD %):		≤ 25

Laboratory Control Sample			Analysis Date	09/21/09	Analysis Technician	KW	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1s)	Expected Value	LCS Rec (%)	MDC
ARS1-B09-03717-01	LCS	AM-241	34300	1200	34896.70	98	270
ARS1-B09-03717-01	LCS	CO-60	24540	540	25394.58	97	190
ARS1-B09-03717-01	LCS	CS-137	15040	360	15365.62	98	140

Duplicate RER/DER/RPD			Analysis Date	09/21/09	Analysis Technician	KW	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1s)	RER	DER	RPD
ARS1-B09-03717-02	LCS	AM-241	34700	1300	0.08	0.23	1.2
ARS1-B09-03717-02	LCS	CO-60	24860	550	0.15	0.42	1.3
ARS1-B09-03717-02	LCS	CS-137	15090	360	0.04	0.10	0.3

Method Blank			Analysis Date	09/21/09	Analysis Technician	KW	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1s)	MDC	Qual	
ARS1-B09-03717-03	MBL	AM-241	0.0075	0.0071	0.024	U	
ARS1-B09-03717-03	MBL	CO-60	0.0022	0.0041	0.015	U	
ARS1-B09-03717-03	MBL	CS-137	0.0007	0.0041	0.015	U	

  
 Shonda Joshua

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the client.

LELAP Certificate# 01949

NELAP Certificate # E87558



## Notes:

### Comments:

- 1.0) Soil and Sludge analysis are reported on a wet basis or an as received basis unless otherwise indicated.
- 2.0) Data in this report are within the limits of uncertainty specified in the reference method unless otherwise specified.
- 3.0) Modified analysis procedures are procedures that are modified to meet the certain specifications. An example may be the use of a water method to analyze a solid matrix due to the lack of an officially recognized procedure for the analysis of the solid matrix. Modified analyses are indicated by the subsequent addition of "m" to the procedure number (i.e. 900.0M).
- 4.0) Derived Air Concentrations and Effluent Release Concentrations are obtained from 10 CFR 20 Appendix B.
- 5.0) **Total activity** is actually total gamma activity and is determined utilizing the prominent gamma emitters from the naturally occurring radioactive decay chains and other prominent radioactive nuclides. Total activity may be lower than the actual total activity due to the extent of secular equilibrium achieved in the various decay chains at the time of analysis. The total activity is not representative of nuclides that emit solely alpha or beta particles.
- 6.0) Ra-228 is determined via secular equilibrium with its daughter, Actinium 228. (Gamma Spectroscopy only).
- 7.0) U-238 is determined via secular equilibrium with its daughter, Thorium 234. (Gamma Spectroscopy only).
- 8.0) All gamma spectroscopy was performed utilizing high purity germanium detectors (HPGe).
- 9.0) ARS makes every attempt to match sample density to calibrated density; however, in some cases, it is not practical or possible to do so and data results may be affected.

### Method References:

- 1.0) **EPA 600/4-80-032**; Prescribed Procedures for the Measurements of Radioactivity in Drinking Water, August 1980.
- 2.0) Standard Methods for Examination of Water and Waste Water, 18<sup>th</sup>, 1992.
- 3.0) **EPA SW-846**; Test Methods for Evaluating Solid Waste, Third Edition, (9/86). (Updated through 1995).
- 4.0) **EPA 600/479-020**; Methods for Chemical Analysis of Water and Waste, March 1983.
- 5.0) **HASL 300**
- 6.0) **ARS-040**; An LCSD is not reported with this process. The criteria for the LCS/LCSD analysis for reproducibility have not been established for Low Level Tritium analysis. A prepared standard for Low Level Tritium has not been developed. As a result, the standard we use is based on the dilution of a verified conventional tritium standard. The volume required for Low Level Tritium analysis, in addition to the lack of an available Low Level Tritium standard, introduce variability into the LCS/LCSD analysis that does not represent the actual sample analysis. The preferred measure for reproducibility is to run a duplicate analysis of a sample.

### Definitions:

- |       |                 |   |
|-------|-----------------|---|
| 1.0)  | <b>ND</b>       | Not detected above the detection limit (non-detect).  |
| 2.0)  | <b>MDC</b>      | (Minimum Detectable Concentration) minimum concentration of the analyte that ARS can detect utilizing the specific analysis |
| 3.0)  | <b>MBL</b>      | Method Blank  |
| 4.0)  | <b>DO</b>       | Duplicate Original  |
| 5.0)  | <b>DUP</b>      | Method Duplicate  |
| 6.0)  | <b>MS/MSD</b>   | Matrix Spike/Matrix Spike Duplicate   |
| 7.0)  | <b>S</b>        | Spike   |
| 8.0)  | <b>RS</b>       | Reference Spike   |
| 9.0)  | <b>*SC</b>      | Subcontracted out to another qualified laboratory   |
| 10.0) | <b>NR</b>       | Not Referenced  |
| 11.0) | <b>N/A</b>      | Not Applicable  |
| 12.0) | <b>*</b>        | Reported as a calculated value  |
| 13.0) | <b>**</b>       | False Positive due to interference from <u>Bi-214</u>   |
| 14.0) | <b>U</b>        | Activity is below the MDC   |
| 15.0) | <b>LCS/LCSD</b> | Laboratory Control Standard/Laboratory Control Standard Duplicate   |

Notes: ARS International assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of ARS International.





2609 North River Road, Port Allen, Louisiana 70767  
(800) 401-4277 -- FAX (225) 381-2996

## American Radiation Services, Inc.

### Laboratory Analysis Report

**ARS1-09-02573**

*Prepared for:*

**Anacon, Inc.**

**Melissa Knight**

**730 FM 1959**

**Houston, TX 77034**

**melissa.knight@anaconlab.com**

**aneupane@terracon.com**

**Peter.fisher@rrc.state.tx.us**

**Phone: 281-922-7000**

**Fax: 281-481-0089**

A handwritten signature in black ink, appearing to read 'C. Knight', is written over a horizontal line.

**Project Manager Review**

A handwritten signature in black ink, appearing to read 'J. Fisher', is written over a horizontal line.

**Management Review**

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the client.

**Contact Person: Questions regarding this analytical report should be addressed to:**

**Project Manager**

**ProjectManagers@amrad.com**

**Phone: 225.381.2991**

**Fax: 225.381.2996**



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02573  
**Client Sample ID:** NA-7  
**Sample Collection Date:** 09/25/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0910030MK  
**ARS Sample ID:** ARS1-09-02573-001  
**Date Received:** 09/28/09  
**Report Date:** 10/02/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.018	24.343	0.399	0.200	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
K-40	2.852	0.611	0.400	0.200		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
SC-46	-0.005	0.059	0.054	0.027	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
CO-60	0.004	0.035	0.065	0.032	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
CS-137	0.008	0.022	0.039	0.019	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
TL-208*	0.211	0.058	0.053	0.027		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
PB-210	0.918	0.620	0.958	0.479	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
BI-212*	0.424	0.233	0.282	0.141		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
BI-214*	0.553	0.110	0.085	0.043		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
PB-214	0.493	0.100	0.126	0.063		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
RA-226	1.727	0.951	1.280	0.640		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
RA-228*	0.736	0.149	0.134	0.067		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
TH-228*	0.574	0.101	0.101	0.051		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
U-235	0.134	0.187	0.318	0.159	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A
Total Gamma	10.133	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:06	JLA	N/A

**NOTES:**

  
 Project Manager Review

**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767

1 (800) 401-4277 FAX (225) 381-2996

ARS Sample Delivery Group: ARS1-09-02573  
 Client Sample ID: NA-9 (1)  
 Sample Collection Date: 09/24/09  
 Sample Matrix: Soil/Solid

Request or PO Number: 0910030MK  
 ARS Sample ID: ARS1-09-02573-002  
 Date Received: 09/28/09  
 Report Date: 10/02/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-0.186	0.513	0.778	0.389	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
K-40	3.654	0.958	0.871	0.436		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
SC-46	-0.008	0.415	0.096	0.048	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
CO-60	-0.009	0.349	0.118	0.059	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
CS-137	0.007	0.052	0.096	0.048	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
TL-208*	0.231	0.072	0.073	0.036		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
PB-210*	1.237	0.865	1.120	0.560		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
BI-212	0.341	0.404	0.660	0.330	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
BI-214*	0.656	0.178	0.171	0.086		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
PB-214*	0.616	0.135	0.187	0.094		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
RA-226	1.800	1.073	1.420	0.710		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
RA-228*	0.944	0.232	0.218	0.109		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
TH-228*	0.965	0.139	0.108	0.054		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
U-235	0.092	0.239	0.412	0.206	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A
Total Gamma	12.229	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	10/01/09 11:25	JLA	N/A

**NOTES:**

  
 Project Manager/Review

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767


1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02573  
**Client Sample ID:** NA-9 (2)  
**Sample Collection Date:** 09/24/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0910030MK  
**ARS Sample ID:** ARS1-09-02573-003  
**Date Received:** 09/28/09  
**Report Date:** 10/02/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	0.057	0.303	0.539	0.270	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
K-40	3.164	0.844	0.769	0.385		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
SC-46	0.000	0.047	0.086	0.043	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
CO-60	0.000	0.074	0.132	0.066	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
CS-137	0.000	0.061	0.109	0.055	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
TL-208*	0.233	0.071	0.074	0.037		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
PB-210	0.784	0.843	1.150	0.575	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
BI-212	-0.068	0.624	0.716	0.358	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
BI-214*	0.268	0.122	0.184	0.092		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
PB-214*	0.443	0.117	0.144	0.072		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
RA-226	1.973	1.201	1.590	0.795		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
RA-228*	0.460	0.161	0.328	0.164		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
TH-228*	0.579	0.147	0.161	0.081		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
U-235	0.016	0.210	0.379	0.190	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A
Total Gamma	9.032	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:01	JLA	N/A

**NOTES:**

  
 Project Manager Review

**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.

LELAP Certificate# 01949

NELAP Certificate # E87558



2609 North River Road, Port Allen, Louisiana 70767


1 (800) 401-4277 FAX (225) 381-2996

**ARS Sample Delivery Group:** ARS1-09-02573  
**Client Sample ID:** NA-9 (3)  
**Sample Collection Date:** 09/24/09  
**Sample Matrix:** Soil/Solid

**Request or PO Number:** 0910030MK  
**ARS Sample ID:** ARS1-09-02573-004  
**Date Received:** 09/28/09  
**Report Date:** 10/02/09

Analysis Description	Analysis Results	Analysis Error +/- 2 s	MDC	DLC	Qual	Analysis Units	Analysis Test Method	Analysis Date/Time	Analysis Technician	Tracer/Chem Recovery
BE-7	-1.446	1.659	2.720	1.360	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
K-40	2.220	2.144	3.510	1.755	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
SC-46	0.092	0.183	0.305	0.153	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
CO-60	-0.057	0.178	0.298	0.149	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
CS-137	0.048	0.344	0.573	0.287	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
TL-208*	0.397	0.235	0.336	0.168		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
PB-210	25.163	4.189	4.110	2.055		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
BI-212*	8.225	1.534	2.210	1.105		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
BI-214	88.358	5.415	0.589	0.295		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
PB-214	94.681	7.876	0.697	0.349		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
RA-226	104.240	8.355	6.990	3.495		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
RA-228*	1.955	0.813	1.160	0.580		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
TH-228*	0.946	0.337	0.450	0.225		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
U-235	-0.031	5.606	2.160	1.080	U	pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A
Total Gamma	337.414	N/A	N/A	N/A		pCi/g	ARS-007/EPA 901.1M	10/01/09 12:12	JLA	N/A

**NOTES:**

  
 Project Manager Review

**Notes:** American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the American Radiation Services, Inc.



## QC Results per Analytical Batch

Analytical Batch	<b>ARS1-B09-03912</b>
SDG	<b>ARS1-09-02573</b>
Analysis	<b>Gamma Spec (Short) in (Soil, Sludge, Was</b>
Analysis Test Method	<b>ARS-007/EPA 901.1M</b>
Analysis Code	<b>GAM-A-020</b>
Report Units	<b>pCi/g</b>

Acceptable QC Performance Ranges			
QC Sample Type	Performance Items and Ranges		
Laboratory Control Sample	Recovery (%):	> 75	< 125
Matrix Spike	Recovery (%):	> 30	< 110
Duplicate	Replicate Error Ratio (RER):	< 1	
	Duplicate Error Ratio (DER):	< 3	
	Relative Percent Difference (RPD %):	≤ 25	

Laboratory Control Sample			Analysis Date	10/01/09	Analysis Technician	JLA	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1s)	Expected Value	LCS Rec (%)	MDC
ARS1-B09-03912-01	LCS	AM-241	34500	1300	34896.70	99	260
ARS1-B09-03912-01	LCS	CO-60	25730	520	25394.58	101	200
ARS1-B09-03912-01	LCS	CS-137	15300	350	15365.62	100	150

Duplicate RER/DER/RPD			Analysis Date	10/01/09	Analysis Technician	JLA	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1s)	RER	DER	RPD
ARS1-B09-03912-02	LCSD	AM-241	34700	1300	0.04	0.11	0.6
ARS1-B09-03912-02	LCSD	CO-60	24750	530	0.48	1.32	3.9
ARS1-B09-03912-02	LCSD	CS-137	15080	330	0.17	0.46	1.4

Method Blank			Analysis Date	10/01/09	Analysis Technician	KW	
Analysis Batch Sample ID	QC Type	Analyte	Results	CSU (1 s)	MDC	Qual	
ARS1-B09-03912-03	MBL	AM-241	-0.0001	0.0011	0.027	U	
ARS1-B09-03912-03	MBL	CO-60	-0.0035	0.0064	0.018	U	
ARS1-B09-03912-03	MBL	CS-137	-0.0009	0.0041	0.015	U	

Ashley Norman

Notes: American Radiation Services, Inc. assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of the client.

LELAP Certificate# 01949

NELAP Certificate # E87558



## Notes:

### Comments:

- 1.0) Soil and Sludge analysis are reported on a wet basis or an as received basis unless otherwise indicated.
- 2.0) Data in this report are within the limits of uncertainty specified in the reference method unless otherwise specified.
- 3.0) Modified analysis procedures are procedures that are modified to meet the certain specifications. An example may be the use of a water method to analyze a solid matrix due to the lack of an officially recognized procedure for the analysis of the solid matrix. Modified analyses are indicated by the subsequent addition of "m" to the procedure number (i.e. 900.0M).
- 4.0) Derived Air Concentrations and Effluent Release Concentrations are obtained from 10 CFR 20 Appendix B.
- 5.0) **Total activity** is actually total gamma activity and is determined utilizing the prominent gamma emitters from the naturally occurring radioactive decay chains and other prominent radioactive nuclides. Total activity may be lower than the actual total activity due to the extent of secular equilibrium achieved in the various decay chains at the time of analysis. The total activity is not representative of nuclides that emit solely alpha or beta particles.
- 6.0) Ra-228 is determined via secular equilibrium with its daughter, Actinium 228. (Gamma Spectroscopy only).
- 7.0) U-238 is determined via secular equilibrium with its daughter, Thorium 234. (Gamma Spectroscopy only).
- 8.0) All gamma spectroscopy was performed utilizing high purity germanium detectors (HPGe).
- 9.0) ARS makes every attempt to match sample density to calibrated density; however, in some cases, it is not practical or possible to do so and data results may be affected.

### Method References:

- 1.0) **EPA 600/4-80-032**; Prescribed Procedures for the Measurements of Radioactivity in Drinking Water, August 1980.
- 2.0) Standard Methods for Examination of Water and Waste Water, 18<sup>th</sup>, 1992.
- 3.0) **EPA SW-846**; Test Methods for Evaluating Solid Waste, Third Edition, (9/86). (Updated through 1995).
- 4.0) **EPA 600/4/79-020**; Methods for Chemical Analysis of Water and Waste, March 1983.
- 5.0) **HASL 300**
- 6.0) **ARS-040**; An LCSD is not reported with this process. The criteria for the LCS/LCSD analysis for reproducibility have not been established for Low Level Tritium analysis. A prepared standard for Low Level Tritium has not been developed. As a result, the standard we use is based on the dilution of a verified conventional tritium standard. The volume required for Low Level Tritium analysis, in addition to the lack of an available Low Level Tritium standard, introduce variability into the LCS/LCSD analysis that does not represent the actual sample analysis. The preferred measure for reproducibility is to run a duplicate analysis of a sample.

### Definitions:

- |       |                 |   |
|-------|-----------------|---|
| 1.0)  | <b>ND</b>       | Not detected above the detection limit (non-detect).  |
| 2.0)  | <b>MDC</b>      | (Minimum Detectable Concentration) minimum concentration of the analyte that ARS can detect utilizing the specific analysis |
| 3.0)  | <b>MBL</b>      | Method Blank  |
| 4.0)  | <b>DO</b>       | Duplicate Original  |
| 5.0)  | <b>DUP</b>      | Method Duplicate  |
| 6.0)  | <b>MS/MSD</b>   | Matrix Spike/Matrix Spike Duplicate   |
| 7.0)  | <b>S</b>        | Spike   |
| 8.0)  | <b>RS</b>       | Reference Spike   |
| 9.0)  | <b>*SC</b>      | Subcontracted out to another qualified laboratory   |
| 10.0) | <b>NR</b>       | Not Referenced  |
| 11.0) | <b>N/A</b>      | Not Applicable  |
| 12.0) | <b>*</b>        | Reported as a calculated value  |
| 13.0) | <b>**</b>       | False Positive due to interference from <u>Bi-214</u>   |
| 14.0) | <b>U</b>        | Activity is below the MDC   |
| 15.0) | <b>LCS/LCSD</b> | Laboratory Control Standard/Laboratory Control Standard Duplicate   |

Notes: ARS International assumes no liability for the use or interpretation of any analytical results provided other than the cost of the analysis itself. Reproduction of this report in less than full requires the written consent of ARS International.





October 27, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001  
FAX (713) 869-9621

RE:

Order No.: 0910170


Dear Brian Voyles:


Anacon, Inc. received 40 samples on 10/15/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0050  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX

730 FM. 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



Chain of Custody Record

Shaded Areas for Lab Use Only.

Client: Terraron TXRR-Houston

Address: 1555 Cap Rd

PO# Bill to RLC

Contact Person: Brian Voyles

Phone Number: 713 690 8787

Fax Number: 8055

E-mail Address: smuel@terraron.com

Anacon Log Number: CA10170

Turn Around Time: 5 Days ASAP\*

Sample Location: CAIUS P. Rd

\*per B. Voyles

Delivered By: P. Hernandez

Custody Seal(Y/N):

Temperature: On Ice 5°C

Sampled By: David Coleman

Please Print

Analysis Requested

Remarks

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Total Pb	TPH 1005	Total Cd	Matrix Code	Containers	Notes
091A	5911	10-15-09	0639	7	4oz Ice	ice	E2-B1	X	X		S=Solid	P=Plastic	
091A			0640				E2-N1	X	X		W=Water	G=Glass	
091A			0944				E2-E1	X	X		Sldg=Sludge	V=Voa	
091A			0947				E2-W1	X	X		O=Oil	B=Bacterial	
091A			0949				E2-S1	X	X		INF=Influent		
091A			1014				E3-B1			X			
091A			1016				E3-S1			X			
091A			10K5				E3-W1			X			
091A			1020				E3-E1			X			
101A			1022				E3-N1			X			
111A			1050				E4-B1			X			
121A			1052				E4-E1			X			
131A			1054				E4-W1			X			
141A			1055				E4-S1			X			
151A			1057				E4-N1			X			
161A			1112				E5-B1			X			
171A			1114				E5-W1			X			

Relinquished By: David Coleman Date: 10-15-09 Time: 11:02 AM

Accepted By: Brian Voyles Date: 10-15-09 Time: 5:10 PM

Relinquished by: Brian Voyles Date: 10-15-09 Time: 5:10 PM

Accepted By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Preservation Code: 1=HNO3, 2=H2SO4, 3=NaOH, 4=HCL, 5=None

Matrix Code: S=Solid, W=Water, Sldg=Sludge, O=Oil, INF=Influent

Containers: P=Plastic, G=Glass, V=Voa, B=Bacterial

Notes: RRP Checklist  
0% moisture.

730 FM 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0099 Fax



Chain of Custody Record

Shaded Areas for Lab Use Only.

Client: Terracon

Address: 1555 Ching Road

PO# Bill to PCC

Contact Person: Steve Neely / Janet Coleman

Phone Number: 713 660 8781

Fax Number: 8055

E-mail Address: stneely@terracon.com

janet@terracon.com

Anacon Log Number: CP10EFD

Turn Around Time: 5:15-6:00

Sample Location: Carroll Ave

Delivered By:

Custody Seal (VIN):

Temperature:

Sampled By:

Janet Coleman

Please Print

Analysis Requested

Remarks

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Matrix Code	Matrix Code	Containers	Notes
181A	Soil	10-15-07	1115	1	4oz ice		E5-S1	TSB PB	TSB PB		
191A			1117			X	E5-E1				
201A			1119			X	E5-N1				
211A			1130			X	E6-B1				
221A			1131			X	E6-E1				
231A			1133			X	E6-N1				
241A			1135			X	E6-S1				
251A			1137			X	E6-W1				
261A			1150			X	E7-B1				
271A			1152			X	E7-W1				
281A			1154			X	E7-N1				
291A			1156			X	E7-E1				
301A			1158			X	E7-S1				
311A			1354			X	E8-B1				
321A			1356			X	E8-B2				
331A			1402			X	E8-N1				
341A			1404			X	E8-N2				

Relinquished By: Janet Coleman Date: 10-15-05 Time: 11:02AM

Accepted By: Steve Neely Date: 10-15-05 Time: 16:11

Relinquished By: Janet Coleman Date: 10-15-05 Time: 5:10

Accepted By: Janet Coleman Date: 10-15-05 Time: 5:10

Relinquished By: Janet Coleman Date: 10-15-05 Time: 5:10

Accepted By: Janet Coleman Date: 10-15-05 Time: 5:10

Preservation Code: 1=HNO3, 2=H2SO4, 3=NaOH, 4=HCL, 5=None

Matrix Code: S=Solid, W=Water, Sludg=Sludge, O=Oil, INF=Influent

Containers: P=Plastic, G=Glass, V=Voa, B=Bacterial



**Anacon, Inc.**

**Date:** 27-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Project:**

**Lab Order:** 0910170

**CASE NARRATIVE**

Anacon, Inc. received 40 soil samples to be analyzed for Total Lead, 5 of these samples were also analyzed for Cadmium, and 10 were analyzed for TPH. The samples were received in good condition and within hold times required for analysis. The only QC problem noted was with one sample, the TPH surrogate was out of the acceptance limits. All other QC was within the required limits and has been included for review.

0004

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN Date and Time Receive 10/15/2009  
 Work Order Numbe 0910170 Received by: CC  
 Checklist completed by C. Cupe 10/15/09 Reviewed by Ymk 10/15/09  
Signature Date Initials Date

Matrix: Solid Carrier name: Blas Hernandez

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- Il samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? No VOA vials submitted  Yes  No
- Water - pH acceptable upon receipt? Yes  No

5°C

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section be

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_

Corrective Action \_\_\_\_\_

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E2-B1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 9:39:00 AM

**Project:**

**Lab ID:** 0910170-001

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	8.79	0.100		mg/Kg	1	10/17/2009 3:58:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	91.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	83.0	50-150		%REC	1	10/19/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0005

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-002

**Client Sample ID:** E2-N1  
**Collection Date:** 10/15/2009 9:40:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	26.3	0.100		mg/Kg	1	10/17/2009 4:22:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	81.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	80.0	50-150		%REC	1	10/19/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0007

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E2-E1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 9:44:00 AM

**Project:**

**Lab ID:** 0910170-003

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	79.6	0.100		mg/Kg	1	10/17/2009 4:28:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	82.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	76.0	50-150		%REC	1	10/19/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0003

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-004

**Client Sample ID:** E2-W1  
**Collection Date:** 10/15/2009 9:47:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	28.3	0.100		mg/Kg	1	10/17/2009 4:34:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	66.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	82.0	50-150		%REC	1	10/19/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0009

Anacon, Inc.

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E2-S1

Lab Order: 0910170

Collection Date: 10/15/2009 9:49:00 AM

Project:

Lab ID: 0910170-005

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	5.80	0.100		mg/Kg	1	10/17/2009 4:40:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	72.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	68.0	50-150		%REC	1	10/19/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0010

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E3-B1

Lab Order: 0910170

Collection Date: 10/15/2009 10:14:00 AM

Project:

Lab ID: 0910170-006

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Cadmium	ND	0.100		mg/Kg	1	10/17/2009 4:59:00 PM
Lead	6.57	0.100		mg/Kg	1	10/17/2009 4:59:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0011

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E3-S1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 10:16:00 AM

**Project:**

**Lab ID:** 0910170-007

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Cadmium	ND	0.100		mg/Kg	1	10/17/2009 5:05:00 PM
Lead	6.76	0.100		mg/Kg	1	10/17/2009 5:05:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0012

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910170  
Project:  
Lab ID: 0910170-008

Client Sample ID: E3-W1  
Collection Date: 10/15/2009 10:18:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Cadmium	ND	0.100		mg/Kg	1	10/17/2009 5:11:00 PM
Lead	9.29	0.100		mg/Kg	1	10/17/2009 5:11:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0013

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E3-E1

Lab Order: 0910170

Collection Date: 10/15/2009 10:20:00 AM

Project:

Lab ID: 0910170-009

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Cadmium	0.230	0.100		mg/Kg	1	10/17/2009 5:17:00 PM
Lead	25.2	0.100		mg/Kg	1	10/17/2009 5:17:00 PM

**Qualifiers:**

ND - Not Detected at the Reporting Limit

S - Spike Recovery outside accepted recovery limits

J - Analyte detected below quantitation limits

R - RPD outside accepted recovery limits

B - Analyte detected in the associated Method Blank

E - Value above quantitation range

\* - Value exceeds Maximum Contaminant Level

0014

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-010

**Client Sample ID:** E3-N1  
**Collection Date:** 10/15/2009 10:22:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Cadmium	ND	0.100		mg/Kg	1	10/17/2009 5:23:00 PM
Lead	6.44	0.100		mg/Kg	1	10/17/2009 5:23:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0015

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-011

**Client Sample ID:** E4-B1  
**Collection Date:** 10/15/2009 10:50:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	7.13	0.100		mg/Kg	1	10/17/2009 5:29:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0016

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E4-E1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 10:52:00 AM

**Project:**

**Lab ID:** 0910170-012

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	4.95	0.100		mg/Kg	1	10/17/2009 5:35:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0017

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-013

**Client Sample ID:** E4-W1  
**Collection Date:** 10/15/2009 10:54:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.76	0.100		mg/Kg	1	10/17/2009 5:41:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0018

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910170  
Project:  
Lab ID: 0910170-014

Client Sample ID: E4-S1  
Collection Date: 10/15/2009 10:55:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	10.9	0.100		mg/Kg	1	10/17/2009 5:47:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0019

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E4-N1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 10:57:00 AM

**Project:**

**Lab ID:** 0910170-015

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Lead	6.55	0.100		mg/Kg	1	10/17/2009 6:06:00 PM

**Qualifiers:**

ND - Not Detected at the Reporting Limit

J - Analyte detected below quantitation limits

B - Analyte detected in the associated Method Blank

\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits

R - RPD outside accepted recovery limits

E - Value above quantitation range

0020

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E5-B1

Lab Order: 0910170

Collection Date: 10/15/2009 11:12:00 AM

Project:

Lab ID: 0910170-016

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.60	0.100		mg/Kg	1	10/17/2009 6:12:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E5-W1

Lab Order: 0910170

Collection Date: 10/15/2009 11:14:00 AM

Project:

Lab ID: 0910170-017

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	126	0.100		mg/Kg	1	10/17/2009 6:18:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0022

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E5-S1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 11:15:00 AM

**Project:**

**Lab ID:** 0910170-018

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	94.7	0.100		mg/Kg	1	10/17/2009 6:24:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-019

**Client Sample ID:** E5-E1  
**Collection Date:** 10/15/2009 11:17:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Lead	260	0.100		mg/Kg	1	10/17/2009 6:30:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-020

**Client Sample ID:** E5-N1  
**Collection Date:** 10/15/2009 11:19:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	8.31	0.100		mg/Kg	1	10/17/2009 6:36:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0025

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E6-B1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 11:30:00 AM

**Project:**

**Lab ID:** 0910170-021

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.22	0.100		mg/Kg	1	10/17/2009 6:55:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910170  
Project:  
Lab ID: 0910170-022

Client Sample ID: E6-E1  
Collection Date: 10/15/2009 11:31:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	6.15	0.100		mg/Kg	1	10/17/2009 7:31:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E6-N1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 11:33:00 AM

**Project:**

**Lab ID:** 0910170-023

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	8.51	0.100		mg/Kg	1	10/17/2009 7:37:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-024

**Client Sample ID:** E6-S1  
**Collection Date:** 10/15/2009 11:35:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	9.80	0.100		mg/Kg	1	10/17/2009 7:43:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0025

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-025

**Client Sample ID:** E6-W1  
**Collection Date:** 10/15/2009 11:37:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.99	0.100		mg/Kg	1	10/17/2009 7:49:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0030

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-026

**Client Sample ID:** E7-B1  
**Collection Date:** 10/15/2009 11:50:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	5.79	0.100		mg/Kg	1	10/17/2009 7:55:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	84.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	69.0	50-150		%REC	1	10/19/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910170  
**Project:**  
**Lab ID:** 0910170-027

**Client Sample ID:** E7-W1  
**Collection Date:** 10/15/2009 11:52:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	6.03	0.100		mg/Kg	1	10/17/2009 8:02:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	89.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	64.0	50-150		%REC	1	10/19/2009

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0032

Anacon, Inc.

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910170  
Project:  
Lab ID: 0910170-028

Client Sample ID: E7-N1  
Collection Date: 10/15/2009 11:54:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	11.1	0.100		mg/Kg	1	10/17/2009 8:20:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	82.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	52.0	50-150		%REC	1	10/19/2009

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0030

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E7-E1

**Lab Order:** 0910170

**Collection Date:** 10/15/2009 11:56:00 AM

**Project:**

**Lab ID:** 0910170-029

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	5.66	0.100		mg/Kg	1	10/17/2009 8:26:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	83.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	50.0	50-150		%REC	1	10/19/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0034

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E7-S1

Lab Order: 0910170

Collection Date: 10/15/2009 11:58:00 AM

Project:

Lab ID: 0910170-030

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	4.26	0.100		mg/Kg	1	10/17/2009 8:32:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/19/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/19/2009
Surr: 1-Chlorooctadecane	71.0	50-150		%REC	1	10/19/2009
Surr: 1-Chlorooctane	49.0	50-150	S	%REC	1	10/19/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0035

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E8-B1  
Lab Order: 0910170      Collection Date: 10/18/2009 1:54:00 PM  
Project:  
Lab ID: 0910170-031      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	6.44	0.100		mg/Kg	1	10/17/2009 8:38:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E8-B2  
Lab Order: 0910170      Collection Date: 10/15/2009 1:56:00 PM  
Project:  
Lab ID: 0910170-032      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.78	0.100		mg/Kg	1	10/17/2009 8:44:00 PM

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                          J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                          B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                          \* - Value exceeds Maximum Contaminant Level

0037

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E8-N1  
**Lab Order:** 0910170      **Collection Date:** 10/15/2009 2:02:00 PM  
**Project:**  
**Lab ID:** 0910170-033      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	4.97	0.100		mg/Kg	1	10/17/2009 8:51:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

0036

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E8-N2  
Lab Order: 0910170      Collection Date: 10/15/2009 2:04:00 PM  
Project:  
Lab ID: 0910170-034      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	4.83	0.100		mg/Kg	1	10/17/2009 8:57:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0039

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E8-S1

Lab Order: 0910170

Collection Date: 10/15/2009 2:08:00 PM

Project:

Lab ID: 0910170-035

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.51	0.100		mg/Kg	1	10/17/2009 9:03:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E8-S2  
**Lab Order:** 0910170      **Collection Date:** 10/15/2009 2:10:00 PM  
**Project:**  
**Lab ID:** 0910170-036      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	8.68	0.100		mg/Kg	1	10/17/2009 9:09:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

0041

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E8-W1  
**Lab Order:** 0910170      **Collection Date:** 10/15/2009 1:58:00 PM  
**Project:**  
**Lab ID:** 0910170-037      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	29.6	0.100		mg/Kg	1	10/17/2009 9:27:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E8-W2  
**Lab Order:** 0910170      **Collection Date:** 10/15/2009 2:00:00 PM  
**Project:**  
**Lab ID:** 0910170-038      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.89	0.100		mg/Kg	1	10/17/2009 9:33:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E8-E1

Lab Order: 0910170

Collection Date: 10/15/2009 2:04:00 PM

Project:

Lab ID: 0910170-039

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.20	0.100		mg/Kg	1	10/17/2009 9:39:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit

S - Spike Recovery outside accepted recovery limits

J - Analyte detected below quantitation limits

R - RPD outside accepted recovery limits

B - Analyte detected in the associated Method Blank

E - Value above quantitation range

\* - Value exceeds Maximum Contaminant Level

0044

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E8-E2  
Lab Order: 0910170      Collection Date: 10/15/2009 2:06:00 PM  
Project:  
Lab ID: 0910170-040      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	4.39	0.100		mg/Kg	1	10/17/2009 9:46:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

0045

ANALYTICAL QC SUMMARY REPORT

94100

CLIENT: Railroad Commission of Texas - Houston  
 Work Order: 0910170  
 Project:

TestCode: 6020\_S

Sample ID	Batch ID	SamplType	TestCode	Units	Prep Date	Run ID	SeqNo	ICP-MS #1	091017C			
Sample ID: BLK101609MMK	Batch ID: R23881	MBLK	6020_S	mg/Kg	10/17/2009	ICP-MS #1	294151					
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Cadmium		ND	0.100			81.3	70	130	0	0		
Lead		0.2109	0.100			93.9	70	130	0	0		
Sample ID: BLK101609MMK2	Batch ID: R23882	MBLK	6020_S	mg/Kg	10/17/2009	ICP-MS #1	294176					
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		0.2422	0.100			83.2	75	125	0	0		
Sample ID: LCS101609MMK	Batch ID: R23881	LCS	6020_S	mg/Kg	10/17/2009	ICP-MS #1	294152					
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Cadmium		16.64	0.100	20	0	99.2	75	125	0	0		
Lead		20.05	0.100	20	0.2109							
Sample ID: LCS101609MMK2	Batch ID: R23882	LCS	6020_S	mg/Kg	10/17/2009	ICP-MS #1	294177					
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		18.12	0.100	20	0.2422	89.4	75	125	0	0		
Sample ID: 0910170-001A-MS	Batch ID: R23881	MS	6020_S	mg/Kg	10/17/2009	ICP-MS #1	294154					
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Cadmium		16.26	0.100	20	0	81.3	70	130	0	0		
Lead		27.57	0.100	20	8.792	93.9	70	130	0	0		

Qualifiers: ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

CLIENT: Railroad Commission of Texas - Houston  
 Work Order: 0910170  
 Project: 0910170

ANALYTICAL QC SUMMARY REPORT  
 TestCode: 6020\_S

1500

Sample ID	Batch ID	Batch Type	TestCode	TestNo	Units	mg/Kg	Prep Date	Analysis	Run ID	SeqNo	ICP-MS #1	091017D
Sample ID: 0910170-021A-MS	Batch ID: R23882	MS	6020_S	SW6020	mg/Kg		10/17/2009		ICP-MS #1	294179	091017D	
Client ID: E6-B1												
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		26.54	0.100	20	7.218	96.6	70	130	0	0		
Sample ID: 0910170-001A-MSD	Batch ID: R23881	MSD	6020_S	SW6020	mg/Kg		10/17/2009		ICP-MS #1	294155	091017C	
Client ID: E2-B1												
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Cadmium		16.87	0.100	20	0	84.4	70	130	16.26	3.71	25	
Lead		28.31	0.100	20	8.792	97.6	70	130	27.57	2.67	25	
Sample ID: 0910170-021A-MSD	Batch ID: R23882	MSD	6020_S	SW6020	mg/Kg		10/17/2009		ICP-MS #1	294180	091017D	
Client ID: E6-B1												
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		26.39	0.100	20	7.218	95.9	70	130	26.54	0.556	25	

Qualifiers: ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

Anacon, Inc.  
730 FM 1959  
Houston, TX 77034

QA/QC REPORT - LCS

Sample ID: LCS Matrix: Solid  
Anacon Number: 0155, 0170, 0088 Units mg/kg

Analyte / Method Number	Blk Value	Spike Conc.	LCS Conc.	% Recovery	Recovery Limits
TPH-GRO - 1005	< 50	500	449	90	60-120
TPH-DRO - 1005	< 50	500	453	91	60-120

LCS Advisory Limits

RPD: 0 out of 2 outside of QC limits

\*Matrix interference

\*\*Sample too concentrated to spike

QA/QC Manager Mkight

0048





October 27, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001

FAX (713) 869-9621

RE:

Dear Brian Voyles:


Order No.: 0910185


Anacon, Inc. received 23 samples on 10/16/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0030  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX



Chain of Custody Record

Shaded Areas for Lab Use Only.

Client: Terraco - TXRR Houston

Address: 1555 dug Pond

PO# Bill to REC

Contact Person: Stevie Wiley / Janet Coleman

Phone Number: 713 670 8989

Fax Number: 2055

E-mail Address: stevie@terracoon.com

Anacon Log Number: 0910135

Turn Around Time: 5105

Sample Location: Atkns Pce

Delivered By: Janet Coleman

Sampled By: Janet Coleman

Please Print

Custody Seal (Y/N):

Temperature:

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Analysis Requested	Remarks
01A	Soil	10-16-07	0832	1	4oz	ice	E9-S1		
02A			0637				E9-W1		
03A			0540				E9-W2		
04A			0842				E9-W3		
05A			0901				E9-E1		
06A			0903				E9-E2		
07A			0905				E9-E3		
08A			0910				E9-E4		
09A			0912				E9-E5		
10A			0915				E9-E6		
11A			0917				E9-N1		
12A			0924				E9-W4		
13A			0927				E9-W5		
14A			0929				E9-W6		
15A			0931				E9-E7		
16A			0944				E9-B1		
17A			0946				E9-B2		

Relinquished By: Janet Coleman Date: 10-16-07 Time: 1613

Accepted By: Stevie Wiley Date: 10-16-07 Time: 1613

Relinquished By: Janet Coleman Date: 10-16-07 Time: 451

Accepted By: Stevie Wiley Date: 10-16-07 Time: 451

Relinquished by: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Accepted By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

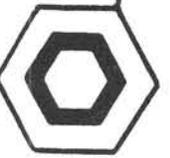
Preservation Code: 1=HNO3 6=Other  
2=H2SO4 3=NaOH 4=HCL 5=None

Matrix Code: S=Solid EFF=Effluent W=Water Sludge=Sludge O=Oil INF=Influent

Containers: P=Plastic G=Glass V=Vial B=Bacterial

Notes: \_\_\_\_\_

730 FM 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



Chain of Custody Record

Shaded Areas for Lab Use Only.

Client: Torricon

Address: 1555 Cvs Blvd

PO# B11 to PCC

Contact Person: Steve Nally / Janet Geman

Phone Number: 713 690 8489

Fax Number: 2055

E-mail Address: snally@torricon.com

Anacon Log Number: 0910185

Turn Around Time: 5-7 Days

Sample Location: Citrus Pk

Delivered By:

Custody Seal (Y/N):

Temperature: 50-55

Sampled By:

Janet Geman

Please Print

Analysis Requested

Remarks

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Matrix Code	Containers	Notes
181A	soil	10-16-09	0948	1	4oz ice		E9-B3			
191A			0950			X	E9-B4			
204A			0952			X	E9-B5			
21A			0954			X	E9-B6			
22A			0959			X	E9-B7			
23A			1001			X	E9-S2			

Relinquished By: Janet Geman Date: 10-16-09 Time: 11:13

Accepted By: Steve Nally Date: 10-16-09 Time: 15:11

Relinquished by: Steve Nally Date: 10-16-09 Time: 15:11

Accepted By: Steve Nally Date: 10-16-09 Time: 15:11

Preservation Code: 1=HNO3, 2=H2SO4, 3=NaOH, 4=HCL, 5=None, 6=Other

Matrix Code: S=Solid, W=Water, Sludg=Sludge, INF=Influent, EFF=Effluent

Containers: P=Plastic, G=Glass, V=Voa, B=Bacterial

**Anacon, Inc.**

**Date:** 27-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Project:**

**Lab Order:** 0910185

**CASE NARRATIVE**

Anacon, Inc. received 23 soil samples to be analyzed for Total Lead, Arsenic, and Barium. The samples were received in good condition and within hold times required for analysis. There were a few QC problems noted was the MS and MSDs for this analysis. All other QC was within the required limits and has been included for review.

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN

Date and Time Receive

10/16/2009

Work Order Number 0910185

Received by: CC

Checklist completed by C. Cupe 10/16/09  
Signature Date

Reviewed by mx 10/19/09  
Initials Date

Matrix: Solid

Carrier name: Clint Larison

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- All samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? No VOA vials submitted  Yes  No
- Water - pH acceptable upon receipt? Yes  No

60°C

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section below

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

Corrective Action \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

0006

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-001

**Client Sample ID:** E9-S1  
**Collection Date:** 10/16/2009 8:32:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	4.32	0.100		mg/Kg	1	10/19/2009 10:28:00 PM
Barium	133	0.100		mg/Kg	1	10/19/2009 10:28:00 PM
Lead	24.1	0.100		mg/Kg	1	10/19/2009 10:28:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-002

Client Sample ID: E9-W1  
Collection Date: 10/16/2009 8:37:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>				<b>SW6020</b>		Analyst: HN
Arsenic	2.69	0.100		mg/Kg	1	10/19/2009 10:55:00 PM
Barium	255	0.100		mg/Kg	1	10/19/2009 10:55:00 PM
Lead	88.8	0.100		mg/Kg	1	10/19/2009 10:55:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0006

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-003

Client Sample ID: E9-W2  
Collection Date: 10/16/2009 8:40:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	2.73	0.100		mg/Kg	1	10/19/2009 11:02:00 PM
Barium	186	0.100		mg/Kg	1	10/19/2009 11:02:00 PM
Lead	93.4	0.100		mg/Kg	1	10/19/2009 11:02:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0007

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-004

Client Sample ID: E9-W3  
Collection Date: 10/16/2009 8:42:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Arsenic	2.66	0.100		mg/Kg	1	10/19/2009 11:22:00 PM
Barium	353	0.100		mg/Kg	1	10/19/2009 11:22:00 PM
Lead	103	0.100		mg/Kg	1	10/19/2009 11:22:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0000

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-005

**Client Sample ID:** E9-E1  
**Collection Date:** 10/16/2009 9:01:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Arsenic	2.01	0.100		mg/Kg	1	10/19/2009 11:28:00 PM
Barium	144	0.100		mg/Kg	1	10/19/2009 11:28:00 PM
Lead	66.9	0.100		mg/Kg	1	10/19/2009 11:28:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-006

**Client Sample ID:** E9-E2  
**Collection Date:** 10/16/2009 9:03:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	2.69	0.100		mg/Kg	1	10/19/2009 11:35:00 PM
Barium	211	0.100		mg/Kg	1	10/19/2009 11:35:00 PM
Lead	123	0.100		mg/Kg	1	10/19/2009 11:35:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-007

Client Sample ID: E9-E3  
Collection Date: 10/16/2009 9:05:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	3.41	0.100		mg/Kg	1	10/19/2009 11:42:00 PM
Barium	321	0.100		mg/Kg	1	10/19/2009 11:42:00 PM
Lead	140	0.100		mg/Kg	1	10/19/2009 11:42:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0011

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-008

Client Sample ID: E9-E4  
Collection Date: 10/16/2009 9:10:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>				<b>SW6020</b>		Analyst: HN
Arsenic	1.04	0.100		mg/Kg	1	10/19/2009 11:49:00 PM
Barium	78.0	0.100		mg/Kg	1	10/19/2009 11:49:00 PM
Lead	14.6	0.100		mg/Kg	1	10/19/2009 11:49:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0012

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-009

**Client Sample ID:** E9-E5  
**Collection Date:** 10/16/2009 9:12:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Arsenic	1.59	0.100		mg/Kg	1	10/19/2009 11:55:00 PM
Barium	176	0.100		mg/Kg	1	10/19/2009 11:55:00 PM
Lead	28.2	0.100		mg/Kg	1	10/19/2009 11:55:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0013

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-010

**Client Sample ID:** E9-E6  
**Collection Date:** 10/16/2009 9:15:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Arsenic	7.23	0.100		mg/Kg	1	10/20/2009 12:02:00 AM
Barium	682	0.100		mg/Kg	1	10/20/2009 12:02:00 AM
Lead	129	0.100		mg/Kg	1	10/20/2009 12:02:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0014

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-011

**Client Sample ID:** E9-N1  
**Collection Date:** 10/16/2009 9:17:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	5.43	0.100		mg/Kg	1	10/20/2009 12:09:00 AM
Barium	454	0.100		mg/Kg	1	10/20/2009 12:09:00 AM
Lead	86.8	0.100		mg/Kg	1	10/20/2009 12:09:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-012

**Client Sample ID:** E9-W4  
**Collection Date:** 10/16/2009 9:24:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	3.36	0.100		mg/Kg	1	10/20/2009 12:15:00 AM
Barium	355	0.100		mg/Kg	1	10/20/2009 12:15:00 AM
Lead	51.8	0.100		mg/Kg	1	10/20/2009 12:15:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-013

Client Sample ID: E9-W5  
Collection Date: 10/16/2009 9:27:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>				<b>SW6020</b>		Analyst: HN
Arsenic	9.36	0.100		mg/Kg	1	10/20/2009 12:35:00 AM
Barium	1140	0.100		mg/Kg	1	10/20/2009 12:35:00 AM
Lead	135	0.100		mg/Kg	1	10/20/2009 12:35:00 AM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-014

**Client Sample ID:** E9-W6  
**Collection Date:** 10/16/2009 9:29:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: <b>HN</b>
Arsenic	147	0.100		mg/Kg	1	10/20/2009 12:42:00 AM
Barium	2180	0.100		mg/Kg	1	10/20/2009 12:42:00 AM
Lead	284	0.100		mg/Kg	1	10/20/2009 12:42:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0010

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-015

**Client Sample ID:** E9-E7  
**Collection Date:** 10/16/2009 9:31:00 AM

**Matrix:** SOLID

<b>Analyses</b>	<b>Result</b>	<b>Limit</b>	<b>Qual</b>	<b>Units</b>	<b>DF</b>	<b>Date Analyzed</b>
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			<b>Analyst: HN</b>
Arsenic	2.89	0.100		mg/Kg	1	10/20/2009 12:49:00 AM
Barium	411	0.100		mg/Kg	1	10/20/2009 12:49:00 AM
Lead	57.3	0.100		mg/Kg	1	10/20/2009 12:49:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-016

Client Sample ID: E9-B1  
Collection Date: 10/16/2009 9:44:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Arsenic	0.555	0.100		mg/Kg	1	10/20/2009 12:55:00 AM
Barium	93.7	0.100		mg/Kg	1	10/20/2009 12:55:00 AM
Lead	10.7	0.100		mg/Kg	1	10/20/2009 12:55:00 AM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-017

Client Sample ID: E9-B2  
Collection Date: 10/16/2009 9:46:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	5.05	0.100		mg/Kg	1	10/20/2009 1:02:00 AM
Barium	529	0.100		mg/Kg	1	10/20/2009 1:02:00 AM
Lead	99.2	0.100		mg/Kg	1	10/20/2009 1:02:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0921

**Anacon, Inc.**

Date: 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-018

**Client Sample ID:** E9-B3  
**Collection Date:** 10/16/2009 9:48:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	1.36	0.100		mg/Kg	1	10/20/2009 1:09:00 AM
Barium	123	0.100		mg/Kg	1	10/20/2009 1:09:00 AM
Lead	14.6	0.100		mg/Kg	1	10/20/2009 1:09:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0022

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-019

**Client Sample ID:** E9-B4  
**Collection Date:** 10/16/2009 9:50:00 AM

**Matrix:** SOLID

<b>Analyses</b>	<b>Result</b>	<b>Limit</b>	<b>Qual</b>	<b>Units</b>	<b>DF</b>	<b>Date Analyzed</b>
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			<b>Analyst: HN</b>
Arsenic	2.66	0.100		mg/Kg	1	10/20/2009 1:16:00 AM
Barium	176	0.100		mg/Kg	1	10/20/2009 1:16:00 AM
Lead	81.8	0.100		mg/Kg	1	10/20/2009 1:16:00 AM

**Qualifiers:**

ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-020

**Client Sample ID:** E9-B5  
**Collection Date:** 10/16/2009 9:52:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	0.927	0.100		mg/Kg	1	10/20/2009 1:22:00 AM
Barium	99.4	0.100		mg/Kg	1	10/20/2009 1:22:00 AM
Lead	8.87	0.100		mg/Kg	1	10/20/2009 1:22:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0026

**Anacon, Inc.**

**Date:** 20-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910185  
**Project:**  
**Lab ID:** 0910185-021

**Client Sample ID:** E9-B6  
**Collection Date:** 10/16/2009 9:54:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	1.11	0.100		mg/Kg	1	10/20/2009 9:42:00 AM
Barium	81.9	0.100		mg/Kg	1	10/20/2009 9:42:00 AM
Lead	48.0	0.100		mg/Kg	1	10/20/2009 9:42:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-022

Client Sample ID: E9-B7  
Collection Date: 10/16/2009 9:59:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	3.89	0.100		mg/Kg	1	10/20/2009 10:09:00 AM
Barium	348	0.100		mg/Kg	1	10/20/2009 10:09:00 AM
Lead	289	0.100		mg/Kg	1	10/20/2009 10:09:00 AM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 20-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910185  
Project:  
Lab ID: 0910185-023

Client Sample ID: E9-S2  
Collection Date: 10/16/2009 10:01:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Arsenic	4.09	0.100		mg/Kg	1	10/20/2009 10:16:00 AM
Barium	416	0.100		mg/Kg	1	10/20/2009 10:16:00 AM
Lead	41.7	0.100		mg/Kg	1	10/20/2009 10:16:00 AM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range



CLIENT: Railroad Commission of Texas - Houston

ANALYTICAL QC SUMMARY REPORT

Work Order: 0910185

Project:

TestCode: 6020\_S

Sample ID: 0910185-001A-MS    SampType: MS    TestCode: 6020\_S    Units: mg/Kg    Prep Date: 10/19/2009    Run ID: ICP-MS #1\_091019C

Client ID: E9-S1    Batch ID: R23897    TestNo: SW6020    Analysis: 10/19/2009    SeqNo: 294324

Analys: Arsenic    Result: 21    PQL: 0.100    SPK value: 20    SPK Ref Val: 4.319    %REC: 83.4    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Analys: Barium    Result: 238.8    PQL: 0.100    SPK value: 20    SPK Ref Val: 132.8    %REC: 530    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Analys: Lead    Result: 42.11    PQL: 0.100    SPK value: 20    SPK Ref Val: 24.09    %REC: 90.1    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Sample ID: 0910185-021A-MS    SampType: MS    TestCode: 6020\_S    Units: mg/Kg    Prep Date: 10/20/2009    Run ID: ICP-MS #1\_091020A

Client ID: E9-B6    Batch ID: R23898    TestNo: SW6020    Analysis: 10/20/2009    SeqNo: 294364

Analys: Arsenic    Result: 15.02    PQL: 0.100    SPK value: 20    SPK Ref Val: 1.107    %REC: 69.6    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Analys: Barium    Result: 74.13    PQL: 0.100    SPK value: 20    SPK Ref Val: 81.88    %REC: -38.8    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Analys: Lead    Result: 45.27    PQL: 0.100    SPK value: 20    SPK Ref Val: 48.03    %REC: -13.8    LowLimit: 70    HighLimit: 130    RPD Ref Val: 0    %RPD: 0    RPDLimit: 25    Qual: S

Sample ID: 0910185-001A-MSD    SampType: MSD    TestCode: 6020\_S    Units: mg/Kg    Prep Date: 10/19/2009    Run ID: ICP-MS #1\_091019C

Client ID: E9-S1    Batch ID: R23897    TestNo: SW6020    Analysis: 10/19/2009    SeqNo: 294325

Analys: Arsenic    Result: 18.17    PQL: 0.100    SPK value: 20    SPK Ref Val: 4.319    %REC: 69.3    LowLimit: 70    HighLimit: 130    RPD Ref Val: 21    %RPD: 14.4    RPDLimit: 25    Qual: S

Analys: Barium    Result: 167.7    PQL: 0.100    SPK value: 20    SPK Ref Val: 132.8    %REC: 174    LowLimit: 70    HighLimit: 130    RPD Ref Val: 238.8    %RPD: 35.0    RPDLimit: 25    Qual: SR

Analys: Lead    Result: 56.11    PQL: 0.100    SPK value: 20    SPK Ref Val: 24.09    %REC: 160    LowLimit: 70    HighLimit: 130    RPD Ref Val: 42.11    %RPD: 28.5    RPDLimit: 25    Qual: SR

Sample ID: 0910185-021A-MSD    SampType: MSD    TestCode: 6020\_S    Units: mg/Kg    Prep Date: 10/20/2009    Run ID: ICP-MS #1\_091020A

Client ID: E9-B6    Batch ID: R23898    TestNo: SW6020    Analysis: 10/20/2009    SeqNo: 294365

Analys: Arsenic    Result: 15.69    PQL: 0.100    SPK value: 20    SPK Ref Val: 1.107    %REC: 72.9    LowLimit: 70    HighLimit: 130    RPD Ref Val: 15.02    %RPD: 4.35    RPDLimit: 25    Qual: SR

Analys: Barium    Result: 127.3    PQL: 0.100    SPK value: 20    SPK Ref Val: 81.88    %REC: 227    LowLimit: 70    HighLimit: 130    RPD Ref Val: 74.13    %RPD: 52.8    RPDLimit: 25    Qual: SR

Analys: Lead    Result: 70.86    PQL: 0.100    SPK value: 20    SPK Ref Val: 48.03    %REC: 114    LowLimit: 70    HighLimit: 130    RPD Ref Val: 45.27    %RPD: 44.1    RPDLimit: 25    Qual: R

NID - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method

6200



October 27, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001  
FAX (713) 869-9621

RE:

Order No.: 0910199

Dear Brian Voyles:

Anacon, Inc. received 35 samples on 10/19/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0048  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX

ANACON, INC.

730 FM 1939  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



# Chain of Custody Record

Shaded Areas for Lab Use Only.

Page 1 of 3

Brian Vogles  
Shirley / Arvin Negepon

Analysis Log Number: 0910599

Turn Around Time: 24 hours

Sample Location: Coker Pipe

Client: **Terraron - TX RR Houston**

Contact Person: **Shirley / Arvin Negepon**

Phone Number: **713 640 8189**

Fax Number:

E-mail Address: **anacorp@terraron.com**

PO: **S.H. to RLC**

Delivered By: **B. Hernandez**

Sampled By: **Tony Coleman**

Arvin Negepon  
Please Print

Custody Seal (DRI):

Temperature: **ON ICE 5°C**

Analysis Requested

Remarks

Lab Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Total B	Total PH	Total C
01A	S01	10-19-09	0806	1	4oz	ICC	E1-W1	X		
02A			0808				E1-W2	X		
03A			0810				E1-W3	X		
04A			0812				E1-W4	X		
05A			0830				E1-N1	X		
06A			0832				E1-N2	X		
07A			0834				E1-N3	X		
08A			0836				E1-N4	X		
09A			0838				E1-N5	X		
10A			0854				E1-N6	X		
11A			0854				E1-N7	X		
12A			0856				E1-N8	X		
13A			0858				E1-N9	X		
14A			0900				E1-E1	X		
15A			10:30				E1-S1	X		
16A			10:40				E1-S2	X		
17A			10:19				E1-S3	X		

Relinquished By: **Arvin Negepon** Date: **10/19/09** Time: **4:00**

Accepted By: **Shirley** Date: **10/19/09** Time: **4:01**

Relinquished By: **Arvin Negepon** Date: **10/19/09** Time: **4:30**

Accepted By: **Shirley** Date: **10/19/09** Time: **4:30**

Preservation Code: 1=H2O3, 2=H2SO4, 3=HCl, 4=HCl, 5=None

S=Dirty, W=Water, Sludge=Sludge, O=OI, IFF=Influent

Matrix Code: S=Solid, EFF=Effluent, W=Water, Sludge=Sludge, O=OI, IFF=Influent

Containers: P=Plastic, G=Glass, V=Vials, B=Barrel





**Anacon, Inc.**

**Date:** 27-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Project:**

**CASE NARRATIVE**

**Lab Order:** 0910199

Anacon, Inc. received 35 soil samples to be analyzed for Total Lead, 1 of these samples were also analyzed for Total Cadmium. The samples were received in good condition and within hold times required for analysis. There was a problem noted with one of the MS and MSDs for the analysis. All other QC was within the required limits and has been included for review.

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN

Date and Time Receive

10/19/2009

Work Order Numbe 0910199

Received by: CC

Checklist completed by A. Cupe 10/19/09  
Signature Date

Reviewed by JMK 10/20/09  
Initials Date

Matrix: Solid

Carrier name: Blas Hernandez

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- If samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? No VOA vials submitted  Yes  No
- Water - pH acceptable upon receipt? Yes  No

5°C

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section be

-----

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

Corrective Action \_\_\_\_\_

\_\_\_\_\_

\_\_\_\_\_

0005

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-001

Client Sample ID: E1-W1  
Collection Date: 10/19/2009 8:06:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Cadmium	1.10	0.100		mg/Kg	1	10/20/2009 1:42:00 PM
Lead	51.4	0.100		mg/Kg	1	10/20/2009 1:42:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0006

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-002

**Client Sample ID:** E1-W2  
**Collection Date:** 10/19/2009 8:08:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	129	0.100		mg/Kg	1	10/20/2009 2:22:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0007

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-003

**Client Sample ID:** E1-W3  
**Collection Date:** 10/19/2009 8:10:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	5.67	0.100		mg/Kg	1	10/20/2009 2:28:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-004

Client Sample ID: E1-W4  
Collection Date: 10/19/2009 8:12:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	351	0.100		mg/Kg	1	10/20/2009 2:35:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0009

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-005

Client Sample ID: E1-N1  
Collection Date: 10/19/2009 8:30:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	442	0.100		mg/Kg	1	10/20/2009 2:42:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0010

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-006

**Client Sample ID:** E1-N2  
**Collection Date:** 10/19/2009 8:32:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: <b>HN</b>
Lead	432	0.100		mg/Kg	1	10/20/2009 2:48:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0011

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-007

**Client Sample ID:** E1-N3  
**Collection Date:** 10/19/2009 8:34:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	468	0.100		mg/Kg	1	10/20/2009 2:55:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-008

Client Sample ID: E1-N4  
Collection Date: 10/19/2009 8:36:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	1270	0.100		mg/Kg	1	10/20/2009 3:01:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0013

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-009

**Client Sample ID:** E1-N5  
**Collection Date:** 10/19/2009 8:38:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	1160	0.100		mg/Kg	1	10/20/2009 3:08:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0016

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-010

Client Sample ID: E1-N6  
Collection Date: 10/19/2009 8:54:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	463	0.100		mg/Kg	1	10/20/2009 3:28:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0015

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-011

Client Sample ID: E1-N7  
Collection Date: 10/19/2009 8:54:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	72.9	0.100		mg/Kg	1	10/20/2009 3:34:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-012

**Client Sample ID:** E1-N8  
**Collection Date:** 10/19/2009 8:56:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	336	0.100		mg/Kg	1	10/20/2009 3:41:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0017

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-013

**Client Sample ID:** E1-E1  
**Collection Date:** 10/19/2009 8:58:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	611	0.100		mg/Kg	1	10/20/2009 3:48:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0018

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-014

Client Sample ID: E1-E2  
Collection Date: 10/19/2009 9:00:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	158	0.100		mg/Kg	1	10/20/2009 3:54:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0019

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E1-S1

Lab Order: 0910199

Collection Date: 10/19/2009 9:58:00 AM

Project:

Lab ID: 0910199-015

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	541	0.100		mg/Kg	1	10/20/2009 4:01:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-016

**Client Sample ID:** E1-S2  
**Collection Date:** 10/19/2009 10:08:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	1540	0.100		mg/Kg	1	10/20/2009 4:08:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0021

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E1-S3

Lab Order: 0910199

Collection Date: 10/19/2009 10:19:00 AM

Project:

Lab ID: 0910199-017

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	1240	0.100		mg/Kg	1	10/20/2009 4:14:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0022

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-018

**Client Sample ID:** E1-S4  
**Collection Date:** 10/19/2009 10:27:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	3110	0.100		mg/Kg	1	10/20/2009 4:21:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0020

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E1-S5

Lab Order: 0910199

Collection Date: 10/19/2009 10:38:00 AM

Project:

Lab ID: 0910199-019

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	48.2	0.100		mg/Kg	1	10/20/2009 4:27:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0024

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-020

Client Sample ID: E1-S6  
Collection Date: 10/19/2009 10:50:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	80.5	0.100		mg/Kg	1	10/20/2009 5:01:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0025

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-021

Client Sample ID: E1-S7  
Collection Date: 10/19/2009 10:53:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	894	0.100		mg/Kg	1	10/20/2009 5:28:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-022

Client Sample ID: E1-S8  
Collection Date: 10/19/2009 11:05:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						
Lead	899	0.100		mg/Kg	1	10/20/2009 5:34:00 PM

Analyst: HN

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0027

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-023

**Client Sample ID:** E1-B1  
**Collection Date:** 10/19/2009 12:02:00 PM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.56	0.100		mg/Kg	1	10/20/2009 5:41:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

Date: 21-Oct-09

Anacon, Inc.

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-024

Client Sample ID: E1-B2  
Collection Date: 10/19/2009 12:07:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	6.74	0.100		mg/Kg	1	10/20/2009 5:48:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

00/9

**Anacon, Inc.**

Date: 21-Oct-09

---

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E1-B3  
**Lab Order:** 0910199      **Collection Date:** 10/19/2009 12:13:00 PM  
**Project:**  
**Lab ID:** 0910199-025      **Matrix:** SOLID

---

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	6.23	0.100		mg/Kg	1	10/20/2009 6:08:00 PM

---

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                          J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                          B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                          \* - Value exceeds Maximum Contaminant Level

Date: 21-Oct-09

**Anacon, Inc.**

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-026

**Client Sample ID:** E1-B4  
**Collection Date:** 10/19/2009 12:23:00 PM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	8.11	0.100		mg/Kg	1	10/20/2009 6:14:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0030

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-027

Client Sample ID: E1-B5  
Collection Date: 10/19/2009 12:38:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	4.51	0.100		mg/Kg	1	10/20/2009 6:21:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0031

**Anacon, Inc.**

**Date:** 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-028

**Client Sample ID:** E1-B6  
**Collection Date:** 10/19/2009 12:35:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	5.70	0.100		mg/Kg	1	10/20/2009 6:28:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0032

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-029

Client Sample ID: E1-B7  
Collection Date: 10/19/2009 12:40:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	6.40	0.100		mg/Kg	1	10/20/2009 6:34:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0033

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-030

Client Sample ID: E1-B8  
Collection Date: 10/19/2009 12:50:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	5.72	0.100		mg/Kg	1	10/20/2009 6:41:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0036

**Anacon, Inc.**

**Date:** 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-031

**Client Sample ID:** E1-B9  
**Collection Date:** 10/19/2009 1:00:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	20.9	0.100		mg/Kg	1	10/20/2009 6:48:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0035

Date: 21-Oct-09

**Anacon, Inc.**

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-032

**Client Sample ID:** PR1-1  
**Collection Date:** 10/19/2009 2:31:00 PM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	929	0.100		mg/Kg	1	10/20/2009 6:55:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0036

**Anacon, Inc.**

Date: 21-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910199  
**Project:**  
**Lab ID:** 0910199-033

**Client Sample ID:** PR1-2  
**Collection Date:** 10/19/2009 2:37:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	194	0.100		mg/Kg	1	10/20/2009 7:01:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0037

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-034

Client Sample ID: PR2-1  
Collection Date: 10/19/2009 2:27:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	361	0.100		mg/Kg	1	10/20/2009 7:08:00 PM

Qualifiers:  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0038

**Anacon, Inc.**

Date: 21-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910199  
Project:  
Lab ID: 0910199-035

Client Sample ID: E1-B10  
Collection Date: 10/19/2009 12:44:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	11.3	0.100		mg/Kg	1	10/20/2009 7:28:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

Anacon, Inc.

Date: 27-Oct-09

# ANALYTICAL QC SUMMARY REPORT

CLIENT: Railroad Commission of Texas - Houston  
Work Order: 0910199  
Project:

TestCode: 6020\_S

0700

Sample ID	Client ID	Sample ID	Batch ID	Sample Type	Result	TestCode	TestNo	Units	SPK value	SPK Ref Val	%REC	Prep Date	LowLimit	HighLimit	RPD Ref Val	Run ID	SeqNo	%RPD	RPDLimit	Qual	
Sample ID: BLK102009MMK	Client ID: ZZZZZ	Sample ID: MBLK	Batch ID: R23918	Sample Type: MBLK	Result	TestCode: 6020_S	TestNo: SW6020	Units: mg/Kg	SPK value	SPK Ref Val	%REC	Prep Date: 10/20/2009	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091020C	SeqNo: 294610	%RPD	RPDLimit	Qual	
Analyte					ND	PQL															
Cadmium					0.1819	PQL															
Lead					0.100	PQL															
Sample ID: BLK102009MMK	Client ID: ZZZZZ	Sample ID: MBLK	Batch ID: R23919	Sample Type: MBLK	Result	TestCode: 6020_S	TestNo: SW6020	Units: mg/Kg	SPK value	SPK Ref Val	%REC	Prep Date: 10/20/2009	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091020D	SeqNo: 294635	%RPD	RPDLimit	Qual	
Analyte					0.56	PQL															
Lead					0.100	PQL															
Sample ID: LCS102009MMK	Client ID: ZZZZZ	Sample ID: LCS	Batch ID: R23918	Sample Type: LCS	Result	TestCode: 6020_S	TestNo: SW6020	Units: mg/Kg	SPK value	SPK Ref Val	%REC	Prep Date: 10/20/2009	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091020C	SeqNo: 294611	%RPD	RPDLimit	Qual	
Analyte					15.14	PQL															
Cadmium					18.79	PQL															
Lead					0.100	PQL															
Sample ID: LCS102009MMK	Client ID: ZZZZZ	Sample ID: LCS	Batch ID: R23919	Sample Type: LCS	Result	TestCode: 6020_S	TestNo: SW6020	Units: mg/Kg	SPK value	SPK Ref Val	%REC	Prep Date: 10/20/2009	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091020D	SeqNo: 294636	%RPD	RPDLimit	Qual	
Analyte					17.7	PQL															
Lead					0.100	PQL															
Sample ID: 0910199-001A-MS	Client ID: E1-W1	Sample ID: MS	Batch ID: R23918	Sample Type: MS	Result	TestCode: 6020_S	TestNo: SW6020	Units: mg/Kg	SPK value	SPK Ref Val	%REC	Prep Date: 10/20/2009	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091020C	SeqNo: 294614	%RPD	RPDLimit	Qual	
Analyte					14.44	PQL															
Cadmium					44.05	PQL															
Lead					0.100	PQL															

Qualifiers: NID - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

# ANALYTICAL QC SUMMARY REPORT

**CLIENT:** Railroad Commission of Texas - Houston  
**Work Order:** 0910199  
**Project:**

TestCode: 6020\_S

Sample ID	Batch ID	SampType	MS	TestCode	6020_S	Units	mg/Kg	Prep Date	10/20/2009	Run ID	ICP-MS #1_091020D		
Client ID: E1-S6	R23919	MS		TestNo: SW6020				Analysis		SeqNo: 294638			
Analyte		Result		PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		41.27		0.100	20	80.46	-196	70	130	0	0		S
Sample ID: 0910199-001A-MSD		SampType: MSD		TestCode: 6020_S				Prep Date:		Run ID: ICP-MS #1_091020C			
Client ID: E1-W1	R23918	MSD		TestNo: SW6020				Analysis	10/20/2009	SeqNo: 294615			
Analyte		Result		PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Cadmium		13.42		0.100	20	1.095	61.6	70	130	14.44	7.35	25	S
Lead		71.92		0.100	20	51.36	103	70	130	44.05	48.1	25	R
Sample ID: 0910199-020A-MSD		SampType: MSD		TestCode: 6020_S				Prep Date:		Run ID: ICP-MS #1_091020D			
Client ID: E1-S6	R23919	MSD		TestNo: SW6020				Analysis	10/20/2009	SeqNo: 294639			
Analyte		Result		PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead		100.6		0.100	20	80.46	101	70	130	41.27	83.6	25	BR

**Qualifiers:** NID - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method



October 27, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001

FAX (713) 869-9621

RE:

Order No.: 0910214

Dear Brian Voyles:


Anacon, Inc. received 32 samples on 10/20/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0041  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX

730 FM 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



Chain of Custody Record

Shaded Areas for Lab Use Only.

ORIGINAL Page 1 of 2

Client: Texas Consultants Inc. TXRP - Houston

Address: 1555 Clay Road Houston, TX

PO# 511 JRRP

Contact Person: Brian Vogles  
Phone Number: 7132405489  
E-mail Address: mvogles@texascons.com

Anticon Log Number: 09102143  
Turn Around Time: 24 hours  
Sample Location: Cactus Pipe

Delivered By: A. Hanson

Custody Seal (Y/N): 5C

Sampled By: Arian Neegare  
Please Print

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Matrix Code	Container Code	Notes
D1A	Sol	10/26/09	10:04	1	1029011e		E10-R1	EFF		
D2A			10:11				E10-R2			
C3A			10:18				E10-S1			
C4A			10:35				E10-W1			
C5A			10:22				E10-F1			
C10A			11:21				E11-R1			
C11A			11:24				E11-R2			
C12A			11:31				E11-F1			
C13A			11:10				E11-W1			
I0A			11:27				E11-S1			
I1A			12:00				E12-R1			
I2A			12:05				E12-R2			
I3A			12:18				E12-S2			
I4A			12:10				E12-W1			
I5A			14:28				PR1-3			
I6A			14:33				PR1-4			
I7A			14:34				PR1-5			

Relinquished By: [Signature] Date: 10/20/09 Time: 3:54  
Accepted By: [Signature] Date: 10-20-09 Time: 3:54  
Relinquished By: [Signature] Date: 10-20-09 Time: 4:00  
Accepted By: [Signature] Date: 10-20-09 Time: 4:30  
Relinquished by: [Signature] Date: 10-20-09 Time: 4:30  
Accepted By: [Signature] Date: 10-20-09 Time: 4:30

Preservation Code: 1=HNO3 6=Other  
2=H2SO4  
3=NaOH  
4=HCL  
5=None  
Matrix Code: S=Solid EFF=Effluent  
W=Water  
Sludg=Sludge  
O=Oil  
INF=Influent  
Container Code: P=Plastic  
G=Glass  
V=Vial  
B=Bacterial

730 FM 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



Chain of Custody Record

ORIGINAL

Page 2 of 2

Shaded Areas for Lab Use Only.

Client:

Trevorcon (envi/bio/s)

Address:

11555 City Pkwy

PO#

Call to RPR

Contact Person:

Anna Neepore / Scott Colman

Phone Number:

713 610 8989

Fax Number:

E-mail Address:

ANACON@TREVORCON.COM  
scott.colman@trevorcon.com

Sampled By:

Anna Neepore

Please Print

Analysis Requested

Remarks

Delivered By:

Custody Seal (Y/N):

Temperature: ON ICE

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres	Client Sample ID	Matrix	Matrix Code	Containers	Notes
2011		10/20/09	14:36	1	5L - 911	IC	PR-6	X	EFF		
201A			14:39				PR-7	X			
201A			14:41				PR-8	X			
201A			14:45				PR-9	X			
201A			14:49				PR-10	X			
201A			13:22				PR-2	X			
201A			13:30				PR-3	X			
201A			13:35				PR-4	X			
201A			13:49				PR-5	X			
201A			13:55				PR-6	X			
201A			13:59				PR-7	X			
201A			14:05				PR-8	X			
201A			14:09				PR-9	X			
201A			14:13				PR-10	X			
201A			14:18				PR-11	X			

Relinquished By: Anna Neepore Date: 10/20/09 Time: 3:51

Accepted By: Scott Colman Date: 10/20/09 Time: 3:59

Relinquished By: Anna Neepore Date: 10/21/09 Time: 4:30

Accepted By: Scott Colman Date: 10/20/09 Time: 4:30

Relinquished by: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Accepted By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Preservation Code: 1=HNO3, 2=H2SO4, 3=NaOH, 4=HCL, 5=None

Matrix Code: S=Solid, W=Water, Sludg=Sludge, O=Oil, INF=Influent

Containers: P=Plastic, G=Glass, V=Voa, B=Bacterial

**Anacon, Inc.****Date:** 27-Oct-09**CLIENT:** Railroad Commission of Texas - Houston**Project:****Lab Order:** 0910214**CASE NARRATIVE**

Anacon, Inc. received 32 soil samples to be analyzed for Total Lead, 13 of these samples were also analyzed for TPH. The samples were received in good condition and within hold times required for analysis. One of the samples TPH surrogates were masked by other peaks present. There was also a problem noted with one of the MS and MSDs for Lead analysis. The content of lead in the sample was too high compared to the spike amount used. All other QC was within the required limits and has been included for review.

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN

Date and Time Receive

10/20/2009

Work Order Numbe 0910214

Received by: CC

Checklist completed by A. Cupe 10/20/09  
Signature Date

Reviewed by mk 10/20/09  
Initials Date

Matrix: Solid

Carrier name: Clint Larison

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- If samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? No VOA vials submitted  Yes  No
- Water - pH acceptable upon receipt? Yes  No

5°C

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section be

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_

Corrective Action \_\_\_\_\_

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-001

**Client Sample ID:** E10-B1  
**Collection Date:** 10/20/2009 10:04:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	18.3	0.100		mg/Kg	1	10/21/2009 6:17:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	93.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	93.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E10-B2

**Lab Order:** 0910214

**Collection Date:** 10/20/2009 10:11:00 AM

**Project:**

**Lab ID:** 0910214-002

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	12.7	0.100		mg/Kg	1	10/21/2009 6:57:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	234	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	234	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	83.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	93.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0006

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E10-S1

**Lab Order:** 0910214

**Collection Date:** 10/20/2009 10:18:00 AM

**Project:**

**Lab ID:** 0910214-003

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	653	0.100		mg/Kg	1	10/21/2009 7:04:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	627	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	627	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	87.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	96.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E10-W1  
 Lab Order: 0910214      Collection Date: 10/20/2009 10:33:00 AM  
 Project:  
 Lab ID: 0910214-004      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	5.88	0.100		mg/Kg	1	10/21/2009 7:11:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	95.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	91.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0006

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-005

**Client Sample ID:** E10-E1  
**Collection Date:** 10/20/2009 10:22:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	571	0.100		mg/Kg	1	10/21/2009 7:17:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	15700	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	398	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	15300	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	88.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	108	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0009

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-006

**Client Sample ID:** E11-B1  
**Collection Date:** 10/20/2009 11:21:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	5.05	0.100		mg/Kg	1	10/21/2009 7:24:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	2230	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	2230	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	90.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	119	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0010

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-007

**Client Sample ID:** E11-B2  
**Collection Date:** 10/20/2009 11:24:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	4.85	0.100		mg/Kg	1	10/21/2009 7:31:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	93.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	83.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

001P

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
 Lab Order: 0910214  
 Project:  
 Lab ID: 0910214-008

Client Sample ID: E11-E1  
 Collection Date: 10/20/2009 11:31:00 AM  
 Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	2070	0.100		mg/Kg	1	10/21/2009 7:38:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	23200	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	383	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	22800	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	70.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	0	50-150	S	%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0012

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-009

**Client Sample ID:** E11-W1  
**Collection Date:** 10/20/2009 11:10:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	20.9	0.100		mg/Kg	1	10/21/2009 7:58:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	4680	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	4680	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	98.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	130	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-010

**Client Sample ID:** E11-S1  
**Collection Date:** 10/20/2009 11:27:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	451	0.100		mg/Kg	1	10/21/2009 8:04:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	305	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	305	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	91.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	117	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0014

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-011

**Client Sample ID:** E12-B1  
**Collection Date:** 10/20/2009 12:00:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: <b>HN</b>
Lead	6.15	0.100		mg/Kg	1	10/21/2009 8:11:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: <b>JL</b>
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	100	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	114	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0015

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-012

**Client Sample ID:** E12-B2  
**Collection Date:** 10/20/2009 12:05:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	11.8	0.100		mg/Kg	1	10/21/2009 8:18:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	83.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	99.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0016

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-013

**Client Sample ID:** E12-S2  
**Collection Date:** 10/20/2009 12:18:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	68.6	0.100		mg/Kg	1	10/21/2009 8:25:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	80.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	103	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0017

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-014

**Client Sample ID:** E12-N1  
**Collection Date:** 10/20/2009 12:10:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	44.9	0.100		mg/Kg	1	10/21/2009 8:31:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0018

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** PR1-3

**Lab Order:** 0910214

**Collection Date:** 10/20/2009 2:28:00 PM

**Project:**

**Lab ID:** 0910214-015

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	410	0.100		mg/Kg	1	10/21/2009 8:38:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0019

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: PR1-4

Lab Order: 0910214

Collection Date: 10/20/2009 2:33:00 PM

Project:

Lab ID: 0910214-016

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	9.77	0.100		mg/Kg	1	10/21/2009 8:45:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910214  
Project:  
Lab ID: 0910214-017

Client Sample ID: PR1-5  
Collection Date: 10/20/2009 2:34:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	169	0.100		mg/Kg	1	10/21/2009 8:51:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: PR1-6

Lab Order: 0910214

Collection Date: 10/20/2009 2:36:00 PM

Project:

Lab ID: 0910214-018

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	9.96	0.100		mg/Kg	1	10/21/2009 9:11:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0022

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** PR1-7  
**Lab Order:** 0910214      **Collection Date:** 10/20/2009 2:39:00 PM  
**Project:**  
**Lab ID:** 0910214-019      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	614	0.100		mg/Kg	1	10/21/2009 9:18:00 PM

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                          J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                          B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                          \* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-020

**Client Sample ID:** PR1-8  
**Collection Date:** 10/20/2009 2:41:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.97	0.100		mg/Kg	1	10/21/2009 9:25:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910214  
Project:  
Lab ID: 0910214-021

Client Sample ID: PR1-9  
Collection Date: 10/20/2009 2:45:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	2630	0.100		mg/Kg	1	10/21/2009 9:45:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0025

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910214  
Project:  
Lab ID: 0910214-022

Client Sample ID: PR1-10  
Collection Date: 10/20/2009 2:49:00 PM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	14.0	0.100		mg/Kg	1	10/21/2009 10:25:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** PR-2  
**Lab Order:** 0910214      **Collection Date:** 10/20/2009 1:22:00 PM  
**Project:**  
**Lab ID:** 0910214-023      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	134	0.100		mg/Kg	1	10/21/2009 10:32:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

0027

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** PR-3  
**Lab Order:** 0910214      **Collection Date:** 10/20/2009 1:30:00 PM  
**Project:**  
**Lab ID:** 0910214-024      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	174	0.100		mg/Kg	1	10/21/2009 10:38:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
\* - Value exceeds Maximum Contaminant Level

0028

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-025

**Client Sample ID:** PR-4  
**Collection Date:** 10/20/2009 1:38:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	151	0.100		mg/Kg	1	10/21/2009 10:45:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0029

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-026

**Client Sample ID:** PR-5  
**Collection Date:** 10/20/2009 1:49:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						
Lead	30.5	0.100		mg/Kg	1	10/21/2009 10:52:00 PM

SW6020

Analyst: HN

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0030

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** PR-6

**Lab Order:** 0910214

**Collection Date:** 10/20/2009 1:55:00 PM

**Project:**

**Lab ID:** 0910214-027

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	75.3	0.100		mg/Kg	1	10/21/2009 10:58:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910214  
Project:  
Lab ID: 0910214-028

Client Sample ID: PR-7  
Collection Date: 10/20/2009 1:59:00 PM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.24	0.100		mg/Kg	1	10/21/2009 11:05:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0032

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-029

**Client Sample ID:** PR-8  
**Collection Date:** 10/20/2009 2:05:00 PM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	231	0.100		mg/Kg	1	10/21/2009 11:12:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0030

**Anacon, Inc.**

Date: 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-030

**Client Sample ID:** PR-9  
**Collection Date:** 10/20/2009 2:09:00 PM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	117	0.100		mg/Kg	1	10/21/2009 11:18:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 22-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910214  
**Project:**  
**Lab ID:** 0910214-031

**Client Sample ID:** PR-10  
**Collection Date:** 10/20/2009 2:13:00 PM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	6.59	0.100		mg/Kg	1	10/21/2009 11:39:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0035

**Anacon, Inc.**

Date: 22-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: PR-11

Lab Order: 0910214

Collection Date: 10/20/2009 2:18:00 PM

Project:

Lab ID: 0910214-032

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	26.1	0.100		mg/Kg	1	10/21/2009 11:45:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

ANALYTICAL QC SUMMARY REPORT

CLIENT: Railroad Commission of Texas - Houston  
Work Order: 0910214  
Project:

TestCode: 6020\_S

1300

Sample ID	Client ID	SampType	Batch ID	Result	TestCode	TestNo	SPK value	SPK Ref Val	Units	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID	SeqNo	ICP-MS #1	RPD	RPDLimit	Qual	
Sample ID: BLK102109MMK	Client ID: ZZZZZ	SampType: MBLK	Batch ID: R23938	Result	TestCode: 6020_S	TestNo: SW6020	SPK value	SPK Ref Val	Units: mg/Kg	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091021D	SeqNo: 294859		%RPD	RPDLimit	Qual	
Lead				0.1947	0.100															
Sample ID: BLK102109MMK2	Client ID: ZZZZZ	SampType: MBLK	Batch ID: R23939	Result	TestCode: 6020_S	TestNo: SW6020	SPK value	SPK Ref Val	Units: mg/Kg	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091021E	SeqNo: 294884		%RPD	RPDLimit	Qual	
Lead				0.3911	0.100															
Sample ID: LCS102109MMK	Client ID: ZZZZZ	SampType: LCS	Batch ID: R23938	Result	TestCode: 6020_S	TestNo: SW6020	SPK value	SPK Ref Val	Units: mg/Kg	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091021D	SeqNo: 294860		%RPD	RPDLimit	Qual	
Lead				18.69	0.100		20	0.1947		92.5	75	125	0							
Sample ID: LCS102109MMK2	Client ID: ZZZZZ	SampType: LCS	Batch ID: R23939	Result	TestCode: 6020_S	TestNo: SW6020	SPK value	SPK Ref Val	Units: mg/Kg	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091021E	SeqNo: 294885		%RPD	RPDLimit	Qual	
Lead				18.79	0.100		20	0.3911		92	75	125	0							
Sample ID: 0910214-001A-MS	Client ID: E10-B1	SampType: MS	Batch ID: R23938	Result	TestCode: 6020_S	TestNo: SW6020	SPK value	SPK Ref Val	Units: mg/Kg	%REC	LowLimit	HighLimit	RPD Ref Val	Run ID: ICP-MS #1_091021D	SeqNo: 294862		%RPD	RPDLimit	Qual	
Lead				32.74	0.100		20	18.32		72.1	70	130	0							

Qualifiers: NID - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

# ANALYTICAL QC SUMMARY REPORT

**CLIENT:** Railroad Commission of Texas - Houston  
**Work Order:** 0910214  
**Project:** 0910214

**TestCode: 6020\_S**

Sample ID	Batch ID	SamptType	MS	TestCode	Units	mg/Kg	Prep Date	Run ID	ICP-MS #1_091021E
Client ID: PR1-9	Batch ID: R23939	MS	TestNo: SW6020	6020_S	mg/Kg		Analysis: 10/21/2009	SeqNo: 294887	
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD RPDLimit Qual
Lead	3425	0.100	20	2630	3980	70	130	0	0 S
Sample ID: 0910214-001A-MSD	Batch ID: R23938	MSD	TestCode: 6020_S	6020_S	mg/Kg		Prep Date: Analysis: 10/21/2009	Run ID: ICP-MS #1_091021D	
Client ID: E10-B1	Batch ID: R23938	MSD	TestNo: SW6020	6020_S	mg/Kg		Analysis: 10/21/2009	SeqNo: 294863	
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD RPDLimit Qual
Lead	38.7	0.100	20	18.32	102	70	130	32.74	16.7 25
Sample ID: 0910214-021A-MSD	Batch ID: R23939	MSD	TestCode: 6020_S	6020_S	mg/Kg		Prep Date: Analysis: 10/21/2009	Run ID: ICP-MS #1_091021E	
Client ID: PR1-9	Batch ID: R23939	MSD	TestNo: SW6020	6020_S	mg/Kg		Analysis: 10/21/2009	SeqNo: 294888	
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD RPDLimit Qual
Lead	3000	0.100	20	2630	1850	70	130	3425	13.2 25 S

**Qualifiers:** NID - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

Anacon, Inc.  
730 FM 1959  
Houston, TX 77034

QA/QC REPORT - LCS

Sample ID: LCS Matrix: Solid  
Anacon Number: 0214, 0224 Units mg/kg

Analyte / Method Number	Blk Value	Spike Conc.	LCS Conc.	% Recovery	Recovery Limits
TPH-GRO - 1005	< 50	500	506	101	60-120
TPH-DRO - 1005	< 50	500	536	107	60-120

LCS Advisory Limits

RPD: 0 out of 2 outside of QC limits

\*Matrix interference

\*\*Sample too concentrated to spike

QA/QC Manager M. Keight





October 27, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001

FAX (713) 869-9621

RE:

Dear Brian Voyles:


Order No.: 0910224


Anacon, Inc. received 37 samples on 10/21/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0046  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX

730 FM 1959  
HOUSTON, TX 77034  
(281) 922-7000 Tel.  
(281) 481-0089 Fax



Chain of Custody Record

Shaded Areas for Lab Use Only.

Client: Terracore TXRR-Houston  
Address: 11555 CVR ROAD

Contact Person: Steve Kelly  
Phone Number: 713 469 3967  
Fax Number: \_\_\_\_\_  
E-mail Address: \_\_\_\_\_

Anacon Log Number: 091034  
Turn Around Time: 24 hrs  
Sample Location: Arturo pipe

PO# B/L to DL

Delivered By: Client  
Custody Seal Y/N: \_\_\_\_\_  
Temperature: ON RE SEC

Sampled By: David Coleman  
Arundel  
Please Print

Log Number	Sample Matrix	Date Collected	Time Collected	# of Containers	Type of Container	Pres.	Client Sample ID	Matrix Code	Containers	Notes
01A	Soil	10-21-09	08:20	7	4oz jar	ice	E12-S1	X	P=Plastic	
02A			08:42				E15-S1	X	G=Glass	
03A			08:51				E15-N1	X	V=Voa	
04A			08:42				E15-L01	X	B=Bacterial	
05A			08:42				E15-N2	X		
06A			08:42				E15-N3	X		
07A			09:04				E15-E1	X		
08A			10:35				E15-S2	X		
09A			10:42				E15-S3	X		
10A			10:44				E15-B3	X		
11A			10:46				E15-B1	X		
12A			10:48				E13-E1	X		
13A			10:50				E13-L01	X		
14A			08:02				E13-N1	X		
15A			08:06							
16A			08:09							
17A			08:15							

Relinquished By: Justin Date: 10-21-09 Time: 13:10  
 Accepted By: Steve Kelly Date: 10-21-09 Time: 13:10  
 Relinquished By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_  
 Accepted By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_  
 Relinquished By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_  
 Accepted By: \_\_\_\_\_ Date: \_\_\_\_\_ Time: \_\_\_\_\_

Preservation Code: 1-HNO3, 2-H2SO4, 3-NaOH, 4-HCl, 5=None  
 Matrix Code: S=Solid, W=Water, Sludge=Sludge, O=Oil, INF=Influent  
 Containers: P=Plastic, G=Glass, V=Voa, B=Bacterial

Analysis Requested

Remarks





**Anacon, Inc.**

**Date:** 27-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Project:**

**Lab Order:** 0910224

**CASE NARRATIVE**

Anacon, Inc. received 37 soil samples to be analyzed for Total Lead, and 17 of these samples were also analyzed for TPH. The samples were received in good condition and within hold times required for analysis. All QC was within the required limits and has been included for review.

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN

Date and Time Receive

10/21/2009

Work Order Numbe 0910224

Received by: CC

Checklist completed by A. Cupe 10/21/09  
Signature Date

Reviewed by MC 10/21/09  
Initials Date

Matrix: Solid

Carrier name: Client

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- All samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? Yes  No
- No VOA vials submitted  Yes  No

5°C

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section be

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_

Corrective Action \_\_\_\_\_

0005

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-001

**Client Sample ID:** E12-E2  
**Collection Date:** 10/21/2009 8:00:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	6.75	0.100		mg/Kg	1	10/22/2009 6:37:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	81.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	75.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
 Lab Order: 0910224  
 Project:  
 Lab ID: 0910224-002

Client Sample ID: E12-S2  
 Collection Date: 10/21/2009 8:42:00 AM  
 Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	7.52	0.100		mg/Kg	1	10/22/2009 7:17:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	75.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	74.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0007

Anacon, Inc.

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-003

Client Sample ID: E15-S1  
Collection Date: 10/21/2009 8:51:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	286	0.100		mg/Kg	1	10/22/2009 7:24:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	77.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	80.0	50-150		%REC	1	10/22/2009

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0000

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-004

**Client Sample ID:** E15-N1  
**Collection Date:** 10/21/2009 8:42:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	55.5	0.100		mg/Kg	1	10/22/2009 7:31:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	70.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	74.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0009

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-005

Client Sample ID: E15-W1  
Collection Date: 10/21/2009 9:00:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	7.02	0.100		mg/Kg	1	10/22/2009 7:37:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	92.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	97.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

Anacon, Inc.

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-006

Client Sample ID: E15-B1  
Collection Date: 10/21/2009 9:04:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	8.63	0.100		mg/Kg	1	10/22/2009 7:44:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	84.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	96.0	50-150		%REC	1	10/22/2009

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0011

Anacon, Inc.

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-007

Client Sample ID: E15-N2  
Collection Date: 10/21/2009 10:38:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	368	0.100		mg/Kg	1	10/22/2009 7:51:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	82.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	88.0	50-150		%REC	1	10/22/2009

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0012

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
 Lab Order: 0910224  
 Project:  
 Lab ID: 0910224-008

Client Sample ID: E15-N3  
 Collection Date: 10/21/2009 10:40:00 AM  
 Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	14.1	0.100		mg/Kg	1	10/22/2009 8:11:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	788	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	788	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	50.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	55.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0010

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E15-E1

Lab Order: 0910224

Collection Date: 10/21/2009 10:42:00 AM

Project:

Lab ID: 0910224-009

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	14.0	0.100		mg/Kg	1	10/22/2009 8:18:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	1570	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	1570	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	72.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	127	50-150		%REC	1	10/22/2009

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0016

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E15-S2

**Lab Order:** 0910224

**Collection Date:** 10/21/2009 10:44:00 AM

**Project:**

**Lab ID:** 0910224-010

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	76.1	0.100		mg/Kg	1	10/22/2009 8:24:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	2730	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	81.0	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	2650	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	73.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	109	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-011

**Client Sample ID:** E15-S3  
**Collection Date:** 10/21/2009 10:46:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	834	0.100		mg/Kg	1	10/22/2009 8:31:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	6080	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	305	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	5770	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	69.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	114	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E15-B2

**Lab Order:** 0910224

**Collection Date:** 10/21/2009 10:48:00 AM

**Project:**

**Lab ID:** 0910224-012

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	29.1	0.100		mg/Kg	1	10/22/2009 8:38:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	97.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	104	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0017

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston

**Client Sample ID:** E15-B3

**Lab Order:** 0910224

**Collection Date:** 10/21/2009 10:50:00 AM

**Project:**

**Lab ID:** 0910224-013

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	4.83	0.100		mg/Kg	1	10/22/2009 8:44:00 PM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	50.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	83.0	50-150		%REC	1	10/22/2009

**Qualifiers:**  
 ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0018

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E13-B1  
**Lab Order:** 0910224      **Collection Date:** 10/21/2009 8:02:00 AM  
**Project:**  
**Lab ID:** 0910224-014      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	8.74	0.100		mg/Kg	1	10/22/2009 8:51:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0010

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E13-E1

Lab Order: 0910224

Collection Date: 10/21/2009 8:06:00 AM

Project:

Lab ID: 0910224-015

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	493	0.100		mg/Kg	1	10/22/2009 8:58:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0020

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-016

Client Sample ID: E13-W1  
Collection Date: 10/21/2009 8:09:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	9.40	0.100		mg/Kg	1	10/22/2009 9:04:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0021

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-017

**Client Sample ID:** E13-N1  
**Collection Date:** 10/21/2009 8:15:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	182	0.100		mg/Kg	1	10/22/2009 9:25:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0082

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E13-S1

Lab Order: 0910224

Collection Date: 10/21/2009 8:19:00 AM

Project:

Lab ID: 0910224-018

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	715	0.100		mg/Kg	1	10/22/2009 9:31:00 PM

**Qualifiers:**

ND - Not Detected at the Reporting Limit

S - Spike Recovery outside accepted recovery limits

J - Analyte detected below quantitation limits

R - RPD outside accepted recovery limits

B - Analyte detected in the associated Method Blank

E - Value above quantitation range

\* - Value exceeds Maximum Contaminant Level

0020

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E14-B1  
**Lab Order:** 0910224      **Collection Date:** 10/21/2009 8:42:00 AM  
**Project:**  
**Lab ID:** 0910224-019      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	196	0.100		mg/Kg	1	10/22/2009 9:38:00 PM

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                         J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                         B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                         \* - Value exceeds Maximum Contaminant Level

0036

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-020

**Client Sample ID:** E14-B2  
**Collection Date:** 10/21/2009 8:47:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	141	0.100		mg/Kg	1	10/22/2009 9:44:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0033

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-021

Client Sample ID: E14-B3  
Collection Date: 10/21/2009 8:49:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	176	0.100		mg/Kg	1	10/22/2009 10:05:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E14-B4

Lab Order: 0910224

Collection Date: 10/21/2009 8:54:00 AM

Project:

Lab ID: 0910224-022

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	819	0.100		mg/Kg	1	10/22/2009 10:45:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0027  
Page 22 of 37

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-023

**Client Sample ID:** E14-B5  
**Collection Date:** 10/21/2009 9:06:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	8.22	0.100		mg/Kg	1	10/22/2009 10:51:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston      Client Sample ID: E14-B6  
Lab Order: 0910224      Collection Date: 10/21/2009 9:08:00 AM  
Project:  
Lab ID: 0910224-024      Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	125	0.100		mg/Kg	1	10/22/2009 10:58:00 PM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-025

**Client Sample ID:** E14-B7  
**Collection Date:** 10/21/2009 9:15:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.00	0.100		mg/Kg	1	10/22/2009 11:05:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-026

**Client Sample ID:** E14-B8  
**Collection Date:** 10/21/2009 9:19:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	9.99	0.100		mg/Kg	1	10/22/2009 11:11:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0031

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-027

**Client Sample ID:** E14-B9  
**Collection Date:** 10/21/2009 9:22:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.58	0.100		mg/Kg	1	10/22/2009 11:18:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E14-B10  
**Lab Order:** 0910224      **Collection Date:** 10/21/2009 9:28:00 AM  
**Project:**  
**Lab ID:** 0910224-028      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	5.44	0.100		mg/Kg	1	10/22/2009 11:25:00 PM

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                          J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                          B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                          \* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

Date: 23-Oct-09

---

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E14-B11  
**Lab Order:** 0910224      **Collection Date:** 10/21/2009 9:32:00 AM  
**Project:**  
**Lab ID:** 0910224-029      **Matrix:** SOLID

---

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	23.2	0.100		mg/Kg	1	10/22/2009 11:32:00 PM

---

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                         J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                         B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                         \* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E14-B12

Lab Order: 0910224

Collection Date: 10/21/2009 9:34:00 AM

Project:

Lab ID: 0910224-030

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	107	0.100		mg/Kg	1	10/22/2009 11:52:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0035

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** E14-B13  
**Lab Order:** 0910224      **Collection Date:** 10/21/2009 9:42:00 AM  
**Project:**  
**Lab ID:** 0910224-031      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	129	0.100		mg/Kg	1	10/22/2009 11:58:00 PM

**Qualifiers:**      ND - Not Detected at the Reporting Limit      S - Spike Recovery outside accepted recovery limits  
                         J - Analyte detected below quantitation limits      R - RPD outside accepted recovery limits  
                         B - Analyte detected in the associated Method Blank      E - Value above quantitation range  
                         \* - Value exceeds Maximum Contaminant Level

**Anacon, Inc.**

**Date:** 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-032

**Client Sample ID:** E14-B14  
**Collection Date:** 10/21/2009 9:37:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	118	0.100		mg/Kg	1	10/23/2009 12:05:00 AM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0037

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-033

Client Sample ID: E14-B15  
Collection Date: 10/21/2009 9:26:00 AM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
METALS BY ICP-MS FOR SOLIDS			SW6020			Analyst: HN
Lead	20.9	0.100		mg/Kg	1	10/23/2009 12:12:00 AM

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-034

**Client Sample ID:** E11-B3  
**Collection Date:** 10/21/2009 10:49:00 AM  
**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	19.0	0.100		mg/Kg	1	10/23/2009 12:18:00 AM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	54.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	59.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0039

Anacon, Inc.

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0910224  
Project:  
Lab ID: 0910224-035

Client Sample ID: E11-N1  
Collection Date: 10/21/2009 10:55:00 AM  
Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	30.8	0.100		mg/Kg	1	10/23/2009 12:25:00 AM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	54.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	62.0	50-150		%REC	1	10/22/2009

Qualifiers: ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0040

**Anacon, Inc.**

Date: 23-Oct-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0910224  
**Project:**  
**Lab ID:** 0910224-036

**Client Sample ID:** E11-W2  
**Collection Date:** 10/21/2009 11:09:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	420	0.100		mg/Kg	1	10/23/2009 12:32:00 AM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	56.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	74.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range

0041

**Anacon, Inc.**

Date: 23-Oct-09

CLIENT: Railroad Commission of Texas - Houston

Client Sample ID: E10-N1

Lab Order: 0910224

Collection Date: 10/21/2009 11:40:00 AM

Project:

Lab ID: 0910224-037

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>		<b>SW6020</b>				Analyst: HN
Lead	93.9	0.100		mg/Kg	1	10/23/2009 12:39:00 AM
<b>TPH FOR SOLIDS</b>		<b>TX1005</b>				Analyst: JL
TPH (C6 - C35)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C6 - C12)	ND	50.0		mg/Kg	1	10/22/2009
TPH (C12 - C35)	ND	50.0		mg/Kg	1	10/22/2009
Surr: 1-Chlorooctadecane	79.0	50-150		%REC	1	10/22/2009
Surr: 1-Chlorooctane	62.0	50-150		%REC	1	10/22/2009

**Qualifiers:** ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 B - Analyte detected in the associated Method Blank  
 \* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 E - Value above quantitation range



CLIENT: Railroad Commission of Texas - Houston  
 Work Order: 0910224  
 Project:

ANALYTICAL QC SUMMARY REPORT

TestCode: 6020\_S

3400

Sample ID	Client ID	Batch ID	SampType	MS	TestCode	TestNo	Units	mg/Kg	Prep Date	Analysis	Run ID	SeqNo	ICP-MS #1	091022D	Run ID	SeqNo	ICP-MS #1	091022C	Run ID	SeqNo	ICP-MS #1	091022D	Run ID	SeqNo	ICP-MS #1	091022D
Sample ID: 0910224-021A-MS	E14-B3	R23952	MS	MS	6020_S	SW6020			10/22/2009		ICP-MS #1	295072	091022D		ICP-MS #1	295048	091022C		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D	
AnalYTE			Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual													
Lead			192.4	0.100	20	176.1	81.5	70	130	0	0															
Sample ID: 0910224-001A-MSD	E12-E2	R23951	MSD	MSD	6020_S	SW6020			10/22/2009		ICP-MS #1	295048	091022C		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D	
AnalYTE			Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual													
Lead			23.09	0.100	20	6.746	81.7	70	130	24.97	7.85															
Sample ID: 0910224-021A-MSD	E14-B3	R23952	MSD	MSD	6020_S	SW6020			10/22/2009		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D		ICP-MS #1	295073	091022D	
AnalYTE			Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual													
Lead			199.6	0.100	20	176.1	118	70	130	192.4	3.67															

Qualifiers: NID - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

Anacon, Inc.  
730 FM 1959  
Houston, TX 77034

QA/QC REPORT - LCS

Sample ID: LCS Matrix: Solid  
Anacon Number: 0214, 0224 Units mg/kg

Analyte / Method Number	Blk Value	Spike Conc.	LCS Conc.	% Recovery	Recovery Limits
TPH-GRO - 1005	< 50	500	506	101	60-120
TPH-DRO - 1005	< 50	500	536	107	60-120

LCS Advisory Limits

RPD: 0 out of 2 outside of QC limits

\*Matrix interference  
\*\*Sample too concentrated to spike

QA/QC Manager M Knight





November 11, 2009

Brian Voyles  
Railroad Commission of Texas - Houston  
1706 Seamist Dr., Suite 501  
Houston, TX 77008

TEL: (713) 869-5001

FAX (713) 869-9621

RE:

Order No.: 0911066

Dear Brian Voyles:


Anacon, Inc. received 4 samples on 11/6/2009 for the analyses presented in the following report.

Analyses are performed with method-required QA/QC samples. These data are provided along with the sample results. There were no problems with the analyses unless noted in a Case Narrative. .

If you have any questions regarding these tests results, please feel free to call.

Sincerely,

  
James Lee, Lab Manager

  
Melissa Knight, QA/QC Manager

Total Number of Pages 0000  
(Including Data Package Cover Sheet)

THIS DOCUMENT MEETS NELAC STANDARDS  
NELAC CERTIFICATE # T104704206-08-TX



**Anacon, Inc.**

**Date:** 11-Nov-09

---

**CLIENT:** Railroad Commission of Texas - Houston  
**Project:**  
**Lab Order:** 0911066

**CASE NARRATIVE**

---

Anacon, Inc. received four soil samples to be analyzed for total lead. The samples were received in good condition and within hold times required for analysis. There was a QC problem noted with the MS and MSD, however, the sample spiked was from a different client. All other QC was within the required limits and has been included for review.

Anacon, Inc.

Sample Receipt Checklist

Client Name RRC-HSTN

Date and Time Receive

11/6/2009

Work Order Numbe 0911066

Received by: MK

Checklist completed by CCupe 11/6/09  
Signature Date

Reviewed by mt 11/6/09  
Initials Date

Matrix: Solid

Carrier name: River Oaks Courier

- Shipping container/cooler in good condition? Yes  No  Not Present
- Custody seals intact on shipping container/cooler? Yes  No  Not Present
- Custody seals intact on sample bottles? Yes  No  Not Present
- Chain of custody present? Yes  No
- Chain of custody signed when relinquished and received? Yes  No
- Chain of custody agrees with sample labels? Yes  No
- Samples in proper container/bottle? Yes  No
- Sample containers intact? Yes  No
- Sufficient sample volume for indicated test? Yes  No
- .ll samples received within holding time? Yes  No
- Container/Temp Blank temperature in compliance? Yes  No
- Water - VOA vials have zero headspace? No VOA vials submitted  Yes  No
- Water - pH acceptable upon receipt? Yes  No

60

Adjusted? \_\_\_\_\_ Checked by \_\_\_\_\_

Any No and/or NA (not applicable) response must be detailed in the comments section be

Client contacted \_\_\_\_\_ Date contacted: \_\_\_\_\_ Person contacted \_\_\_\_\_

Contacted by: \_\_\_\_\_ Regarding: \_\_\_\_\_

Comments: \_\_\_\_\_

Corrective Action \_\_\_\_\_

**Anacon, Inc.**

Date: 09-Nov-09

**CLIENT:** Railroad Commission of Texas - Houston  
**Lab Order:** 0911066  
**Project:**  
**Lab ID:** 0911066-001

**Client Sample ID:** e14-b4-A  
**Collection Date:** 11/5/2009 11:36:00 AM

**Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>						Analyst: HN
Lead	6.79	0.100		mg/Kg	1	11/9/2009 11:55:00 AM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 09-Nov-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0911066  
Project:  
Lab ID: 0911066-002

Client Sample ID: pr1-7-A  
Collection Date: 11/5/2009 12:50:00 PM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	7.46	0.100		mg/Kg	1	11/9/2009 12:02:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 09-Nov-09

**CLIENT:** Railroad Commission of Texas - Houston      **Client Sample ID:** pr1-9A  
**Lab Order:** 0911066      **Collection Date:** 11/5/2009 1:44:00 PM  
**Project:**  
**Lab ID:** 0911066-003      **Matrix:** SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	11.9	0.100		mg/Kg	1	11/9/2009 12:08:00 PM

**Qualifiers:** ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

**Anacon, Inc.**

Date: 09-Nov-09

CLIENT: Railroad Commission of Texas - Houston  
Lab Order: 0911066  
Project:  
Lab ID: 0911066-004

Client Sample ID: pr1-1-A  
Collection Date: 11/5/2009 2:19:00 PM

Matrix: SOLID

Analyses	Result	Limit	Qual	Units	DF	Date Analyzed
<b>METALS BY ICP-MS FOR SOLIDS</b>			<b>SW6020</b>			Analyst: HN
Lead	16.1	0.100		mg/Kg	1	11/9/2009 12:15:00 PM

**Qualifiers:**  
ND - Not Detected at the Reporting Limit  
J - Analyte detected below quantitation limits  
B - Analyte detected in the associated Method Blank  
\* - Value exceeds Maximum Contaminant Level

S - Spike Recovery outside accepted recovery limits  
R - RPD outside accepted recovery limits  
E - Value above quantitation range

0007

Anacon, Inc.

Date: 11-Nov-09

### ANALYTICAL QC SUMMARY REPORT

CLIENT: Railroad Commission of Texas - Houston  
Work Order: 0911066  
Project:

TestCode: 6020\_S

Sample ID: BLK110609MMK	SampType: MBLK	TestCode: 6020_S	Units: mg/Kg	Prep Date:	Run ID: ICP-MS #1_091109A						
Client ID: ZZZZZ	Batch ID: R24142	TestNo: SW6020		Analysis: 11/9/2009	SeqNo: 297421						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead	0.2926	0.100									

Sample ID: LCS110609MMK	SampType: LCS	TestCode: 6020_S	Units: mg/Kg	Prep Date:	Run ID: ICP-MS #1_091109A						
Client ID: ZZZZZ	Batch ID: R24142	TestNo: SW6020		Analysis: 11/9/2009	SeqNo: 297422						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead	18.61	0.100	20	0.2926	91.6	75	125	0	0		

Sample ID: 0911059-001A-MS	SampType: MS	TestCode: 6020_S	Units: mg/Kg	Prep Date:	Run ID: ICP-MS #1_091109A						
Client ID: ZZZZZ	Batch ID: R24142	TestNo: SW6020		Analysis: 11/9/2009	SeqNo: 297428						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead	391	0.100	200	116.4	137	70	130	0	0		

Sample ID: 0911059-001A-MSD	SampType: MSD	TestCode: 6020_S	Units: mg/Kg	Prep Date:	Run ID: ICP-MS #1_091109A						
Client ID: ZZZZZ	Batch ID: R24142	TestNo: SW6020		Analysis: 11/9/2009	SeqNo: 297429						
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	RPD Ref Val	%RPD	RPDLimit	Qual
Lead	411.8	0.100	200	116.4	148	70	130	391	5.18	25	S

Qualifiers: ND - Not Detected at the Reporting Limit  
 J - Analyte detected below quantitation limits  
 S - Spike Recovery outside accepted recovery limits  
 R - RPD outside accepted recovery limits  
 B - Analyte detected in the associated Method

**APPENDIX C**

**WASTE MANIFESTS (UNDER SEPARATE COVER)**



A Full **Service**  
Environmental Company

# TRANSMITTAL

Date: **Thursday, December 10, 2009** From: **Siobhan LeRoy**  
To: **Terracon** Job Name: **Railroad Commission of Texas**

**Arun Neupane**

USA Reference: **2159-NR-H033**  
Direct Line: **(713) 425-6901**

Copies	Dated	Description of Transmitted Documents
1		Manifest Copies

**NOTES: Hi Arun, Here are the copies you requested of the manifests for the Railroad Commission project. (Cactus Pipe and Supply. If you have any questions, you can reach me at - (713) 425-6901.**

Thank you very much \_\_\_\_\_ Siobhan LeRoy

---

# **NORM SOIL - US ECOLOGY IDAHO**

---

09092115296 TRK# 402 + LINEN 33420 # 27915

NON-HAZARDOUS WASTE MANIFEST 1. Generator ID Number CESQG 2. Page 1 of 1 3. Emergency Response Phone 866-780-3116 4. Waste Tracking Number 0060

5. Generator's Name and Mailing Address: Cactus Pipe and Supply (122185) c/o USA Environment, P.O. Box 87087, Houston, TX 77287. Generator's Site Address: N.E. Corner of Dorsett and Market St. Houston, TX 77029. Generator's Phone: 713-425-6901

6. Transporter 1 Company Name: U.S. Bulk Transport, Inc. U.S. EPA ID Number: PAD987347515

7. Transporter 2 Company Name: U.S. EPA ID Number:

8. Designated Facility Name and Site Address: US ECOLOGY IDAHO, INC., 20400 LEMLEY ROAD, GRANDVIEW, ID 83624. Facility's Phone: 800-274-1516. U.S. EPA ID Number: IDD073114854

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit Wt./Vol.
	No.	Type		
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	27	Y
2.				
3.				
4.				

13. Special Handling Instructions and Additional Information: WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact. Bond 77 Rules # NATSP1, NATSP2, NATSP7

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste. Generator's Name: Bill Bolling, Signature: Bill Bolling, Date: 09/18/09

15. International Shipments:  Import to U.S.  Export from U.S. Port of entry/exit: Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials. Transporter 1 Name: Jeffrey R. Marsh, Signature: Jeffrey R. Marsh, Date: 09/18/09. Transporter 2 Name: Signature: Date:

17. Discrepancy. 17a. Discrepancy Indication Space:  Quantity  Type  Residue  Partial Rejection  Full Rejection. Manifest Reference Number: U.S. EPA ID Number:

17b. Alternate Facility (or Generator): U.S. EPA ID Number: Facility's Phone:

17c. Signature of Alternate Facility (or Generator): Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a. Printed/Typed Name: Signature: Date: 9/21/09

169-BLC-0 5 11977 (Rev. 8/06) DESIGNATED FACILITY TO GENERATOR

# CERTIFICATE OF DISPOSAL

**September 24,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0060/ was received by U.S. Ecology, Inc., on 09/21/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/21/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092115296-0060-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

P.O. 2189-NR-H033  
09092115331

TRK # 1086-1  
45100\* 28 yds

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number

2. Page 1 of 1

3. Emergency Response Phone

4. Waste Tracking Number

CE300

800-780-3116

0061

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o USA Environment  
P.O. BOX 87087  
Houston, TX 77287

N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-425-6901

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114654

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

10. Containers

No.

Type

11. Total Quantity

12. Unit Wt./Vol.

1. Non Hazardous, Non Regulated Soil containing NORM

1

DT

28

Y

13. Special Handling Instructions and Additional Information

WSID # 22724

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contract.

MASSP2

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

3 10 10  
P.O. # NA4SP1, MA4SP2, MA5SP1

Generator's/Officer's Printed/Typed Name

BILL BORING Agent

Signature

Bill Boring

Month Day Year

09 18 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

Transporter Signature (for exports only):

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Richard Wallace

Signature

R. Wallace

Month Day Year

09 18 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator. Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name

Signature

Dorothy McCauley

Dorothy McCauley

Month Day Year

09 18 05

# CERTIFICATE OF DISPOSAL

September 24,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0061/  
was received by U.S. Ecology, Inc., on 09/21/2009. The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/21/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092115331-0061-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

091092115329 TRK# 1086 25675 4/6/09

NON-HAZARDOUS WASTE MANIFEST 1. Generator ID Number CESQG 2. Page 1 of 1 3. Emergency Response Phone 866-780-3116 4. Waste Tracking Number 0062

5. Generator's Name and Mailing Address: Cactus Pipe and Supply (122185) c/o USA ENVIRONMENT, Houston, TX 77287. Generator's Site Address: N.E. Corner of Dorsett and Market St. Houston, TX 77029. Generator's Phone: 713-425-6901

6. Transporter 1 Company Name: U.S. Bulk Transport, Inc. U.S. EPA ID Number: PAD987347515

7. Transporter 2 Company Name: U.S. EPA ID Number:

8. Designated Facility Name and Site Address: US ECOLOGY IDAHO, INC., 20400 LEMLEY ROAD, GRANDVIEW, ID 83624. Facility's Phone: 800-274-1516. U.S. EPA ID Number: IDD073114654

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit WL/Vol.
	No.	Type		
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	25	Y
2.				
3.				
4.				

13. Special Handling Instructions and Additional Information: WSID# 2272V Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contract. Rail # 57 Piles # NAGSP2, NAGSP1, NAGSP2

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste. Generator's/Officer's Printed/Typed Name: Bill Boring Agent Signature: Bill Boring Month: 09 Day: 18 Year: 09

15. International Shipments:  Import to U.S.  Export from U.S. Port of entry/exit: Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials: Transporter 1 Printed/Typed Name: NES DESJETER Signature: [Signature] Month: 09 Day: 18 Year: 09

17. Discrepancy: 17a. Discrepancy Indication Space:  Quantity  Type  Residue  Partial Rejection  Full Rejection. Manifest Reference Number:

17b. Alternate Facility (or Generator): U.S. EPA ID Number: Facility's Phone:

17c. Signature of Alternate Facility (or Generator): Month: Day: Year:

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a. Printed/Typed Name: Brenda Johnson for user Signature: Brenda Johnson Month: 09 Day: 12 Year: 09

# CERTIFICATE OF DISPOSAL

**September 24,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0062/ was received by U.S. Ecology, Inc., on 09/21/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/21/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092115329-0062-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:**



**Title:** RECEIVING SUPERVISOR

P.O. 2159-NR-11033

09092115330

39900

Trk# 1086-2  
25-45

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number

CESQG

2. Page 1 of

1

3. Emergency Response Phone

866-780-3116

4. Waste Tracking Number

0063

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o  
P.O. Box 57887  
Houston, TX 77287

USA Environment

Generator's Site Address (if different than mailing address)

N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-425-8901

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114654

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

1. Non Hazardous, Non Regulated Soil containing NORM

10. Containers

No.

Type

1

DT

11. Total Quantity

25

12. Unit

WL/Vol.

Y

13. Special Handling Instructions and Additional Information

WSID #

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

West NA2SP1 5

Box # 57

Peter # NA6SP3, NA6SP4

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's/Officer's Printed/Typed Name

Bill Borling

Signature

WB

Month Day Year

09 18 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Timothy E. Woodard

Signature

Timothy E. Woodard

Month Day Year

09 18 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Sec 13 WSD should be 2724 for clarification per Vmm 9-21-09  
Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a

Printed/Typed Name

Janet McCarty

Signature

Janet McCarty

Month Day Year

9 21 09

# CERTIFICATE OF DISPOSAL

September 24, 2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0063/  
was received by U.S. Ecology, Inc., on 09/21/2009. The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/21/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092115330-0063-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

P.O.# 2159-NR-H033

09092115348

TRUCK# 150 25 yds  
39500 #

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0064</b>	
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA ENVIRONMENT P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>			
Generator's Phone: <b>713-425-6901</b>						
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>			
7. Transporter 2 Company Name			U.S. EPA ID Number			
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>			
Facility's Phone: <b>800-274-1516</b>						
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.	
		No.	Type			
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>25</b>	<b>Y</b>	
2.						
3.						
4.						
13. Special Handling Instructions and Additional Information <b>WSID# 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contract.</b>						
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.						
Generator's/Officer's Printed/Typed Name <b>Bill Bonny Agent</b>		Signature <i>Bill Bonny</i>		Month Day Year <b>09   18   09</b>		
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____						
16. Transporter Acknowledgment of Receipt of Materials						
Transporter 1 Printed/Typed Name <b>Chip Reynolds</b>		Signature <i>Chip Reynolds</i>		Month Day Year <b>09   18   09</b>		
Transporter 2 Printed/Typed Name		Signature		Month Day Year		
17. Discrepancy						
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection						
Manifest Reference Number:						
17b. Alternate Facility (or Generator)				U.S. EPA ID Number		
Facility's Phone:						
17c. Signature of Alternate Facility (or Generator)						Month Day Year
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a						
Printed/Typed Name <b>Brenda Johnson for user</b>		Signature <i>Brenda Johnson</i>		Month Day Year <b>09   12   09</b>		

GENERATOR

INT'L

TRANSPORTER

DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

**September 24,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0064/ was received by U.S. Ecology, Inc., on 09/21/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/21/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092115348-0064-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092415378

TRKA 1012 47220 #  
25 yds.

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number

CESQG

2. Page 1 of

1

3. Emergency Response Phone

866-780-3116

4. Waste Tracking Number

0065

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287

USA Environment

Generator's Site Address (if different than mailing address)

N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-425-6901

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114854

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

1. Non Hazardous, Non Regulated Soil containing NORM

10. Containers

No.

Type

1

DT

11. Total Quantity

25

12. Unit WL/Vol.

Y

13. Special Handling Instructions and Additional Information

WSID # 2274

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

Burch 57

Peter H. NARSPL, NARSPL, NARSPL

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's/Officer's Printed/Typed Name

Bill Borow Agent

Signature

Bill Borow

Month Day Year  
09 18 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

Transporter Signature (for exports only):

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Brendell Keller

Signature

Brendell Keller

Month Day Year

09 21 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

U.S. EPA ID Number

17b. Alternate Facility (or Generator)

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator. Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name

Brenda Johnson for user

Signature

Brenda Johnson

Month Day Year

09 24 09

# CERTIFICATE OF DISPOSAL

**September 28,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0065/  
was received by U.S. Ecology, Inc., on 09/24/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092415568-0065-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092415560

TRKH 1068 25 units 44040

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number

CESQG

2. Page 1 of

1

3. Emergency Response Phone

866-780-3116

4. Waste Tracking Number

0066

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287

Generator's Site Address (if different than mailing address)

N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-426-6901

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114854

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

1. Non Hazardous, Non Regulated Soil containing NORM

10. Containers

No.

Type

11. Total Quantity

12. Unit WL/Vol.

1

DT

25

Y

13. Special Handling Instructions and Additional Information

WSID.# 22724

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

Box # 57

Piles # NA25P6, NA25P7, NA25P8

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator/Officer's Printed/Typed Name

Bill Borking Agent

Signature

Bill Borking

Month Day Year

09 18 09

INT'L

15. International Shipments  Import to U.S.  Export from U.S.

Port of entry/exit:

Date leaving U.S.:

Transporter Signature (for exports only):

TRANSPORTER

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

GARY MILLER

Signature

Gary Miller

Month Day Year

09 21 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

DESIGNATED FACILITY

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a

Printed/Typed Name

Jane McCarty

Signature

Jane McCarty

Month Day Year

09 24 09

# CERTIFICATE OF DISPOSAL

**September 28,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0066/ was received by U.S. Ecology, Inc., on 09/24/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092415560-0066-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092415353 25561K# 136 42920#

**NON-HAZARDOUS WASTE MANIFEST**

1. Generator ID Number  
**CESQG**

2. Page 1 of  
**1**

3. Emergency Response Phone  
**866-780-3116**

4. Waste Tracking Number  
**0067**

5. Generator's Name and Mailing Address  
**Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287**

Generator's Site Address (if different than mailing address)  
**N.E. Corner of Dorsett and Market St.  
Houston, TX 77029**

Generator's Phone: **713-425-6901**

6. Transporter 1 Company Name  
**U.S. Bulk Transport, Inc.**

U.S. EPA ID Number  
**PAD987347515**

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address  
**US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624**

U.S. EPA ID Number  
**IDD073114654**

Facility's Phone: **800-274-1516**

9. Waste Shipping Name and Description

10. Containers

No.

Type

11. Total Quantity

12. Unit Wt./Vol.

1. **Non Hazardous, Non Regulated Soil containing NORM**

**1**

**DT**

**25**

**Y**

2.

3.

4.

13. Special Handling Instructions and Additional Information

**WSID# 22724**

**Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.**

**Box # 42**

**Pile# NA2SP9, NA2SP10, NA7SP1**

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's/Officer's Printed/Typed Name

**BILL BORING**

Signature

*[Signature]*

Month Day Year  
**09 21 09**

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

Transporter Signature (for exports only):

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

**Larry Hood**

Signature

*[Signature]*

Month Day Year  
**9 21 09**

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name

Signature

**James J. Coakley Jones**

*[Signature]*

Month Day Year  
**9 21 09**

# CERTIFICATE OF DISPOSAL

**September 28,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 00671 was received by U.S. Ecology, Inc., on 09/24/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092415553-0067-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

29092415527 TRK# 160 4478# 204rd'

**NON-HAZARDOUS WASTE MANIFEST**

1. Generator ID Number  
CESQG

2. Page 1 of  
1

3. Emergency Response Phone  
866-780-3116

4. Waste Tracking Number  
0068

5. Generator's Name and Mailing Address  
Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287

Generator's Site Address (if different than mailing address)  
N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-425-6901

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address  
US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114654

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

10. Containers

No.

Type

11. Total Quantity

12. Unit Wt./Vol.

1. Non Hazardous, Non Regulated Soil containing NORM

1

DT

20

Y

11-16

13. Special Handling Instructions and Additional Information

WSID # 22724

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

Box # 42

5 10 10  
Pile # NATSP1, NATSP2, NATSP3

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's Name Printed/Typed Name

Signature

BULL BORING

UBuy

Month Day Year  
09 28 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

Transporter Signature (for exports only):

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Signature

Month Day Year  
09 21 09

K Charney Bower

Charney Bower

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a

Printed/Typed Name

Signature

Month Day Year

Shirley Quibach BRUSEZ

Shirley Quibach

09 24 09

# CERTIFICATE OF DISPOSAL

September 28,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0068/  
was received by U.S. Ecology, Inc., on 09/24/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092415527-0068-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:**

*Donna Pullen*

**Title:** RECEIVING SUPERVISOR

09092415518 TRK # 538 471100\* 204rds

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0069</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o P.O. Box 87887 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
Generator's Phone: <b>713-425-6901</b>					
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>				U.S. EPA ID Number <b>PAD987347515</b>	
7. Transporter 2 Company Name				U.S. EPA ID Number	
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83824</b>				U.S. EPA ID Number <b>IDD073114654</b>	
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit WL/Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>20</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724</b> Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  <b>Bole # 42</b> <b>10</b> <b>10</b> <b>Pelen # NATSP4, NATSP5</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name <b>BILL BORING</b>		Signature <i>WBS</i>		Month <b>09</b>	Day <b>21</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S.		Port of entry/exit:		Year <b>09</b>	
Transporter Signature (for exports only):		Date leaving U.S.:			
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>Stephen Staszewski</b>		Signature <i>Stephen Staszewski</i>		Month <b>9</b>	Day <b>21</b>
Transporter 2 Printed/Typed Name		Signature		Year <b>09</b>	
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
17b. Alternate Facility (or Generator)				Manifest Reference Number:	
Facility's Phone:				U.S. EPA ID Number	
17c. Signature of Alternate Facility (or Generator)				Month	Day
				Year	
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Corian Kastner for UST</b>		Signature <i>Corian Kastner</i>		Month <b>9</b>	Day <b>24</b>
				Year <b>09</b>	

# CERTIFICATE OF DISPOSAL

**September 28,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0069/ was received by U.S. Ecology, Inc., on 09/24/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092415518-0069-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:**

*Donna Pullen*

**Title:** RECEIVING SUPERVISOR

09092415537 TRK#106 424600# 20 yard

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0010</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA Environment P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
Generator's Phone: <b>713-425-6901</b>					
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit WL/Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>20</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724</b> <b>Transporter Phone Number 800-847-4594</b> <b>Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by state contract.</b>					
<b>Bole # 42</b> <b>Permit # NA7SP6, NA7SP7</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name <b>Bill Barry</b>			Signature <b>[Signature]</b>		Month Day Year <b>09/27/09</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>Robert Dixon</b>			Signature <b>[Signature]</b>		Month Day Year <b>9/21/9</b>
Transporter 2 Printed/Typed Name			Signature		Month Day Year
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
17b. Alternate Facility (or Generator) Manifest Reference Number: _____ U.S. EPA ID Number _____					
Facility's Phone: _____					
17c. Signature of Alternate Facility (or Generator) _____ Month Day Year _____					
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Sheila Deborah Frustez</b>			Signature <b>[Signature]</b>		Month Day Year <b>9/24/09</b>

# CERTIFICATE OF DISPOSAL

September 28, 2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0070/ was received by U.S. Ecology, Inc., on 09/24/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/24/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092415537-0070-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092575244 TRK# 1074 20 yrels 44240 #

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0071</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA Environment P.O. Box 87087 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dersett and Market St. Houston, TX 77029</b>		
Generator's Phone: <b>713-425-6901</b>					
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>20</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste. <b>Bill Borning</b> Signature <b>Bill Borning</b> Month <b>09</b> Day <b>23</b> Year <b>09</b>					
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____					
16. Transporter Acknowledgment of Receipt of Materials Transporter 1 Printed/Typed Name: <b>Tim Jewness</b> Signature _____ Month <b>9</b> Day <b>23</b> Year <b>09</b> Transporter 2 Printed/Typed Name _____ Signature _____ Month _____ Day _____ Year _____					
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
17b. Alternate Facility (or Generator) Manifest Reference Number: _____ U.S. EPA ID Number _____					
Facility's Phone: _____					
17c. Signature of Alternate Facility (or Generator) _____ Month _____ Day _____ Year _____					
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a <b>Brenda Johnson for USEE</b> Signature <b>Brenda Johnson</b> Month <b>9</b> Day <b>25</b> Year <b>09</b>					

GENERATOR  
INTL  
TRANSPORTER  
DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0071/ was received by U.S. Ecology, Inc., on 09/25/2009 . The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/25/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092515644-0071-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

09092515646

Truck # 1084

20 yds.  
42760#

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0072</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA Environment P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		No.	Type		
		1	DT	20	Y
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 2224 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contract.</b>					
<b>Box # 53</b> <b>Pile # NA 75P10</b> <b>NA 8SP1</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Owner's Printed/Typed Name <b>BILL BURNING</b>		Signature <i>[Signature]</i>		Month <b>09</b>	Day <b>23</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S.		Port of entry/exit:		Year <b>09</b>	
Transporter Signature (for exports only):		Date leaving U.S.:			
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>CLINT HODGE</b>		Signature <i>[Signature]</i>		Month <b>09</b>	Day <b>23</b>
Transporter 2 Printed/Typed Name		Signature		Year <b>09</b>	
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
Manifest Reference Number:					
17b. Alternate Facility (or Generator)			U.S. EPA ID Number		
Facility's Phone:					
17c. Signature of Alternate Facility (or Generator)			Month Day Year		
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Brenda Johnson for user</b>		Signature <i>[Signature]</i>		Month <b>09</b>	Day <b>25</b>
				Year <b>09</b>	

# CERTIFICATE OF DISPOSAL

**September 30,2009**

**CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029**

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0072/ was received by U.S. Ecology, Inc., on 09/25/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/25/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092515646-0072-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092515645

Track # 1040 44780#  
20y15

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>888-780-3116</b>	4. Waste Tracking Number <b>0073</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA Environment P.O. Box 87887 Houston, TX 77287 Generator's Phone: 713-425-6901</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>				U.S. EPA ID Number <b>PAD987347515</b>	
7. Transporter 2 Company Name				U.S. EPA ID Number	
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624 Facility's Phone: 800-274-1516</b>				U.S. EPA ID Number <b>IDD073114854</b>	
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		1	DT	20	Y
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contract.</b>  <b>Row # 53</b> <b>Roller # NA8SP2</b> <b>NA8SP3</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's Printed/Typed Name <b>Bill Borling</b>			Signature <i>[Signature]</i>		Month Day Year <b>09 23 09</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S.      Port of entry/exit: _____ Transporter Signature (for exports only): _____      Date leaving U.S.: _____					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>Loch Ponoho</b>			Signature <i>[Signature]</i>		Month Day Year <b>9 23 9</b>
Transporter 2 Printed/Typed Name			Signature		Month Day Year
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
17b. Alternate Facility (or Generator)				Manifest Reference Number: _____ U.S. EPA ID Number	
Facility's Phone: _____					
17c. Signature of Alternate Facility (or Generator)				Month Day Year	
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a					
Printed/Typed Name <b>Jarvis McCauley</b>			Signature <i>[Signature]</i>		Month Day Year <b>9 23 09</b>

GENERATOR  
INT'L  
TRANSPORTER  
DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0073/  
was received by U.S. Ecology, Inc., on 09/25/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/25/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092515645-0073-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** 

**Title:** RECEIVING SUPERVISOR

09092515655 Trench 25 Yrds. 42760

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0074</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o USA Environment P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>25</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID #</b> Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  <b>Box # 53</b> <b>Rel # NA9SP2 NA8SP4 NA9SP1</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name <b>Bill Borina</b>		Signature <b>MB</b>		Month <b>09</b>	Day <b>23</b>
Year <b>09</b>		15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____			
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>X J DeWe for Bulk</b>		Signature <b>Mario DeWe for Bulk</b>		Month <b>09</b>	Day <b>23</b>
Year <b>09</b>		Transporter 2 Printed/Typed Name Signature Month Day Year			
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
<b>WSID # 22724 for clarification only per Schedule 9/25/09-D.J</b> Manifest Reference Number:					
17b. Alternate Facility (or Generator)			U.S. EPA ID Number		
Facility's Phone:					
17c. Signature of Alternate Facility (or Generator)			Month Day Year		
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Brenda Johnson for user</b>		Signature <b>Brenda Johnson</b>		Month <b>09</b>	Day <b>25</b>
Year <b>09</b>					

GENERATOR  
INT'L  
TRANSPORTER  
DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0074/ was received by U.S. Ecology, Inc., on 09/25/2009 .The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/25/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092515655-0074-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092815e70

3391

42220#

25 yr

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number

GESQG

2. Page 1 of 1

3. Emergency Response Phone

866-780-3116

4. Waste Tracking Number

0075

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287

USA Environment

Generator's Site Address (if different than mailing address)

N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

6. Transporter 1 Company Name  
U.S. Bulk Transport, Inc.  
713-425-6901

U.S. EPA ID Number

PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624

U.S. EPA ID Number

IDD073114654

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

10. Containers

No. Type

11. Total Quantity

12. Unit WL/Vol.

1. Non Hazardous, Non Regulated Soil containing NORM

1

DT

25

Y

13. Special Handling Instructions and Additional Information

WSID # Commission, as required by a state contact.

Signed in the course and scope of the contractual performance or service on behalf of the Railroad

5 10 10  
NA9SP2 NA9SP3 NA9SP4

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's/Officer's Printed/Typed Name

B. B. B. B. B.

Signature

[Signature]

Month Day Year  
09 23 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit:

Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Scott Baker

Signature

[Signature]

Month Day Year  
09 23 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

WSID 22724 Per Marie McMonigle JM 9/28/09

Manifest Reference Number:

U.S. EPA ID Number

17b. Alternate Facility (or Generator)

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a

Printed/Typed Name

Brenda Johnson for user

Signature

Brenda Johnson

Month Day Year  
09 28 09

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0075/ was received by U.S. Ecology, Inc., on 09/28/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/28/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092815670-0075-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

TRK # 1286  
40300

09092815643

25465

NON-HAZARDOUS WASTE MANIFEST 1. Generator ID Number CESQG 2. Page 1 of 1 3. Emergency Response Phone 866-780-3116 4. Waste Tracking Number 0076

5. Generator's Name and Mailing Address: Cactus Pipe and Supply (122185) c/o USA Environment, Houston, TX 77287. Generator's Site Address: N.E. Corner of Dorsett and Market St. Houston, TX 77029. Generator's Phone: 713-425-6901

6. Transporter 1 Company Name: U.S. Bulk Transport, Inc. U.S. EPA ID Number: PAD987347515

7. Transporter 2 Company Name: U.S. EPA ID Number:

8. Designated Facility Name and Site Address: US ECOLOGY IDAHO, INC., 20400 LEMLEY ROAD, GRANDVIEW, ID 83624. Facility's Phone: 800-274-1616. U.S. EPA ID Number: IDD073114654

Table with 5 columns: 9. Waste Shipping Name and Description, 10. Containers (No., Type), 11. Total Quantity, 12. Unit Wt./Vol., and an empty column. Row 1: Non Hazardous, Non Regulated Soil containing NORM, 1 container, Type DT, Total Quantity 25, Unit Y.

13. Special Handling Instructions and Additional Information: WSID # 22724. Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact. Includes handwritten codes: 10 NA9SP5, 10 NA9SP6, 5 NA9SP8.

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste. Generator's/Officer's Printed/Typed Name: Bill Bong, Signature: Bill Bong, Date: 9/23/09.

15. International Shipments: [ ] Import to U.S., [ ] Export from U.S. Port of entry/exit: Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials. Transporter 1 Printed/Typed Name: WES BERTER, Signature: [Signature], Date: 09/23/09. Transporter 2 Printed/Typed Name: [Blank], Signature: [Blank], Date: [Blank].

17. Discrepancy: 17a. Discrepancy Indication Space: [ ] Quantity, [ ] Type, [ ] Residue, [ ] Partial Rejection, [ ] Full Rejection. Manifest Reference Number: U.S. EPA ID Number:

17b. Alternate Facility (or Generator): Facility's Phone: U.S. EPA ID Number:

17c. Signature of Alternate Facility (or Generator): Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a. Printed/Typed Name: Brenda Johnson for user, Signature: Brenda Johnson, Date: 9/28/09.

GENERATOR  
INT'L  
TRANSPORTER  
DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0076/  
was received by U.S. Ecology, Inc., on 09/28/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/28/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092815663-0076-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09092815264 37260 # 20 yards

**NON-HAZARDOUS WASTE MANIFEST**

1. Generator ID Number: **CESQG**  
 2. Page 1 of: **1**  
 3. Emergency Response Phone: **866-780-3116**  
 4. Waste Tracking Number: **0079**

5. Generator's Name and Mailing Address: **Cactus Pipe and Supply (122185) c/o USA Environment**  
 P.O. Box 87687  
 Houston, TX 77287  
 Generator's Phone: **713-425-6901**  
 Generator's Site Address (if different than mailing address): **N.E. Corner of Dorsett and Market St. Houston, TX 77029**

6. Transporter 1 Company Name: **U.S. Bulk Transport, Inc.**  
 U.S. EPA ID Number: **PAD987347515**

7. Transporter 2 Company Name: \_\_\_\_\_  
 U.S. EPA ID Number: \_\_\_\_\_

8. Designated Facility Name and Site Address: **US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624**  
 Facility's Phone: **800-274-1516**  
 U.S. EPA ID Number: **IDD073114654**

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit Wt./Vol.
	No.	Type		
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	20	Y
2.				
3.				
4.				

13. Special Handling Instructions and Additional Information: **WSID # 22724** Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  
*Palmer NA3SP1 NA3SP2*

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.  
 Generator's Printed/Typed Name: **Bill Bonny** Signature: *WB* Month: **09** Day: **23** Year: **09**

15. International Shipments:  Import to U.S.  Export from U.S. Port of entry/exit: \_\_\_\_\_ Date leaving U.S.: \_\_\_\_\_

16. Transporter Acknowledgment of Receipt of Materials  
 Transporter 1 Printed/Typed Name: **Richard Wallace** Signature: *R. Wallace* Month: **09** Day: **23** Year: **09**  
 Transporter 2 Printed/Typed Name: \_\_\_\_\_ Signature: \_\_\_\_\_ Month: \_\_\_\_\_ Day: \_\_\_\_\_ Year: \_\_\_\_\_

17. Discrepancy  
 17a. Discrepancy Indication Space:  Quantity  Type  Residue  Partial Rejection  Full Rejection  
 Manifest Reference Number: \_\_\_\_\_

17b. Alternate Facility (or Generator): \_\_\_\_\_ U.S. EPA ID Number: \_\_\_\_\_  
 Facility's Phone: \_\_\_\_\_

17c. Signature of Alternate Facility (or Generator): \_\_\_\_\_ Month: \_\_\_\_\_ Day: \_\_\_\_\_ Year: \_\_\_\_\_

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a  
 Printed/Typed Name: **Sheila Auburn for USEZ** Signature: *Sheila Auburn* Month: **09** Day: **28** Year: **09**

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0079/ was received by U.S. Ecology, Inc., on 09/28/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/28/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09092815664-0079-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

Truck # 303-1  
 31880# 20 yards  
 09092815107

**NON-HAZARDOUS WASTE MANIFEST**

1. Generator ID Number

CESQG

2. Page 1 of

1

3. Emergency Response Phone

866-780-3116

4. Waste Tracking Number

0080

5. Generator's Name and Mailing Address

Cactus Pipe and Supply (122185) c/o  
 P.O. Box 87687  
 Houston, TX 77287

USA Environment

Generator's Site Address (if different than mailing address)

N.E. Corner of Dorsett and Market St.  
 Houston, TX 77029

Generator's Phone:

713-425-6901

U.S. EPA ID Number

PAD987347515

6. Transporter 1 Company Name

U.S. Bulk Transport, Inc.

U.S. EPA ID Number

7. Transporter 2 Company Name

U.S. EPA ID Number

IDD073114654

8. Designated Facility Name and Site Address

US ECOLOGY IDAHO, INC.  
 20400 LEMLEY ROAD  
 GRANDVIEW, ID 83624

Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description

1. Non Hazardous, Non Regulated Soil containing NORM

10. Containers

No.

Type

11. Total Quantity

20

12. Unit

Y

13. Special Handling Instructions and Additional Information

WSID # 22724

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.

10  
 Peter NA3SP3

10  
 NA3SP4

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.

Generator's/Officer's Printed/Typed Name

Bill Borning

Signature

WBJ

Month Day Year

9 24 09

15. International Shipments

Import to U.S.

Export from U.S.

Port of entry/exit

Transporter Signature (for exports only):

Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name

Allen Stubblefield

Signature

AS

Month Day Year

9 24 09

Transporter 2 Printed/Typed Name

Signature

Month Day Year

17. Discrepancy

17a. Discrepancy Indication Space

Quantity

Type

Residue

Partial Rejection

Full Rejection

Manifest Reference Number:

17b. Alternate Facility (or Generator)

U.S. EPA ID Number

Facility's Phone:

17c. Signature of Alternate Facility (or Generator)

Month Day Year

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name

Shelia Dubach for USEZ

Signature

Shelia Dubach

Month Day Year

9 28 09

# CERTIFICATE OF DISPOSAL

**September 30,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0080/  
was received by U.S. Ecology, Inc., on 09/28/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/28/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09092815667-0080-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:**



**Title:** RECEIVING SUPERVISOR

09093015816

Truck 303 25yds. 34040#

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number CESQG  
2. Page 1 of 1  
3. Emergency Response Phone 866-780-3116  
4. Waste Tracking Number 0082

5. Generator's Name and Mailing Address: Cactus Pipe and Supply (122185) c/o USA Environment, Houston, TX 77287  
Generator's Site Address (if different than mailing address): N.E. Corner of Dorsett and Market St. Houston, TX 77029

6. Transporter 1 Company Name: BAYOU CITY ENV. SERVICES U5BWLK  
U.S. EPA ID Number: PAD987347515 TXR000032045

7. Transporter 2 Company Name: \_\_\_\_\_  
U.S. EPA ID Number: \_\_\_\_\_

8. Designated Facility Name and Site Address: US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624  
Facility's Phone: 800-274-1516  
U.S. EPA ID Number: IDD073114654

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit WL/Vol.	
	No.	Type			
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	25	Y	
2.					
3.					
4.					

13. Special Handling Instructions and Additional Information  
WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  
Pile A NA9SP8 5 NA9SP9 10 NA9SP30 10

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.  
Generator's/Officer's Printed/Typed Name: B. Boonin Agency Signature: \_\_\_\_\_ Month: 09 Day: 29 Year: 09

15. International Shipments  Import to U.S.  Export from U.S. Port of entry/exit: \_\_\_\_\_ Date leaving U.S.: \_\_\_\_\_

16. Transporter Acknowledgment of Receipt of Materials  
Transporter 1 Printed/Typed Name: Travis Baker Signature: \_\_\_\_\_ Month: 9 Day: 28 Year: 09  
Transporter 2 Printed/Typed Name: \_\_\_\_\_ Signature: \_\_\_\_\_ Month: \_\_\_\_\_ Day: \_\_\_\_\_ Year: \_\_\_\_\_

17. Discrepancy  
17a. Discrepancy Indication Space  Quantity  Type  Residue  Partial Rejection  Full Rejection  
Manifest Reference Number: \_\_\_\_\_

17b. Alternate Facility (or Generator) \_\_\_\_\_ U.S. EPA ID Number: \_\_\_\_\_  
Facility's Phone: \_\_\_\_\_

17c. Signature of Alternate Facility (or Generator) \_\_\_\_\_ Month: \_\_\_\_\_ Day: \_\_\_\_\_ Year: \_\_\_\_\_

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in item 17a  
Printed/Typed Name: Brenda Johnson for user Signature: Brenda Johnson Month: 9 Day: 30 Year: 09

# CERTIFICATE OF DISPOSAL

October 01,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0082/  
was received by U.S. Ecology, Inc., on 09/30/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/30/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09093015816-0082-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

09100215909 1010 42580 25yards

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0083</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit WL/Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>25</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724</b> Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.					
<p>10 10 5</p> <p>NA9SP32 NA9SP33 NA9SP34</p>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name <b>B Bonny</b>			Signature <b>WB</b>		Month Day Year <b>09 28 09</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>Kelly Johnson</b>			Signature <b>Kelly Johnson</b>		Month Day Year <b>09 28 09</b>
Transporter 2 Printed/Typed Name			Signature		Month Day Year
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
Manifest Reference Number: _____					
17b. Alternate Facility (or Generator)			U.S. EPA ID Number		
Facility's Phone: _____					
17c. Signature of Alternate Facility (or Generator)					Month Day Year
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Shelley Dubach for USEZ</b>			Signature <b>Shelley Dubach</b>		Month Day Year <b>10 2 09</b>

GENERATOR

TRANSPORTER INT'L

DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

October 05,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0083/  
was received by U.S. Ecology, Inc., on 10/02/2009. The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 10/02/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09100215909-0083-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09093015817 1086-2 39880# 25yds.

NON-HAZARDOUS WASTE MANIFEST		1. Generator ID Number CESQG	2. Page 1 of 1	3. Emergency Response Phone 866-780-3116	4. Waste Tracking Number 0084
5. Generator's Name and Mailing Address Cactus Pipe and Supply (122185) c/o P.O. Box 87687 Houston, TX 77287 Generator's Phone: 713-425-6901			Generator's Site Address (if different than mailing address) N.E. Corner of Dorsett and Market St. Houston, TX 77029		
6. Transporter 1 Company Name U.S. Bulk Transport, Inc.				U.S. EPA ID Number PAD987347515	
7. Transporter 2 Company Name				U.S. EPA ID Number	
8. Designated Facility Name and Site Address US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624 Facility's Phone: 800-274-1516				U.S. EPA ID Number IDD073114854	
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1. Non Hazardous, Non Regulated Soil containing NORM		1	DT	25	Y
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  5 NA9SP34 NR9SP3# NA9SP11					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name B. Borling Agent				Signature Bee By	
				Month	Day
				09	28
				Year	09
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name L. Timothy E Woodard				Signature L. Timothy E Woodard	
				Month	Day
				09	28
				Year	09
Transporter 2 Printed/Typed Name				Signature	
17. Discrepancy					
17a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection					
Manifest Reference Number:					
17b. Alternate Facility (or Generator)				U.S. EPA ID Number	
Facility's Phone:					
17c. Signature of Alternate Facility (or Generator)				Month	
				Day	Year
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name Brenda Johnson for user				Signature Brenda Johnson	
				Month	Day
				09	30
				Year	09

# CERTIFICATE OF DISPOSAL

October 01,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0084/ was received by U.S. Ecology, Inc., on 09/30/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/30/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09093015817-0084-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

09100115888 1612 28840# 10 yrcds

<b>NON-HAZARDOUS WASTE MANIFEST</b>		1. Generator ID Number <b>CESQG</b>	2. Page 1 of <b>1</b>	3. Emergency Response Phone <b>866-780-3116</b>	4. Waste Tracking Number <b>0085</b>
5. Generator's Name and Mailing Address <b>Cactus Pipe and Supply (122185) c/o P.O. Box 87687 Houston, TX 77287</b>			Generator's Site Address (if different than mailing address) <b>N.E. Corner of Dorsett and Market St. Houston, TX 77029</b>		
6. Transporter 1 Company Name <b>U.S. Bulk Transport, Inc.</b>			U.S. EPA ID Number <b>PAD987347515</b>		
7. Transporter 2 Company Name			U.S. EPA ID Number		
8. Designated Facility Name and Site Address <b>US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624</b>			U.S. EPA ID Number <b>IDD073114654</b>		
Facility's Phone: <b>800-274-1516</b>					
9. Waste Shipping Name and Description		10. Containers		11. Total Quantity	12. Unit Wt./Vol.
		No.	Type		
1. <b>Non Hazardous, Non Regulated Soil containing NORM</b>		<b>1</b>	<b>DT</b>	<b>15</b>	<b>Y</b>
2.					
3.					
4.					
13. Special Handling Instructions and Additional Information <b>WSID # 22724</b> Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  <b>Pile NA 9SP27 10 5 NA9SP28</b>					
14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.					
Generator's/Officer's Printed/Typed Name <b>B. Boromy Agent</b>			Signature <b>B. Boromy</b>		Month Day Year <b>09 28 09</b>
15. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: Date leaving U.S.:					
16. Transporter Acknowledgment of Receipt of Materials					
Transporter 1 Printed/Typed Name <b>Wendell Keller</b>			Signature <b>Wendell Keller</b>		Month Day Year <b>09 28 09</b>
Transporter 2 Printed/Typed Name			Signature		Month Day Year
17. Discrepancy					
17a. Discrepancy Indication Space <input checked="" type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection <b>Actual received 10 yrcds. Driver released pending resolution per Umm 10/1/09 (CUE)</b> <b>10 yrcds OK per Solomon Leroy via email 10-5-09 SP</b>					
17b. Alternate Facility (or Generator)			U.S. EPA ID Number		
Facility's Phone:					
17c. Signature of Alternate Facility (or Generator)					
18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a					
Printed/Typed Name <b>Cerian Kastner (GorUOU)</b>			Signature <b>Cerian Kastner</b>		Month Day Year <b>10/1/09</b>

# CERTIFICATE OF DISPOSAL

**October 08,2009**

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0085/ was received by U.S. Ecology, Inc., on 10/01/2009. The waste(s) were subsequently treated, if required by 40 CFR Part 268 and U.S. Ecology's permits and disposed of by 10/01/2009 in accordance with permits and laws regulating this facility.

**Reference Number:** 09100115888-0085-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** *Donna Pullen*

**Title:** RECEIVING SUPERVISOR

P.O. 2159-NR-H033

09093015823

538

45120#  
25yds.

NON-HAZARDOUS WASTE MANIFEST

1. Generator ID Number  
CESQG

2. Page 1 of  
1

3. Emergency Response Phone  
866-780-3116

4. Waste Tracking Number  
0086

5. Generator's Name and Mailing Address  
Cactus Pipe and Supply (122185) c/o  
P.O. Box 87687  
Houston, TX 77287

Generator's Site Address (if different than mailing address)  
N.E. Corner of Dorsett and Market St.  
Houston, TX 77029

Generator's Phone: 713-425-6901  
6. Transporter 1 Company Name  
U.S. Bulk Transport, Inc.

U.S. EPA ID Number  
PAD987347515

7. Transporter 2 Company Name

U.S. EPA ID Number

8. Designated Facility Name and Site Address  
US ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRANDVIEW, ID 83624  
Facility's Phone: 800-274-1516

U.S. EPA ID Number  
IDD073114654

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	
	No.	Type			
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	15	Y	
2.					
3.					
4.					

13. Special Handling Instructions and Additional Information  
WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  
Pile A NR9SP28 5  
NR9SP29 10

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.  
Generator's/Owner's Printed/Typed Name: B. Bonnie Agent  
Signature: Belle Bonny  
Month: 09 Day: 28 Year: 09

15. International Shipments  Import to U.S.  Export from U.S. Port of entry/exit: Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials  
Transporter 1 Printed/Typed Name: Stephen Straszheim  
Signature: Stephen Straszheim  
Month: 9 Day: 28 Year: 09  
Transporter 2 Printed/Typed Name: Signature: Month: Day: Year:

17. Discrepancy  
17a. Discrepancy Indication Space  Quantity  Type  Residue  Partial Rejection  Full Rejection  
Driver Released pending resolution. 9/30/09 - B.J. Manifested at 15 yds. Actual received 25 yds. 9/20/09 - B.J. 25 yds. OK per Stephen  
Manifest Reference Number: U.S. EPA ID Number

17b. Alternate Facility (or Generator) Facility's Phone: U.S. EPA ID Number

17c. Signature of Alternate Facility (or Generator) Month: Day: Year:

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a  
Printed/Typed Name: Brenda Johnson for USEI  
Signature: Brenda Johnson  
Month: 9 Day: 30 Year: 09

# CERTIFICATE OF DISPOSAL

October 08,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0086/  
was received by U.S. Ecology, Inc., on 09/30/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 09/30/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09093015823-0086-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

09100115852 32020# 20 yards

NON-HAZARDOUS WASTE MANIFEST 1. Generator ID Number CESQG 2. Page 1 of 1 3. Emergency Response Phone 866-780-3116 4. Waste Tracking Number 0087

5. Generator's Name and Mailing Address: Cactus Pipe and Supply (122185) c/o P.O. Box 87887 Houston, TX 77287  
 Generator's Site Address (if different than mailing address): N.E. Corner of Dorsett and Market St. Houston, TX 77029  
 Generator's Phone: 713-425-6901

6. Transporter 1 Company Name: U.S. Bulk Transport, Inc. U.S. EPA ID Number: PAD987347515

7. Transporter 2 Company Name: U.S. EPA ID Number:

8. Designated Facility Name and Site Address: US ECOLOGY IDAHO, INC. 20400 LEMLEY ROAD GRANDVIEW, ID 83624 U.S. EPA ID Number: IDD073114654  
 Facility's Phone: 800-274-1516

9. Waste Shipping Name and Description	10. Containers		11. Total Quantity	12. Unit Wt./Vol.
	No.	Type		
1. Non Hazardous, Non Regulated Soil containing NORM	1	DT	20	Y
2.				
3.				
4.				

13. Special Handling Instructions and Additional Information: WSID # 22724 Signed in the course and scope of the contractual performance or service on behalf of the Railroad Commission, as required by a state contact.  
 10 File # NA9SP25 10 Rate # NA 9 SP26

14. GENERATOR'S CERTIFICATION: I certify the materials described above on this manifest are not subject to federal regulations for reporting proper disposal of Hazardous Waste.  
 Generator's/Officer's Printed/Typed Name: B. Boring Signature: [Signature] Month: 09 Day: 28 Year: 09

15. International Shipments:  Import to U.S.  Export from U.S. Port of entry/exit: Date leaving U.S.:

16. Transporter Acknowledgment of Receipt of Materials  
 Transporter 1 Printed/Typed Name: X Larry Hood Signature: [Signature] Month: 9 Day: 28 Year: 09  
 Transporter 2 Printed/Typed Name: Signature: Month: Day: Year:

17. Discrepancy  
 17a. Discrepancy Indication Space:  Quantity  Type  Residue  Partial Rejection  Full Rejection  
 Manifest Reference Number:

17b. Alternate Facility (or Generator): U.S. EPA ID Number:  
 Facility's Phone:

17c. Signature of Alternate Facility (or Generator): Month: Day: Year:

18. Designated Facility Owner or Operator: Certification of receipt of materials covered by the manifest except as noted in Item 17a

Printed/Typed Name: Maria Dubach Krusez Signature: [Signature] Month: 10 Day: 10 Year: 09

GENERATOR  
TRANSPORTER INT'L  
DESIGNATED FACILITY

# CERTIFICATE OF DISPOSAL

October 05,2009

CACTUS PIPE AND SUPPLY (122185)C/O USA ENVIRONMENT  
NE CORNER OF DORSETT AND MARKET ST  
HOUSTON, TX 77029

This is to certify that waste as defined on Uniform Hazardous Waste Manifest number 0087/  
was received by U.S. Ecology, Inc., on 10/01/2009 .The waste(s) were subsequently treated, if required by  
40 CFR Part 268 and U.S. Ecology's permits and disposed of by 10/01/2009 in accordance with permits and  
laws regulating this facility.

**Reference Number:** 09100115852-0087-1-1

**Material:** 1 DUMP TRUCK

**Process:** Direct Landfill

**Facility:** U.S. ECOLOGY IDAHO, INC.  
20400 LEMLEY ROAD  
GRAND VIEW, ID 83624  
EPA ID: IDD073114654

**Waste Type:** NON HAZARDOUS WASTE

**Customer:** USA ENVIRONMENT, LP

**Printed Name:** DONNA PULLEN

**Signature:** Donna Pullen

**Title:** RECEIVING SUPERVISOR

---

# NON NORM SOIL - HPP

---

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11052493
CUSTOMER NAME	USA Environment's, LP				
ORDER NUMBER	113	TRUCK NAME	M. Pulido	TRUCK NO.	P944
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/01/2009	TIME	08:24	WEIGHED BY	Javierd
TOTAL FOR THIS ORDER TODAY			2	LODS	40
				UNITS	

RECEIVED BY:   
SIGNATURE: *JAVIER*

CARRIER SIGNATURE: *JAVIER*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cetera Recycled Concrete of Dorsett St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: L2

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Truck #: 944  
Time: 7:15  
Carrier Signature: *Paul Brown*

Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Material Description: Gravel and Soil

Non DOT Regulated, Non-Hazardous  
Date: 10-1-09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11052492
CUSTOMER NAME	USA Environment's, LP				
ORDER NUMBER	113	TRUCK NAME	M. Pulido	TRUCK NO.	P322
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/01/2009	TIME	08:21	WEIGHED BY	Javierd
TOTAL FOR THIS ORDER TODAY			1	LODS	20
				UNITS	

RECEIVED BY:   
SIGNATURE: *Paul Brown*

CARRIER SIGNATURE: *Paul Brown*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cetera Recycled Concrete of Dorsett St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: L1

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Truck #: 322  
Time: 7:35  
Carrier Signature: *Paul Brown*

Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Material Description: Gravel and Soil

Non DOT Regulated, Non-Hazardous  
Date: 10-1-09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Invoice No.	02150	Trailer No.	S11052497
Sales Order No.	02150	Customer Name	USA Environment, LP	Order Date	10/01/2009	Order Time	08:31
Customer Name	USA Environment, LP	Material Description	Soil - 1	Weight	20	Units	Yard
Material Description	Soil - 1	Carrier Name	M. Pulido	Weight	20	Units	Yard
Carrier Name	M. Pulido	Weight	20	Units	Yard	TOTAL FOR THIS ORDER ONLY	
Weight	20	Units	Yard	TOTAL FOR THIS ORDER ONLY		4	LOADS
TOTAL FOR THIS ORDER ONLY		4	LOADS	TOTAL FOR THIS ORDER ONLY		00	UNITS

RECEIVED BY:  PUBLIC SERVICE COMPANY OF TEXAS

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Carter Mikewald, Corner of DeWitt St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 20DOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.


Truck #: 96  
Customer Signature: 

Customer Use: 24

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cracked Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10-1

Time: 8:00  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Invoice No.	02150	Trailer No.	S11052494
Sales Order No.	02150	Customer Name	USA Environment, LP	Order Date	10/01/2009	Order Time	08:25
Customer Name	USA Environment, LP	Material Description	Soil - 1	Weight	20	Units	Yard
Material Description	Soil - 1	Carrier Name	M. Pulido	Weight	20	Units	Yard
Carrier Name	M. Pulido	Weight	20	Units	Yard	TOTAL FOR THIS ORDER ONLY	
Weight	20	Units	Yard	TOTAL FOR THIS ORDER ONLY		3	LOADS
TOTAL FOR THIS ORDER ONLY		3	LOADS	TOTAL FOR THIS ORDER ONLY		00	UNITS

RECEIVED BY:  PUBLIC SERVICE COMPANY OF TEXAS

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Carter Mikewald, Corner of DeWitt St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 20DOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.


Truck #: 5H811  
Customer Signature: 

Customer Use: 23

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cracked Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10-1

Time: 7:55  
Carrier Signature: 

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

CLASS NO.	2159-NR-H033	JOB NUMBER	02150	TICKET NO.	S11052503
CUSTOMER NAME	USA Environment, LP				
CLASSIFICATION	113	HAZARDOUS	NO	WEIGHT	20
HAZARDOUS	NO	WEIGHT	20	YARD	Yard
DATE	10/01/2009	08:41	Jmend		
UNITS	6	LOADS	120	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

Signature: *[Signature]*

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer No. 888500  
 Sales Order No. 02150

Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dierdorf St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to 7500T Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 1 212

Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 8:12

Date: 10/1

Non DOT Regulated, Non-Hazardous

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

CLASS NO.	2159-NR-H033	JOB NUMBER	02150	TICKET NO.	S11052501
CUSTOMER NAME	USA Environment, LP				
CLASSIFICATION	113	HAZARDOUS	NO	WEIGHT	20
HAZARDOUS	NO	WEIGHT	20	YARD	Yard
DATE	10/01/2009	08:39	Jmend		
UNITS	5	LOADS	100	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

Signature: *[Signature]*

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer No. 888500  
 Sales Order No. 02150

Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dierdorf St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to 7500T Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 1 713

Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 8:05

Date: 10/1

Non DOT Regulated, Non-Hazardous

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

UNIT NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	UNIT NO.	81052520
CUSTOMER NAME	USA Environment, LP			TRUCK NO.		DATE	
DATE RECEIVED	4/04	UNITS ORDERED	USA Environment 944	WEIGHT BY	20	YARD	
MATERIAL DESCRIPTION	Soil - 1			DATE	10/01/2009 09:40	UNIT NO.	81052520
				UNITS FOR THIS ORDER	160	UNITS	

RECEIVED BY:  **CLASS 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87667, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8241, 8276, 8157, #400 and/or other appropriate specifications.

Truck #: 944

Customer Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: 4/1  
Time: 9:05  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

UNIT NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	UNIT NO.	81052516
CUSTOMER NAME	USA Environment, LP			TRUCK NO.		DATE	
DATE RECEIVED	4/04	UNITS ORDERED	USA Environment 826	WEIGHT BY	20	YARD	
MATERIAL DESCRIPTION	Soil - 1			DATE	10/01/2009 09:12	UNIT NO.	81052516
				UNITS FOR THIS ORDER	7	UNITS	140

RECEIVED BY:  **CLASS 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87667, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8241, 8276, 8157, #400 and/or other appropriate specifications.

Truck #: 826

Customer Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: 4/1  
Time: 8:30  
Carrier Signature: *[Signature]*


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work


CUSTOMER COPY  
MATERIAL CODES  
0484

ORDER NO.	888500	PO NUMBER	2159-NR-H033	DOB		SALES ORDER NO.	02158	TICKET NO.	S11052538
CUSTOMER NAME	USA Environment, LP								
PLANT NUMBER	113	MATERIAL NAME	M. Pulido	TRUCK NO.	PS11	DATE	10/01/2009	TIME	09:55
MATERIAL DESCRIPTION	Soil - 1								
DATE	10/01/2009	TIME	09:55	WEIGHED BY	Jmend	SCALE	10 LBS	WEIGHT	200
UNITS	Yards								

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

DELIVER ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunbar St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunbar St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 75007 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 511  
Customer Signature: R. R. R.

Center Signature: E. Medina

Time: 9:15  
Date: 10-1-09

Non DOT Regulated, Non-Hazardous

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: 210

Notice: The manufacturer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0484

ORDER NO.	888500	PO NUMBER	2159-NR-H033	DOB		SALES ORDER NO.	02158	TICKET NO.	S11052524
CUSTOMER NAME	USA Environment, LP								
PLANT NUMBER	113	MATERIAL NAME	M. Pulido	TRUCK NO.	P322	DATE	10/01/2009	TIME	09:45
MATERIAL DESCRIPTION	Soil - 1								
DATE	10/01/2009	TIME	09:45	WEIGHED BY	Jmend	SCALE	9 LBS	WEIGHT	100
UNITS	Yards								

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

DELIVER ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunbar St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunbar St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 75007 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 5922  
Customer Signature: R. R. R.

Center Signature: R. C. A.

Time: 9:10  
Date: 10-1-09

Non DOT Regulated, Non-Hazardous

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: 210

Notice: The manufacturer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	PO NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033	02150	511052539
CUSTOMER NAME: USA Environment, LP		DATE	UNIT
		10/01/2009	Yard
CLASS NUMBER	MATERIAL NAME	TRUCK NO.	WEIGHT BY
404	USA Environment P713		10:10
MATERIAL DESCRIPTION: SOIL - 1		DATE	UNIT
		10/01/2009	12 LOADS
			240 UNITS

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donsett St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: L12

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Chemical Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Concrete materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 713  
Time: 9:32  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	PO NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033	02150	511052534
CUSTOMER NAME: USA Environment, LP		DATE	UNIT
		10/01/2009	Yard
CLASS NUMBER	MATERIAL NAME	TRUCK NO.	WEIGHT BY
113	M. Pulido		10:03
MATERIAL DESCRIPTION: SOIL - 1		DATE	UNIT
		10/01/2009	11 LOADS
			220 UNITS

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donsett St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: L11

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Chemical Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Concrete materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 96  
Time: 9:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511052545
Customer Name	USA Environment, LP						
Customer Address	USA Environment, LP						
Material Description	113	Material Name	M. Pulido	Truck No.	ps25	YARD	YARD
Material Description	Soil - 1						
DATE	10/01/2009	TIME	10:33	WEIGHED BY	Jmend		
TONS FOR THE CURRENT LOAD	14 LOUS		TONS FOR THE CURRENT LOAD		280		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Mariner St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 826  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated, Non-Hazardous

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511052541
Customer Name	USA Environment, LP						
Customer Address	USA Environment, LP						
Material Description	113	Material Name	M. Pulido	Truck No.	ps12	YARD	YARD
Material Description	Soil - 1						
DATE	10/01/2009	TIME	10:13	WEIGHED BY	Jmend		
TONS FOR THE CURRENT LOAD	13 LOUS		TONS FOR THE CURRENT LOAD		260		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Mariner St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 212  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated, Non-Hazardous

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
6404

STATION NO.	888500	PO NUMBER	2159-NR-H033	BOX NO.		SALES ORDER NO.	02150	TICKET NO.	S11052356
CUSTOMER NAME	USA Environment, LP								
CLASSIFICATION	113	MATERIAL NAME	M. Pulido	TRUCK NO.	P322	DATE	10/01/2009	WEIGHED BY	Jmend
MATERIAL DESCRIPTION	Soil - 1								
WEIGHT	16	UNITS	LOADS	WEIGHT	320	UNITS	YARD		

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use: **716**

PO Number: 2159-NR-H033  
Yards: **20**

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T320T Spec Item #247, #276, #3157, #400 and/or other appropriate specification

Truck #: **322**

Customer Signature: *[Signature]*

Time: **11-25**

Carrier Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: **10-1**

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

STATION NO.	888500	PO NUMBER	2159-NR-H033	BOX NO.		SALES ORDER NO.	02150	TICKET NO.	S11052355
CUSTOMER NAME	USA Environment, LP								
CLASSIFICATION	113	MATERIAL NAME	M. Pulido	TRUCK NO.	P344	DATE	10/01/2009	WEIGHED BY	Jmend
MATERIAL DESCRIPTION	Soil - 1								
WEIGHT	15	UNITS	LOADS	WEIGHT	300	UNITS	YARD		

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use: **715**

PO Number: 2159-NR-H033  
Yards: **20**

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T320T Spec Item #247, #276, #3157, #400 and/or other appropriate specification

Truck #: **940**

Customer Signature: *[Signature]*

Time: **11-20**

Carrier Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: **10-20**

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

UNIT NO.	PO NUMBER	SALES ORDER NO.	TRUCK NO.
885508	2159-NR-H033	02150	511052566
CUSTOMER NAME: USA Environment, LP			
DATE	TIME	WEIGHED BY	UNITS
10/01/2009	11:43	Jmend	18 Loads
MATERIAL DESCRIPTION: Soil - 1			360 UNITS

DELIVER/ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston TX**

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER: \_\_\_\_\_  
SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Use

PO Number 2159-NR-H033  
Yards 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil

Process to 73207 Spec Item 8317, 8376, 83117, #400 and/or other appropriate specifications.

Track #: 713

Customer Name: USA Environment  
P.O. Box 6787, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Customer No. 885500  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

UNIT NO.	PO NUMBER	SALES ORDER NO.	TRUCK NO.
885508	2159-NR-H033	02150	511052559
CUSTOMER NAME: USA Environment, LP			
DATE	TIME	WEIGHED BY	UNITS
10/01/2009	11:16	Jmend	17 Loads
MATERIAL DESCRIPTION: Soil - 1			348 UNITS

DELIVER/ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston TX**

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER: **Edwin**  
SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Use

PO Number 2159-NR-H033  
Yards 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil

Process to 73207 Spec Item 8317, 8376, 83117, #400 and/or other appropriate specifications.

Track #: 511

Customer Name: USA Environment  
P.O. Box 6787, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Customer No. 885500  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	911052570
CARRIER NAME	USA Environment, LP		DATE	10/01/2009	TIME	11:55
TRUCK #	M. Pulido	P212	WEIGHT	20	YARD	
MATERIAL DESCRIPTION	Soil - 1		TOTAL FOR THIS ORDER TODAY	Jmard		
			20 LOADS	400		UNITS

RESERVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**

RECEIVED BY: 

TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *K. Macle*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Signature: *R. Bon*

Under the carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Gravel Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants customer transported are non-hazardous materials, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to PSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 212

Time: 11:00

Carrier Signature: *K. Macle*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	911052568
CARRIER NAME	USA Environment, LP		DATE	10/01/2009	TIME	11:48
TRUCK #	M. Pulido	P007	WEIGHT	20	YARD	
MATERIAL DESCRIPTION	Soil - 1		TOTAL FOR THIS ORDER TODAY	Jmard		
			19 LOADS	380		UNITS

RESERVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**

RECEIVED BY: 

TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Bill B*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Signature: *R. Bon*

Under the carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Gravel Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants customer transported are non-hazardous materials, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to PSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 007

Time: 11:00

Carrier Signature: *Bill B*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511052560
Customer Name:	USA Environment, LP			
Truck #:	113	M. Pulido	P944	
Material Description:	Soil - 1			

Customer No.	888500	2159-NR-H033	02150	511052578
Customer Name:	USA Environment, LP			
Truck #:	113	M. Pulido	P826	
Material Description:	Soil - 1			


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

RECEIVED BY:  M. Pulido

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

RECEIVED BY:  M. Pulido

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Customer Name: HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non-Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus District, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 6242, 6276, 6315, 6400 unless other appropriate specification.

Truck #: 9442  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cement Company (SCC). The carrier/customer shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Southern Cement Company warrants transported material to meet specifications, and any not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/01/2009  
Time: 12:29  
Carrier Signature: 


**Bill of Lading**

Customer Name: HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
Non-DOT  
L23

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus District, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 6242, 6276, 6315, 6400 unless other appropriate specification.

Truck #: 826  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cement Company (SCC). The carrier/customer shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Southern Cement Company warrants transported material to meet specifications, and any not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/01/2009  
Time: 12:17  
Carrier Signature: 

CUSTOMER COPIES  
Material codes  
0404

888508	2159-NR-H033	02150	511052598
CUSTOMER NAME: USA Environment, LP		20	Yard
113	M. Pulido	ps11	
MATERIAL DESCRIPTION: Soil - 1		10/01/2009 13:17	Jmand
		E3 LOUSE	460 UNITS



Class 1 Material  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kornet Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 25207 Spec from 8247, 8376, 83157, 8400 and/or other appropriate specification.

Truck #: 511  
Customer Signature: \_\_\_\_\_

PO Number: 2159-NR-H033  
Yards: 12,500  
L25

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10-1

Carrier Signature: *E. Pulido*

CUSTOMER COPIES  
Material codes  
0404

888508	2159-NR-H033	02150	511052584
CUSTOMER NAME: USA Environment, LP		20	Yard
113	M. Pulido	ps22	
MATERIAL DESCRIPTION: Soil - 1		10/01/2009 12:44	Jmand
		E3 LOUSE	460 UNITS



Class 1 Material  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kornet Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 25207 Spec from 8247, 8376, 83157, 8400 and/or other appropriate specification.

Truck #: 322  
Customer Signature: \_\_\_\_\_

PO Number: 2159-NR-H033  
Yards: 20  
L21

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10-1

Carrier Signature: *M. Pulido*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			PO Number	2159-NR-H033	Material Code	0404
Truck #	994	Carrier	20	Yard	20	Units	40

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cactus Pipeyard, Corner of Doremi St. and Market St.  
Houston, TX

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:  SIGNATURE: *Javier*

DATE	TIME	WEIGHT	UNITS
18/07/2009	08:20	Jmend	40

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall issue and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cactus Pipeyard, Corner of Doremi St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 994  
Time: 7:35  
Carrier: *Javier*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			PO Number	2159-NR-H033	Material Code	0404
Truck #	198	Carrier	20	Yard	20	Units	20

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cactus Pipeyard, Corner of Doremi St. and Market St.  
Houston, TX

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:  SIGNATURE: *Moff*

DATE	TIME	WEIGHT	UNITS
18/07/2009	08:05	Jmend	20

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall issue and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cactus Pipeyard, Corner of Doremi St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 198  
Time: 7:30  
Carrier: *M. C. Lewis*

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	S11052957
Customer Name:	USA Environment, LP			
Customer Address:	USA Environment, LP			
Material Description:	113	M. Pulido	P826	
Material Description:	Soil - 1			
Carrier:	10/07/2009	08:36	Jmend	
Carrier:	TOTAL POUNDS OVER TOW		4	00
Carrier:	TOTAL POUNDS OVER TOW		4	00

RECEIVED BY:  Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**


Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Durock St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 2-0  
RRG Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 826  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Consolidated Carbon and/or HPP. The carrier shall save and hold SOC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

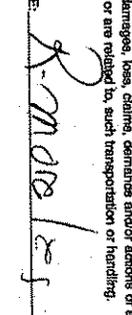
Non DOT Regulated, Non-Hazardous  
Date: 10/7/09  
Time: 7:50  
Carrier Signature: 

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	S11052951
Customer Name:	USA Environment, LP			
Customer Address:	USA Environment, LP			
Material Description:	113	M. Pulido	P212	
Material Description:	Soil - 1			
Carrier:	10/07/2009	08:23	Jmend	
Carrier:	TOTAL POUNDS OVER TOW		3	00
Carrier:	TOTAL POUNDS OVER TOW		3	00

RECEIVED BY:  Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**


Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150


Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Durock St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 2-0  
RRG Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 212  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Consolidated Carbon and/or HPP. The carrier shall save and hold SOC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/7/09  
Time: 7:45  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

0404

CUSTOMER COPY  
MATERIAL CODES

CUSTOMER NO.	2159-NR-H033	ISSUE NO.	02150	ISSUE DATE	11/05/2003
CUSTOMER NAME	USA Environment, LP				
TRUCK NO.	113	TRUCK NAME	M. Pulido	TRUCK NO.	P777
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	QUANTITY	00:52	UNIT	Yard
WEIGHTED BY	Jmwend				
UNITS FOR THIS ORDER ONLY	6	LOADS			120
					UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Glenn Cooper*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX 77034

Material Description: Gravel and Soil  
Process is 72007 Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 777  
Customer Signature: *Roy*

PO Number: 2159-NR-H033  
Yards: 22  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Gravel Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous in accordance with applicable laws and regulations.

Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 8:15

Carrier Signature: *Glenn Cooper*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

0404

CUSTOMER COPY  
MATERIAL CODES

CUSTOMER NO.	2159-NR-H033	ISSUE NO.	02150	ISSUE DATE	11/05/2003
CUSTOMER NAME	USA Environment, LP				
TRUCK NO.	113	TRUCK NAME	M. Pulido	TRUCK NO.	P894
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	QUANTITY	00:46	UNIT	Yard
WEIGHTED BY	Jmwend				
UNITS FOR THIS ORDER ONLY	5	LOADS			100
					UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Glenn Cooper*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX 77034

Material Description: Gravel and Soil  
Process is 72007 Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 097  
Customer Signature: *Roy*

PO Number: 2159-NR-H033  
Yards: 22  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Gravel Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous in accordance with applicable laws and regulations.

Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 8:01

Carrier Signature: *Roy*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	007				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 007  
Customer Signature: *[Signature]*

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	007				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 007  
Customer Signature: *[Signature]*

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	322				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	322				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	322				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

Customer No.	888500	Transport to: HPP Corp	2070 Genoa Red Bluff	Houston, TX 77034	(281) 487-0766 Fax (281) 487-0769
Customer Name:	USA Environment	Former: Cetera Ploward, Corner of Donnet St. and Market St.	Houston, TX		
Material Description:	Gravel and Soil				
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.					
Truck #:	322				
Customer Signature:	<i>[Signature]</i>				



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former: Cetera Ploward, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8242, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511052975
Customer Name:	USA Environment, LP			
Customer Address:	USA Environment, LP			
Customer City:	Houston, TX			
Customer State:	TX			
Customer Zip:	77034			
Customer Phone:	(281) 487-0766			
Customer Fax:	(281) 487-0769			
Customer Email:	usa@usaenv.com			
Customer Website:	www.usaenv.com			
Customer Account No.:	02150			
Customer Order No.:	02150			
Customer Invoice No.:	02150			
Customer Invoice Date:	10/07/2009			
Customer Invoice Time:	09:22			
Customer Invoice User:	jmand			
Customer Invoice Unit:	YARD			
Customer Invoice Qty:	20			
Customer Invoice Total:	10.0000			
Customer Invoice Tax:	200			
Customer Invoice Net Total:	10.0000			
Customer Invoice Tax Total:	200			
Customer Invoice Grand Total:	200			

CLASS 1 MATERIAL  
Former Cactus Pipeyard, Houston, TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**


Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer No. 888500  
Sales Order No. 02150

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 0217, 0276, 0317, 0400 and/or other appropriate specifications.

Truck #: 019  
Customer Signature: 

Time: 8:35  
Center Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511052975
Customer Name:	USA Environment, LP			
Customer Address:	USA Environment, LP			
Customer City:	Houston, TX			
Customer State:	TX			
Customer Zip:	77034			
Customer Phone:	(281) 487-0766			
Customer Fax:	(281) 487-0769			
Customer Email:	usa@usaenv.com			
Customer Website:	www.usaenv.com			
Customer Account No.:	02150			
Customer Order No.:	02150			
Customer Invoice No.:	02150			
Customer Invoice Date:	10/07/2009			
Customer Invoice Time:	09:15			
Customer Invoice User:	jmand			
Customer Invoice Unit:	YARD			
Customer Invoice Qty:	20			
Customer Invoice Total:	9.0000			
Customer Invoice Tax:	180			
Customer Invoice Net Total:	9.0000			
Customer Invoice Tax Total:	180			
Customer Invoice Grand Total:	180			

CLASS 1 MATERIAL  
Former Cactus Pipeyard, Houston, TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer No. 888500  
Sales Order No. 02150

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 0217, 0276, 0317, 0400 and/or other appropriate specifications.

Truck #: 019  
Customer Signature: 

Time: 8:30  
Center Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0484

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0484

Customer Name:	USA Environment, LP	Invoice No.:	02150	Invoice Date:	5/10/2009
Customer No.:	888500	PO Number:	2158-NR-H033	Material Code:	113
Sales Order No.:	02150	Yards:	220	Units:	240
Material Description:	Soil - 1	Weighted By:	Yard	Volume:	12.0009
Carrier:	M. Pulido	Weighted By:	Yard	Volume:	12.0009
Signature:	M. Pulido	Weighted By:	Yard	Volume:	12.0009

RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Customer Name:	USA Environment, LP	Invoice No.:	02150	Invoice Date:	5/10/2009
Customer No.:	888500	PO Number:	2158-NR-H033	Material Code:	113
Sales Order No.:	02150	Yards:	220	Units:	220
Material Description:	Soil - 1	Weighted By:	Yard	Volume:	11.0009
Carrier:	M. Pulido	Weighted By:	Yard	Volume:	11.0009
Signature:	M. Pulido	Weighted By:	Yard	Volume:	11.0009

RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2158-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 198  
Date: 5/10/09  
Time: 9:00  
Carrier Signature: M.G. Lewis

Non DOT Regulated, Non-Hazardous

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2158-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 340  
Date: 5/10/09  
Time: 8:30  
Carrier Signature: M. Pulido

Non DOT Regulated, Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

PRO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	PO NUMBER	2159-NR-H033
CUSTOMER NAME	USA Environment, LP		DATE	10/07/2009	TIME
QUANTITY	113	UNIT	Yard	WEIGHTED BY	Weight
MATERIAL DESCRIPTION	M. PULIDO		DATE	10/07/2009	TIME
SO11	1		TOTAL FOR THIS ORDER	14 Loads	280 UNITS

DELIVERY ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: 

CARRIER SIGNATURE: *K. Morales*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornier St. and Marlene St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 027, 0376, 03157, 0400 and/or other appropriate specifications.

Truck #: 212  
Customer Signature: *B. Boy*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L38

Non DOT Regulated, Non-Hazardous  
Date: 10/07/09  
Time: 9:15  
Carrier Signature: *R. Morales*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

PRO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	PO NUMBER	2159-NR-H033
CUSTOMER NAME	USA Environment, LP		DATE	10/07/2009	TIME
QUANTITY	113	UNIT	Yard	WEIGHTED BY	Weight
MATERIAL DESCRIPTION	M. PULIDO		DATE	10/07/2009	TIME
SO11	1		TOTAL FOR THIS ORDER	13 Loads	260 UNITS

DELIVERY ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: 

CARRIER SIGNATURE: *J. Jones*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornier St. and Marlene St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 027, 0376, 03157, 0400 and/or other appropriate specifications.

Truck #: 044  
Customer Signature: *B. Boy*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L37

Non DOT Regulated, Non-Hazardous  
Date: 10/07/09  
Time: 9:10  
Carrier Signature: *J. Jones*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES

0404

ORDER NO.	PO NUMBER	BOX NUMBER	SALES ORDER NO.	TICKET NO.
888508	2159-NR-H033		02150	511052986
CUSTOMER NAME USA Environment, LP				
DATE RECEIVED	DATE SHIPPED	TRUCK NO.	WEIGHTED BY	UNITS
113	M. Pulido	P086	Jimend	320 UNITS
MATERIAL DESCRIPTION: Soil - 1				

Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

DATE	TIME	WEIGHTED BY	UNITS
10/07/2009	10:10	Jimend	320 UNITS
NOTICE: The carrier/broker involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/broker shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.			

CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Environ. Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX 77002, TX

Customer No. 888500  
Sales Order No. 02150  
Truck #: 9226  
Customer Signature: [Signature]

Customer Use

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/broker involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and Aggregate (SCCA). The carrier/broker shall save and hold SCCA harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/17  
Time: [Signature]  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES

0404

ORDER NO.	PO NUMBER	BOX NUMBER	SALES ORDER NO.	TICKET NO.
888508	2159-NR-H033		02150	511052986
CUSTOMER NAME USA Environment, LP				
DATE RECEIVED	DATE SHIPPED	TRUCK NO.	WEIGHTED BY	UNITS
113	M. Pulido	P083	Jimend	300 UNITS
MATERIAL DESCRIPTION: Soil - 1				

Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

DATE	TIME	WEIGHTED BY	UNITS
10/07/2009	10:03	Jimend	300 UNITS
NOTICE: The carrier/broker involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/broker shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.			

CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Environ. Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX 77002, TX

Customer No. 888500  
Sales Order No. 02150  
Truck #: 085  
Customer Signature: [Signature]

Customer Use

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/broker involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and Aggregate (SCCA). The carrier/broker shall save and hold SCCA harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/17  
Time: [Signature]  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511052994
Sales Order No.	02150			
Customer Name:	USA Environment, LP			
Material Description:	113	M. Pulido	P322	
Weighted by:	18 Loads		360	Units

Class 1 Material  
Former Cactus Bipyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
L42

RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dognath St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8347, 8376, 83157, 4400 and/or other appropriate specifications.

Truck #: 322  
Customer Signature: *[Signature]*

Center Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: 10/7/2009

Time: 9:50  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511052991
Sales Order No.	02150			
Customer Name:	USA Environment, LP			
Material Description:	113	M. Pulido	P777	
Weighted by:	17 Loads		340	Units

Class 1 Material  
Former Cactus Bipyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
L41

RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dognath St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8347, 8376, 83157, 4400 and/or other appropriate specifications.

Truck #: 777  
Customer Signature: *[Signature]*

Center Signature: *[Signature]*

Non DOT Regulated, Non-Hazardous  
Date: 10/7/2009

Time: 9:35  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	PO NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033	02150	511052994
CUSTOMER NAME USA Environment, LP			
QUANTITY	UNIT	WEIGHT	UNIT
113	M. PULIDO	20	Yard
MATERIAL DESCRIPTION: Soil - 1			
DATE		WEIGHT BY	
10/07/2009 10:33		Jmerid	
TOTALS FOR THIS ORDER ONLY			
10 Loads		360	UNITS

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Marjies St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 312  
Customer Signature: *[Signature]*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/7/09  
Time: 9:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	PO NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033	02150	511052994
CUSTOMER NAME USA Environment, LP			
QUANTITY	UNIT	WEIGHT	UNIT
113	M. PULIDO	20	Yard
MATERIAL DESCRIPTION: Soil - 1			
DATE		WEIGHT BY	
10/07/2009 10:22		Jmerid	
TOTALS FOR THIS ORDER ONLY			
17 Loads		340	UNITS

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Marjies St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 977  
Customer Signature: *[Signature]*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/7/09  
Time: 9:35  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888300	PO Number	2159-NR-H033	DATE	02150	TRUCK NO.	S11052997
Customer Name	USA Environment, LP			DATE	02	TRUCK NO.	Yard
Customer Address	113 M. Pulido			DATE	10/07/2009	TRUCK NO.	10:39
Material Description	Soil - 1			DATE	20	TRUCK NO.	400

RECEIVED BY: **CLASS 1 Material Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Denmark St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Sand  
Process to TADOT Spec Item K217, K276, K317, K400 and/or other appropriate specifications.

Truck #: 325

Time: 12:05

Carrier Signature: 

Customer Signature: 

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888300	PO Number	2159-NR-H033	DATE	02150	TRUCK NO.	S11052995
Customer Name	USA Environment, LP			DATE	02	TRUCK NO.	Yard
Customer Address	113 M. Pulido			DATE	10/07/2009	TRUCK NO.	10:36
Material Description	Soil - 1			DATE	19	TRUCK NO.	380

RECEIVED BY: **CLASS 1 Material Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Denmark St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TADOT Spec Item K217, K276, K317, K400 and/or other appropriate specifications.

Truck #: 007

Time: 9:55

Carrier Signature: 

Customer Signature: 

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	SALES ORDER NO.	02150	MODEL NO.	S11053001
CUSTOMER NAME	USA Environment, LP				
SHIP TO	NAME	PHONE	FAX	WEIGHT BY	UNIT
113	M. Pulido			20	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	10:52	Jmehd	
TOTAL FROM THIS ORDER TODAY	22 Loads	440 UNITS			

RESERVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, fees, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

PO Number: 2159-NR-1033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Truck #: 198

Time: 10:15

Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	SALES ORDER NO.	02150	MODEL NO.	S11052999
CUSTOMER NAME	USA Environment, LP				
SHIP TO	NAME	PHONE	FAX	WEIGHT BY	UNIT
113	M. Pulido			20	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	10:48	Jmehd	
TOTAL FROM THIS ORDER TODAY	21 Loads	420 UNITS			

RESERVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, fees, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

PO Number: 2159-NR-1033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Truck #: 198

Time: 10:05

Center Signature: *[Signature]*

Bill of Lading



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Paved, Corner of Dierker St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 4400 and/or other  
appropriate specifications

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Houston Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Consensus version materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Truck #: 340

Customer Signature: [Signature]

Carrier Signature: [Signature]  
Time: 10:25  
Date: 10/25

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

447

Bill of Lading



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Paved, Corner of Dierker St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 4400 and/or other  
appropriate specifications

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Consensus version materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Truck #: 001

Customer Signature: [Signature]

Carrier Signature: [Signature]  
Time: 10:31  
Date: 10/25

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

448

CUSTOMER COPY

MATERIAL CODES

**HPP**  
2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

Customer Use  
0404

PRODUCTION NO.	FOR NUMBER	FOR NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	511053004
CUSTOMER NAME: USA Environment, LP				
MATERIAL NUMBER	QUANTITY	WEIGHTED BY	UNIT	UNIT
113	M. Pulido	P340	20	Yard
DATE: 10/07/2009 11:00				
DRIVER: jaend				
MATERIAL DESCRIPTION: Soil - 1				
			23 Loads	450 UNITS

RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston Reprinted Tickets TX



SIGNATURE:

CARRIER SIGNATURE:

10/20/09

CUSTOMER COPY

MATERIAL CODES

**HPP**  
2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

Customer Use  
0404

PRODUCTION NO.	FOR NUMBER	FOR NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	511053009
CUSTOMER NAME: USA Environment, LP				
MATERIAL NUMBER	QUANTITY	WEIGHTED BY	UNIT	UNIT
113	M. Pulido	P001	20	Yard
DATE: 10/07/2009 11:11				
DRIVER: jaend				
MATERIAL DESCRIPTION: Soil - 1				
			24 Loads	480 UNITS

RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston Reprinted Tickets TX



SIGNATURE:

CARRIER SIGNATURE:

10/20/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SHIP DATE	02150	TRUCK NO.	511053018
CUSTOMER NAME:				USA Environment, LP			
UNIT NUMBER	113	QUANTITY	M. Puidio	TRUCK NO.	PE12		
MATERIAL DESCRIPTION:				Soil - 1			
DATE	10/07/2009	TIME	11:37	WEIGHED BY	jaend		
TOTAL FROM THIS ORDER ONLY				26 Loads	520	UNITS	

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *A. Morales*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 8787, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dierckx St. and Market St., Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

450

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Track #: air

Customer Signature: *burg*

Time: 11:05

Carrier Signature: *R. Morales*

Date: 10/7

Non DOT Regulated Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SHIP DATE	02150	TRUCK NO.	511053017
CUSTOMER NAME:				USA Environment, LP			
UNIT NUMBER	113	QUANTITY	M. Puidio	TRUCK NO.	P944		
MATERIAL DESCRIPTION:				Soil - 1			
DATE	10/07/2009	TIME	11:31	WEIGHED BY	jaend		
TOTAL FROM THIS ORDER ONLY				25 Loads	500	UNITS	

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Mike*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 8787, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dierckx St. and Market St., Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

449

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Track #: 9444

Customer Signature: *Bony*

Time: 10:55

Carrier Signature: *David*

Date: 10/7

Non DOT Regulated Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053021
Customer Name	USA Environment, LP					
Material Description	113	M. Pulido	TRUCK NO.	P826	DATE	10/07/2009 11:57
Soil - 1			WEIGHED BY	Jasnd	TIME	20
			YARD	Yard		
			TOTAL TONS (GROSS TON)	28	LOADS	560
			UNITS			

RESERVED BY: **Class 1 Material Former Cactus Bivoyard, Houston TX**

SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: \_\_\_\_\_

**Bill of Lading**

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Customer No.: 888500  
 Sales Order No.: 02150

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
 Process in TSDOT Spec Item 8242, 8276, 83151, 8400 and/or other appropriate specifications.

Truck #: 9226  
 Date: 10/07/2009  
 Time: 11:57  
 Customer Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053020
Customer Name	USA Environment, LP					
Material Description	113	M. Pulido	TRUCK NO.	P083	DATE	10/07/2009 11:50
Soil - 1			WEIGHED BY	Jasnd	TIME	20
			YARD	Yard		
			TOTAL TONS (GROSS TON)	27	LOADS	540
			UNITS			

RESERVED BY: **Class 1 Material Former Cactus Bivoyard, Houston TX**

SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: \_\_\_\_\_

**Bill of Lading**

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Customer No.: 888500  
 Sales Order No.: 02150

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
 Process in TSDOT Spec Item 8242, 8276, 83151, 8400 and/or other appropriate specifications.

Truck #: 083  
 Date: 10/07/2009  
 Time: 11:20  
 Customer Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053026
CUSTOMER NAME	USA Environment, LP						
PLATES NUMBER	113	PLATES STATE	M. Pulido	TRUCK NO.	P322	WEIGHTED BY	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/07/2009	TIME	12:17	WEIGHTED BY	Jaeend	TOTALS FOR THIS ORDER ONLY	30 Loads 600 UNITS



RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards 2.2 54  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 322  
Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 11:35  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053023
CUSTOMER NAME	USA Environment, LP						
PLATES NUMBER	113	PLATES STATE	M. Pulido	TRUCK NO.	P777	WEIGHTED BY	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/07/2009	TIME	12:05	WEIGHTED BY	Jaeend	TOTALS FOR THIS ORDER ONLY	29 Loads 580 UNITS



RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards 2.2 53  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 777  
Customer Signature: *[Signature]*


Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 11:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511053028
Customer Name	USA Environment, LP			
Material Description	113	M, Pulido	P375	
Material Description	Soil - 1			
DATE RECEIVED	10/07/2009	12:30	jaend	
UNITS	32	LOADS	640	UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 22

RRC Material  
Non DOT Regulated Non Hazardous

56

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specifications.

Truck #: 375

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Carrier Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/7/09  
Time: 11:50

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511053027
Customer Name	USA Environment, LP			
Material Description	113	M, Pulido	P007	
Material Description	Soil - 1			
DATE RECEIVED	10/07/2009	12:25	jaend	
UNITS	31	LOADS	620	UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 22

RRC Material  
Non DOT Regulated Non Hazardous

55

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specifications.

Truck #: 007

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Carrier Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/7/09  
Time: 11:45

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.dprexycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511053035
Customer Name	USA Environment, LP			
Material Description	113	M. Pulido	p019	
DATE RECEIVED	10/07/2009	12:47	jaend	
UNITS	34 Loads		560	

RECEIVED BY: **Glass 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
HRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dismont St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 019  
Customer Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/7/09  
Time: 12:47  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.dprexycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511053034
Customer Name	USA Environment, LP			
Material Description	113	M. Pulido	p340	
DATE RECEIVED	10/07/2009	12:42	jaend	
UNITS	33 Loads		550	

RECEIVED BY: **Glass 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
HRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dismont St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 340  
Customer Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/7/09  
Time: 12:15  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	INVOICE NO.	02150	TICER NO.	S11053042
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	13:13	INITIALS	Jend
UNITS	38 LUBS	WEIGHT	750	UNITS	



RECEIVED BY:  
 Class 1 Material  
 Forster Cactus Pileyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Konrad*

**Bill of Lading**

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name:  
 USA Environment  
 P.O. Box 87697, Houston, TX 77287  
 Former Cactus Pileyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8242, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 212  
 Customer Signature: *Bj*

Non DOT Regulated Non-Hazardous  
 Date: 10/12/09  
 Time: 12:33  
 Carrier Signature: *Konrad*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	INVOICE NO.	02150	TICER NO.	S11053041
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	13:06	INITIALS	Jend
UNITS	37 LUBS	WEIGHT	740	UNITS	



RECEIVED BY:  
 Class 1 Material  
 Forster Cactus Pileyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Dave*

**Bill of Lading**

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name:  
 USA Environment  
 P.O. Box 87697, Houston, TX 77287  
 Former Cactus Pileyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8242, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 944  
 Customer Signature: *Rony*

Non DOT Regulated Non-Hazardous  
 Date: 10/12/09  
 Time: 12:30  
 Carrier Signature: *Gavin Bandy*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY

MATERIAL CODES

CUSTOMER NO.	2159-NR-H033	JOB NUMBER	02150	TICKET NO.	511053046
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER VALUE	M. Pulido	TRUCK NO.	P826
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	13:29	WEIGHED BY	Jwend
UNITS	40 Loads	WEIGHT	20	UNIT	Yard
WEIGHT	TOWNSHIP THIS ORDER TODAY		800 UNITS		

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:   
CLASS 1 Material  
Former Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 


Bill of Lading

Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kemper Cactus Pipeyard, Corner of Dewart St. and Main St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 0241, 0276, 03157, 0400 and/or other appropriate specifications.

Truck #: 826  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY

MATERIAL CODES

CUSTOMER NO.	2159-NR-H033	JOB NUMBER	02150	TICKET NO.	511053043
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER VALUE	M. Pulido	TRUCK NO.	P093
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	13:19	WEIGHED BY	Jwend
UNITS	39 Loads	WEIGHT	20	UNIT	Yard
WEIGHT	TOWNSHIP THIS ORDER TODAY		780 UNITS		

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:   
CLASS 1 Material  
Former Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 

Bill of Lading

Customer Name: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kemper Cactus Pipeyard, Corner of Dewart St. and Main St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 0241, 0276, 03157, 0400 and/or other appropriate specifications.

Truck #: 083  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	SHIP NUMBER	SHIP ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	S1105304B
CUSTOMER NAME	USA Environment, LP			
PLANT NUMBER	PLANT NAME	TRUCK NO.		
113	M. Pulido	P007		
MATERIAL DESCRIPTION: Soil - 1				
DATE	TIME	WEIGHED BY	UNITS	
10/07/2009	13:44	jsend	20	Yard
TOTALS FOR THIS ORDER/TICKET:			42	LOADS
			940	UNITS

RECEIVED BY: **Class 1 Material Forster Cactus Bipyard, Houston** TX

DELIVERY ADDRESS: **Class 1 Material Forster Cactus Bipyard, Houston**

RECEIVED BY: \_\_\_\_\_

CARRIER SIGNATURE: *Bel Kan*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	SHIP NUMBER	SHIP ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	S1105304X
CUSTOMER NAME	USA Environment, LP			
PLANT NUMBER	PLANT NAME	TRUCK NO.		
113	M. Pulido	P777		
MATERIAL DESCRIPTION: Soil - 1				
DATE	TIME	WEIGHED BY	UNITS	
10/07/2009	13:34	jsend	20	Yard
TOTALS FOR THIS ORDER/TICKET:			41	LOADS
			820	UNITS

RECEIVED BY: **Class 1 Material Forster Cactus Bipyard, Houston** TX

DELIVERY ADDRESS: **Class 1 Material Forster Cactus Bipyard, Houston**

RECEIVED BY: \_\_\_\_\_

CARRIER SIGNATURE: *Blaise Berger*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

**HPP Corp**  
Transporter: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dierkes St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Material

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Company (SC) or HPP. The carrier shall save and hold SC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier's responsibility is limited to, such transportation or handling. Customer's responsibility is limited to, such transportation or handling. Customer's responsibility is limited to, such transportation or handling.

Non DOT Regulated Non-Hazardous

Date: 10/15/09  
Time: 12:15  
Carrier Signature: *DL*

**Bill of Lading**

**HPP Corp**  
Transporter: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dierkes St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Company (SC) or HPP. The carrier shall save and hold SC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier's responsibility is limited to, such transportation or handling. Customer's responsibility is limited to, such transportation or handling. Customer's responsibility is limited to, such transportation or handling.

Non DOT Regulated Non-Hazardous

Date: 10/15/09  
Time: 1:00  
Carrier Signature: *Blaise Berger*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/10/2009
Customer Name	USA Environment, LP						
Material Description	113	M, Pulido	P375	Quantity	20	Unit	Yard
Material Description	Soil - 1						
Carrier	USA Environment, LP						
Carrier No.	10/07/2009 13:50						
Carrier Name	Jasend						
Carrier Address	44 Lours						
Carrier City	880						
Carrier State	UNITS						

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Market St. Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

68

Material Description: Gravel and Soil  
Process to 75007 Spec Item 4247, 4276, 43137, 4400 and/or other appropriate specification.

Truck #: 375  
Customer Signature: 

Time: 1:20  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/10/2009
Customer Name	USA Environment, LP						
Material Description	113	M, Pulido	P322	Quantity	20	Unit	Yard
Material Description	Soil - 1						
Carrier	USA Environment, LP						
Carrier No.	10/07/2009 13:48						
Carrier Name	Jasend						
Carrier Address	43 Lours						
Carrier City	860						
Carrier State	UNITS						

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Market St. Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

66

Material Description: Gravel and Soil  
Process to 75007 Spec Item 4247, 4276, 43137, 4400 and/or other appropriate specification.

Truck #: 322  
Customer Signature: 

Time: 1:11  
Carrier Signature: 

Header: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains responsible for all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Header: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains responsible for all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

CLASSIFICATION NO.	2159-NR-H033	PO NUMBER	02150	PALETS ORDER NO.	511053035
CUSTOMER NAME	USA Environment, LP				
PLATE NUMBER	113	HAULER NAME	M. Pulido	TRUCK NO.	P019
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/07/2009	TIME	14:23	WEIGHED BY	Jmend
TOTAL TONS FOR THIS ORDER TODAY				46	LOADS
				520	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**



CARRIER SIGNATURE: *M. Galca*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use

PO Number: 2159-NR-H033

Yards: 20

REC Material

**Non DOT Regulated Non Hazardous**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8242.87% 83157, \$400 and/or other appropriate specifications.

Truck #: 0129

Customer Signature: *[Signature]*

Notes: The certification involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Sustainable Resource Corporation (SRC). The carrier shall save and hold SRC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants that the material is as described and is not a regulated hazardous waste.

Non DOT Regulated Non Hazardous

Date: 10/7/09

Time: 14:23

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

CLASSIFICATION NO.	2159-NR-H033	PO NUMBER	02150	PALETS ORDER NO.	511053054
CUSTOMER NAME	USA Environment, LP				
PLATE NUMBER	113	HAULER NAME	M. Pulido	TRUCK NO.	P340
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/07/2009	TIME	14:13	WEIGHED BY	Jmend
TOTAL TONS FOR THIS ORDER TODAY				45	LOADS
				900	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**



CARRIER SIGNATURE: *M. Galca*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use

PO Number: 2159-NR-H033

Yards: 20

REC Material

**Non DOT Regulated Non Hazardous**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8242.87% 83157, \$400 and/or other appropriate specifications.

Truck #: 940

Customer Signature: *[Signature]*

Notes: The certification involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Sustainable Resource Corporation (SRC). The carrier shall save and hold SRC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants that the material is as described and is not a regulated hazardous waste.

Non DOT Regulated Non Hazardous

Date: 10/7/09

Time: 14:13

Carrier Signature: *[Signature]*

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE OPENED	02150	TICKET NO.	511053067
CUSTOMER NAME	USA Environment, LP						
CARRIER	113	DRIVER	M. Pulido	TRUCK NO.	P001	WEIGHED BY	Jmand
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/07/2009		TIME	14:58		SCALE	Jmand
WEIGHT	48 Loads		UNIT	960 UNITS			

RECEIVED BY:  **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Perez*

**Bill of Lading**

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
72  
KRG Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to 752007 Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 001  
Customer Signature: *Bon*

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE OPENED	02150	TICKET NO.	511053061
CUSTOMER NAME	USA Environment, LP						
CARRIER	113	DRIVER	M. Pulido	TRUCK NO.	P198	WEIGHED BY	Jmand
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/07/2009		TIME	14:41		SCALE	Jmand
WEIGHT	47 Loads		UNIT	940 UNITS			

RECEIVED BY:  **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. G. Jones*

**Bill of Lading**

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
71  
KRG Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to 752007 Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 198  
Customer Signature: *B. K. J.*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACKING NO.	511053070
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NAME	M. Pulido	TRUCK #	P212
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	15:14	WEIGHED BY	Jarend
UNITS	50 LOADS	WEIGHT	1000	UNITS	



Class 1 Material  
Former Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Kracke*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Marbach St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non-Hazardous

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 212

Customer Signature: *Ky*

Non DOT Regulated Non-Hazardous

Date: 10/7/09

Time: 2:12

Carrier Signature: *Kracke*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACKING NO.	511053069
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NAME	M. Pulido	TRUCK #	P944
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/07/2009	TIME	15:08	WEIGHED BY	Jarend
UNITS	49 LOADS	WEIGHT	980	UNITS	



Class 1 Material  
Former Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Fair*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Marbach St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033

Yards: 73

RRC Material

Non DOT Regulated Non-Hazardous

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 944

Customer Signature: *Bry*

Non DOT Regulated Non-Hazardous

Date: 10/7/09

Time: 2:20

Carrier Signature: *Fair*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Invoice No.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053072
Customer Name	USA Environment, LP						
Customer Address	113	Customer Name	M. Pulido	TRUCK NO.	P826		
MATERIAL DESCRIPTION:	Soil - 1						
DATE	10/07/2009	TIME	15:31	WEIGHED BY	jarend		
TOTAL TONS THIS ORDER VALUE				52 LOADS			
				1040 UNITS			

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: *[Signature]*

DELIVER ADDRESS: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Marshall St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RICE Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 8226

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Marshall St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Non DOT Regulated, Non-Hazardous  
Date: 10/7

Time: 2:55  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Invoice No.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053071
Customer Name	USA Environment, LP						
Customer Address	113	Customer Name	M. Pulido	TRUCK NO.	P083		
MATERIAL DESCRIPTION:	Soil - 1						
DATE	10/07/2009	TIME	15:26	WEIGHED BY	jarend		
TOTAL TONS THIS ORDER VALUE				51 LOADS			
				1020 UNITS			

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: *[Signature]*

DELIVER ADDRESS: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Marshall St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 10  
RICE Material  
Non DOT Regulated Non-Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 082

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Marshall St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Non DOT Regulated, Non-Hazardous  
Date: 10/7

Time: 2:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	988500	PO Number	2159-NR-H033	DOB Month		SALES ORDER NO.	02150	TRUCK NO.	511053077
Customer Name	USA Environment, LP								
Carrier Name	M. Pulido	Truck No.	P007						
Date	10/07/2009	Time	15:59	Weighted by	Jsend				
Material Description	Soil - 1					Yards for this operation	54 Loads		1080 UNITS

DELIVERY ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *M. Pulido*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Use

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
Kaiser Charles Kierstead, Corner of Bennett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to T320T Spec Item #317, #376, #3157, #400 and/or other appropriate specification.

Truck #: 007  
Customer Signature: *[Signature]*

Time: 3:23  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	988500	PO Number	2159-NR-H033	DOB Month		SALES ORDER NO.	02150	TRUCK NO.	511053073
Customer Name	USA Environment, LP								
Carrier Name	M. Pulido	Truck No.	P777						
Date	10/07/2009	Time	15:45	Weighted by	Jsend				
Material Description	Soil - 1					Yards for this operation	53 Loads		1050 UNITS

DELIVERY ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Use

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
Kaiser Charles Kierstead, Corner of Bennett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to T320T Spec Item #317, #376, #3157, #400 and/or other appropriate specification.

Truck #: 777  
Customer Signature: *[Signature]*

Time: 3:00  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053079
Customer Name	USA Environment, LP						
Material Description	113	M. Puidlo	P322	DATE	10/07/2009	TIME	16:06
MATERIAL DISPOSITION				Weighted by	Jrand		
Soil - 1				TOTALS FOR THIS DISPOSITION	56 Loads	1120 UNITS	

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:  Class 1 Material Forster Cactus Bldg, Houston TX  
SIGNATURE: \_\_\_\_\_

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cribbed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bldg, Corner of Donnet St. and Market St.  
Houston, TX

Process to 72007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.  
Material Description: Gravel and Soil  
Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 3:30  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053079
Customer Name	USA Environment, LP						
Material Description	113	M. Puidlo	P375	DATE	10/07/2009	TIME	16:04
MATERIAL DISPOSITION				Weighted by	Jrand		
Soil - 1				TOTALS FOR THIS DISPOSITION	55 Loads	1100 UNITS	

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:  Class 1 Material Forster Cactus Bldg, Houston TX  
SIGNATURE: \_\_\_\_\_

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cribbed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bldg, Corner of Donnet St. and Market St.  
Houston, TX

Process to 72007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.  
Material Description: Gravel and Soil  
Non DOT Regulated, Non-Hazardous  
Date: 10/7  
Time: 3:35  
Carrier Signature: \_\_\_\_\_



**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	PO Number	PO Date	SALES ORDER NO.	TRUCK NO.
888500	2159-NR-H033		02150	S11053085
CUSTOMER NAME USA Environment, LP				
QUANTITY	QUANTITY	UNIT	WEIGHTED BY	UNIT
113	M. Pulido		20	Yard
DATE 10/07/2009 16:29				
DRIVER jarend				
MATERIAL DESCRIPTION Soil - 1				
TOTAL FOR THIS ORDER TODAY 60 TONS 1200 UNITS				

Class 1 Material  
Former Cactus Pipeline, Houston TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

CARRIER: *Jawid*

SIGNATURE: *Jawid*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Center of Domestic St. and Market Sts.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Customer Use  
PO Number 2159-NR-H033  
Yards 20

RRC Material  
Non DOT Regulated Non Hazardous

89

Material Description: Gravel and Soil  
Process to 1250T Spec Item 0247, 0276, 03157, 0400 and/or other appropriate specifications

Truck #: *9444*

Time: *4:00*

Carrier Signature: *Jawid*

Non DOT Regulated, Non-Hazardous  
Date: *10/7/09*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Concrete vessels materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	PO Number	PO Date	SALES ORDER NO.	TRUCK NO.
888500	2159-NR-H033		02150	S11053084
CUSTOMER NAME USA Environment, LP				
QUANTITY	QUANTITY	UNIT	WEIGHTED BY	UNIT
113	M. Pulido		20	Yard
DATE 10/07/2009 16:27				
DRIVER jarend				
MATERIAL DESCRIPTION Soil - 1				
TOTAL FOR THIS ORDER TODAY 59 TONS 1180 UNITS				

Class 1 Material  
Former Cactus Pipeline, Houston TX

RECEIVED BY: 

SIGNATURE: \_\_\_\_\_

CARRIER: *PDavis*

SIGNATURE: *PDavis*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Center of Domestic St. and Market Sts.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Customer Use  
PO Number 2159-NR-H033  
Yards 20

RRC Material  
Non DOT Regulated Non Hazardous

83

Material Description: Gravel and Soil  
Process to 1250T Spec Item 0247, 0276, 03157, 0400 and/or other appropriate specifications

Truck #: *001*

Time: *3:50*

Carrier Signature: *PDavis*

Non DOT Regulated, Non-Hazardous  
Date: *10/7/09*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Concrete vessels materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0484

Customer No.	888300	PO Number	2159-NR-H033	Invoice No.	511053099
Customer Name	USA Environment, LP				
Material Description	Soil - 1				
Quantity	2	Units	LOADS	40	UNITS



Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: *Soliman*  
CARRIER SIGNATURE: *Soliman*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: \_\_\_\_\_

RRC Material  
Non DOT Registered Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Edward, Celia Riverard, Corner of Donnell St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specifications.

Truck #: 73  
Customer Signature: *Sam*

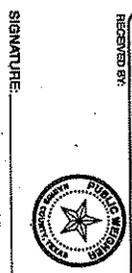
Carrier Signature: *[Signature]*  
Date: 7/20  
Time: 7:20

Non DOT Registered Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888300	PO Number	2159-NR-H033	Invoice No.	511053098
Customer Name	USA Environment, LP				
Material Description	Soil - 1				
Quantity	1	Units	LOADS	20	UNITS



Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY: *[Signature]*  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Registered Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Edward, Celia Riverard, Corner of Donnell St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specifications.

Truck #: 375  
Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*  
Date: 7/15  
Time: 7:15

Non DOT Registered Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	JOB NUMBER		SALES ORDER NO.	02150	TICKET NO.	511053101
CUSTOMER NAME	USA Environment, LP						
ORDER NUMBER	113	PALETTE NAME	M. Pulido	TRACK NO.	PC12		
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/08/2009	TIME	0813	WEIGHED BY	Jbend	UNITS	Yard
TOTALS FOR THIS ORDER/TOTAL				4	LOADS	80	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pinyard, Houston TX**



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: *A. Moore*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to split transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: **USA Environment**  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pinyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: **Gravel and Soil**  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 212  
Customer Signature: *Romy*

**Customer Use**

PO Number: **2159-NR-H033**  
Yards: 2-U  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier/customer shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains responsible for proper use of materials and for any non-hazardous regulations, and any other applicable laws and regulations.

Date: \_\_\_\_\_  
Time: 7:35  
Carrier Signature: *Francisco*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	JOB NUMBER		SALES ORDER NO.	02150	TICKET NO.	511053100
CUSTOMER NAME	USA Environment, LP						
ORDER NUMBER	113	PALETTE NAME	M. Pulido	TRACK NO.	PD001		
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/08/2009	TIME	0810	WEIGHED BY	Jbend	UNITS	Yard
TOTALS FOR THIS ORDER/TOTAL				3	LOADS	50	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pinyard, Houston TX**



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: *Francisco*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: **USA Environment**  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pinyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: **Gravel and Soil**  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 001  
Customer Signature: *Romy*

**Customer Use**

PO Number: **2159-NR-H033**  
Yards: 2-U  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier/customer shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains responsible for proper use of materials and for any non-hazardous regulations, and any other applicable laws and regulations.

Date: \_\_\_\_\_  
Time: 7:30  
Carrier Signature: *Francisco*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-4033	SALES ORDER NO.	02150	TITLE NO.	S11053104
CUSTOMER NAME	USA Environment, LP	DATE	10/08/2009 08:24	WEIGHTED BY	jeand
MATERIAL DESCRIPTION	Soil - 1	UNITS	Yard	UNITS	120
RECEIVED BY:	M. Pulido	UNITS	5	UNITS	120

RECEIVED BY: **Class 1 Material**  
Former Cactus Bipyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-4033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Berrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 7200T Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 994

Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8/09  
Time: 7:45  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-4033	SALES ORDER NO.	02150	TITLE NO.	S11053103
CUSTOMER NAME	USA Environment, LP	DATE	10/08/2009 08:23	WEIGHTED BY	jeand
MATERIAL DESCRIPTION	Soil - 1	UNITS	Yard	UNITS	100
RECEIVED BY:	M. Pulido	UNITS	5	UNITS	100

RECEIVED BY: **Class 1 Material**  
Former Cactus Bipyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-4033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Berrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 7200T Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 322

Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8/09  
Time: 7:45  
Carrier Signature: *[Signature]*

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053107
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	YARD
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	WEIGHTED BY	Jmend		
UNIT	B LOADS		150 UNITS		

CLASS 1 Material  
Forster Cactus Pipeyard, Houston  
TX

RECEIVED BY:   
CARRIER SIGNATURE: *EYoria*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

(93)

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 7500T Spec Item #317, #276, #3157, #400 and/or other appropriate specifications

Truck #: 19  
Customer Signature: *R. Bon*

Non DOT Regulated, Non-Hazardous

Date: 10/11/09  
Time: 7:50  
Carrier Signature: *[Signature]*

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053106
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	YARD
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	WEIGHTED BY	Jmend		
UNIT	7 LOADS		140 UNITS		

CLASS 1 Material  
Forster Cactus Pipeyard, Houston  
TX

RECEIVED BY:   
CARRIER SIGNATURE: *Beltov*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

(92)

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 7500T Spec Item #317, #276, #3157, #400 and/or other appropriate specifications

Truck #: 007  
Customer Signature: *R. Bon*

Non DOT Regulated, Non-Hazardous

Date: 10/18/09  
Time: 7:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888590	PO Number	2159-NR-H033	Ship Date	02150	Ship To	511053109
Sales Order No.	02150	Customer Name	USA Environment, LP	Origin	20	Unit	Yard
Material Description	Soil - 1	Weight	10/08/2009 08:46	Weighted By	jsand		
		TOTAL FROM THE CROWN TOWER					
		10 LOADS				200	UNITS

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:   
SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404


CUSTOMER COPY  
MATERIAL CODES

Customer No.	888590	PO Number	2159-NR-H033	Ship Date	02150	Ship To	511053109
Sales Order No.	02150	Customer Name	USA Environment, LP	Origin	20	Unit	Yard
Material Description	Soil - 1	Weight	10/08/2009 08:46	Weighted By	jsand		
		TOTAL FROM THE CROWN TOWER					
		9 LOADS				150	UNITS

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:   
SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888590  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 250T Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 826  
Customer Signature: 

**Customer Use**

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous

Date:   
Time:   
Carrier Signature: 

**Bill of Lading**



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888590  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 250T Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 340  
Customer Signature: 

**Customer Use**

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous

Date:   
Time:   
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CONTRACT NO.	2159-NR-H033	PO NUMBER	02150	INVOICE NO.	511053114
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	113	BUYER NAME	M. Pulido	TRUCK NO.	P375
MATERIAL DESCRIPTION	S011 - 1				
DATE	10/09/2009	TIME	09:14	WEIGHED BY	Jmand
TOTAL SCALES ORDER TODAY	12	LODS	240	UNITS	



RECEIVED BY: Class 1 Material Former Cactus Pileyard, Houston TX  
SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 67887, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Marjorie St., Houston, TX

Customer No. 888300  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

96

Material Description: Gravel and Soil  
Process to TADOT Spec Item 6217, 6276, 63157, 6400 and/or other appropriate specifications.

Truck #: # 375  
Customer Signature: [Signature]

Center Signature: [Signature]  
Date: 8/20  
Time: 10:15

Non DOT Regulated Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CONTRACT NO.	2159-NR-H033	PO NUMBER	02150	INVOICE NO.	511053114
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	113	BUYER NAME	M. Pulido	TRUCK NO.	P777
MATERIAL DESCRIPTION	S011 - 1				
DATE	10/09/2009	TIME	08:52	WEIGHED BY	Jmand
TOTAL SCALES ORDER TODAY	11	LODS	220	UNITS	



RECEIVED BY: Class 1 Material Former Cactus Pileyard, Houston TX  
SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 67887, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Marjorie St., Houston, TX

Customer No. 888300  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

95

Material Description: Gravel and Soil  
Process to TADOT Spec Item 6217, 6276, 63157, 6400 and/or other appropriate specifications.

Truck #: 777  
Customer Signature: [Signature]

Center Signature: [Signature]  
Date: 8/20  
Time: 10:15

Non DOT Regulated Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Check No.	02150	Check No.	511053123
Customer Name	USA Environment, LP			Carrier	M. Pulido	Weight	20
Material Description	Soil - 1			Unit	Yard	j send	
Received By	Class 1 Material Former Cactus Pipeyard, Houston TX			Carrier	M. Pulido	Weight	20
Signature	[Signature]			Unit	Yard	j send	



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
H0308-1X

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 212  
Carrier Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/8

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Check No.	02150	Check No.	511053120
Customer Name	USA Environment, LP			Carrier	M. Pulido	Weight	20
Material Description	Soil - 1			Unit	Yard	j send	
Received By	Class 1 Material Former Cactus Pipeyard, Houston TX			Carrier	M. Pulido	Weight	20
Signature	[Signature]			Unit	Yard	j send	



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
H0308-1X

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 001  
Carrier Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/8

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

PROPOSED NO.	2159-NR-H033	JOB NUMBER		SALES ORDER NO.	02159	TRUCK NO.	S11053127
CUSTOMER NAME	USA Environment, LP						
QUANTITY	113	UNIT	M. Paildo	WEIGHT	20	UNITS	Yard
MATERIAL DESCRIPTION	Soil - 1			DATE	10/08/2009	WEIGHTED BY	Jwend
				NON DOT REGISTERED ORDER TOTAL			
				15 LOADS			320 UNITS

DELIVERED ADDRESS:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:  
Jwend

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Jwend*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

PROPOSED NO.	2159-NR-H033	JOB NUMBER		SALES ORDER NO.	02159	TRUCK NO.	S11053126
CUSTOMER NAME	USA Environment, LP						
QUANTITY	113	UNIT	M. Paildo	WEIGHT	20	UNITS	Yard
MATERIAL DESCRIPTION	Soil - 1			DATE	10/08/2009	WEIGHTED BY	Jwend
				NON DOT REGISTERED ORDER TOTAL			
				15 LOADS			300 UNITS

DELIVERED ADDRESS:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX

RECEIVED BY:  
Jwend

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Jwend*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Registered Non Hazardous

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 999

Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 9:05

Date: 10/08/2009

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier's responsibility is limited to the material as presented and is not a regulated hazardous waste.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Registered Non Hazardous

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 83

Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 9:00

Date: 10/08/2009

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier's responsibility is limited to the material as presented and is not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/09
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P007	Weight	20	Units	Yard
Material Description	Soil - 1						
Weight	18 Loads	Volume	350	Units			



Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: *Archie*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 007  
Time: \_\_\_\_\_  
Customer Signature: *Bony*

Non DOT Regulated Non Hazardous  
Date: \_\_\_\_\_  
Time: 9:20  
Carrier Signature: *Archie*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/09
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P322	Weight	20	Units	Yard
Material Description	Soil - 1						
Weight	17 Loads	Volume	340	Units			



Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 322  
Time: \_\_\_\_\_  
Customer Signature: *Bony*

Non DOT Regulated Non Hazardous  
Date: \_\_\_\_\_  
Time: 9:15  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRACKING NO.	511053138
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	ORDER NAME	TRUCK NO.	WEIGHT IN	WEIGHT OUT	YARD
113	M. Pulido	P826	20		
MATERIAL DESCRIPTION:			TOTALS FOR THIS ORDER/LOAD		
Soil - 1			20 LOADS		400 UNITS

DELIVER ADDRESS:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**

RECEIVED BY:  
*[Signature]*

SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Daret St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specifications.

Truck #: 826  
Customer Signature: *[Signature]*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: *[Signature]*  
Time: *[Signature]*  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRACKING NO.	511053137
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	ORDER NAME	TRUCK NO.	WEIGHT IN	WEIGHT OUT	YARD
113	M. Pulido	P019	20		
MATERIAL DESCRIPTION:			TOTALS FOR THIS ORDER/LOAD		
Soil - 1			19 LOADS		380 UNITS

DELIVER ADDRESS:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**

RECEIVED BY:  
*[Signature]*

SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Transport for: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Daret St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specifications.

Truck #: 19  
Customer Signature: *[Signature]*

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: *[Signature]*  
Time: *[Signature]*  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Bill To		Ship To	
Sales Order No.	02150	Customer Name	USA Environment, LP	Address		City	
Material Description	113 M. Pulido	Truck No.	P777	Quantity	20	Unit	Yard
Material Description	Soil - 1	Carrier	Jesard	Quantity	22	Unit	LOADS
					440		UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**

DELIVERY ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston**

TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Steve Cooper*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment, P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

2106

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 777

Customer Signature: *Born*

Center Signature: *Steve Cooper*

Time: 9:15

Non DOT Regulated, Non-Hazardous  
Date: 1/18

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cactus Pipeyard and/or HPP. The carrier shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Bill To		Ship To	
Sales Order No.	02150	Customer Name	USA Environment, LP	Address		City	
Material Description	113 M. Pulido	Truck No.	P340	Quantity	20	Unit	Yard
Material Description	Soil - 1	Carrier	Jesard	Quantity	21	Unit	LOADS
					420		UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**

DELIVERY ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston**

TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. S. W.*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment, P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

2105

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 340

Customer Signature: *Born*

Center Signature: *Steve Cooper*

Time: 9:15

Non DOT Regulated, Non-Hazardous  
Date: 1/18

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cactus Pipeyard and/or HPP. The carrier shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

MATERIAL CODES

Customer No.	2159-NR-H033	Order No.	02150	Invoice No.	511053147
Customer Name:	USA Environment, LP				
Material Description:	113	M. Pulpido	P212	Weighted by:	Yard
DATE	10/08/2009	10:39	Time	10:39	Unit
TOTAL FROM THIS ORDER ONLY			24	LOADS	480
				UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Ramos*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Eugene C. Chapa, District Manager, Center of District St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 2112  
Customer Signature: *Ry*

**Bill of Lading**

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

7109

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete Recycle HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Concrete recycles materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8

Time: 10:30  
Center Signature: *Ramos*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

CUSTOMER COPY MATERIAL CODES

Customer No.	2159-NR-H033	Order No.	02150	Invoice No.	511053143
Customer Name:	USA Environment, LP				
Material Description:	113	M. Pulpido	P375	Weighted by:	Yard
DATE	10/08/2009	10:24	Time	10:24	Unit
TOTAL FROM THIS ORDER ONLY			23	LOADS	460
				UNITS	


RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Jess*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.



**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Eugene C. Chapa, District Manager, Center of District St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 375  
Customer Signature: *Ry*

**Bill of Lading**

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

7107

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete Recycle HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Concrete recycles materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8

Time: 9:55  
Center Signature: *Jess*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SHIP ORDER NO.	02150	INVT. NO.	511053149
CUSTOMER NAME	USA Environment, LP				
SHIP TO	NAME	STREET	CITY	STATE	ZIP
			20	TX	77034
DATE	10/08/2009	TIME	10:46	DRIVER	J Mend
MATERIAL DESCRIPTION	Soil - 1				
	25 TONS				520 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Spive*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

Customer Name: **USA Environment**  
P.O. Box 87987, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Deerpark St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: **L110**

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: *941*

Customer Signature: *[Signature]*

Time: *10:15*

Center Signature: *[Signature]*

Date: *10/8/09*

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Houston Cactus Pipeyard (HPP). The carrier shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SHIP ORDER NO.	02150	INVT. NO.	511053148
CUSTOMER NAME	USA Environment, LP				
SHIP TO	NAME	STREET	CITY	STATE	ZIP
			20	TX	77034
DATE	10/08/2009	TIME	10:44	DRIVER	J Mend
MATERIAL DESCRIPTION	Soil - 1				
	25 TONS				500 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Perez*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

Customer Name: **USA Environment**  
P.O. Box 87987, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Deerpark St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: **L108**

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: *001*

Customer Signature: *[Signature]*

Time: *9:50*

Center Signature: *[Signature]*

Date: *10/8/09*

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Houston Cactus Pipeyard (HPP). The carrier shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACKING NO.	511053150
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	M. Pulido	TRUCK NO.	P322	DATE	10/08/2009 11:08
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	20	WEIGHTED BY	jsend	UNITS	29 LBS
WEIGHTED PER THIS ORDER	560	UNITS			

RECEIVED BY: **Class 1 Material Forster Cactus Bipyard, Houston TX**

Signature:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE:

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Carrier:   
Time: 10:20

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specification.

Truck #: 822  
Customer Signature:

Non DOT Regulated Non Hazardous  
Date: 10/8/09

Carrier Signature:

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACKING NO.	511053150
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	M. Pulido	TRUCK NO.	P083	DATE	10/08/2009 10:51
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	27	WEIGHTED BY	jsend	UNITS	540
WEIGHTED PER THIS ORDER	540	UNITS			

RECEIVED BY: **Class 1 Material Forster Cactus Bipyard, Houston TX**

Signature:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE:

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Carrier:   
Time: 10:15

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specification.

Truck #: 83  
Customer Signature:

Non DOT Regulated Non Hazardous  
Date: 10/8/09

Carrier Signature:

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	ORDER NO.	511053163
CUSTOMER NAME	USA Environment, LP				
QUANTITY	113	UNIT NAME	M. PULIDO	TRUCK NO.	P826
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	TIME	11:21	WEIGHED BY	JSEND
SCALE	30 LBS	WEIGHT	600	UNITS	YARD

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated/Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Genoa Pipeyard, Corner of Danzell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75207 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 826  
Customer Signature: 

Time: 9:45  
Carrier Signature: 


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	ORDER NO.	511053159
CUSTOMER NAME	USA Environment, LP				
QUANTITY	113	UNIT NAME	M. PULIDO	TRUCK NO.	P007
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	TIME	11:11	WEIGHED BY	JSEND
SCALE	29 LBS	WEIGHT	580	UNITS	YARD

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 


**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated/Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Genoa Pipeyard, Corner of Danzell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75207 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 007  
Customer Signature: 

Time: 10:30  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work


0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	SHIP DATE	02150	TRACKING NO.	511053167
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NAME	M. Pulido	ORDER NO.	p019
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	TIME	11:31	ORDERED BY	jwend
TOTAL FEET/TONS ORDERED TODAY	32 Loads		640 UNITS		

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Track #: 19

Time: 10/15/09

Carrier Signature: 

Date: 10/15/09

Non DOT Regulated, Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generators warrant materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work


0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	SHIP DATE	02150	TRACKING NO.	511053165
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NAME	M. Pulido	ORDER NO.	p340
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	11:30	ORDERED BY	jwend
TOTAL FEET/TONS ORDERED TODAY	31 Loads		620 UNITS		

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Track #: 340

Time: 10/15/09

Carrier Signature: 

Date: 10/15/09

Non DOT Regulated, Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generators warrant materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	JOB NUMBER	02150	TRUCK NO.	511053178
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009 11:47	WEIGHED BY	jaend	SCALE	Yard
WEIGHT	34.0008	TOTALS FOR THIS ORDER TODAY	680	UNITS	

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Bipyerd, Houston TX

RECEIVED BY:   
SIGNATURE: *Jesse Road*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
L118  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyerd, Corner of Donnell St. and Marbler St.  
Houston, TX  
Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications  
Truck #: 375  
Customer Signature: *RM*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crustal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.  
Non DOT Regulated, Non Hazardous  
Date: 11/10  
Time: 11:10  
Carrier Signature: *Jesse Road*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	JOB NUMBER	02150	TRUCK NO.	511053170
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009 11:39	WEIGHED BY	jaend	SCALE	Yard
WEIGHT	33.0008	TOTALS FOR THIS ORDER TODAY	660	UNITS	

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Bipyerd, Houston TX

RECEIVED BY:   
SIGNATURE: *Flora Cooper*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
L117  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bipyerd, Corner of Donnell St. and Marbler St.  
Houston, TX  
Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications  
Truck #: 777  
Customer Signature: *RM*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crustal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.  
Non DOT Regulated, Non Hazardous  
Date: 11:00  
Time: 11:00  
Carrier Signature: *Flora Cooper*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES

0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	SHIP NO.	02150	SALES ORDER NO.	511053175
CUSTOMER NAME	USA Environment, LP						
SHIP NO.	113	DATE RECEIVED	M. Pulido	TRUCK NO.	9944	UNITS	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE RECEIVED	10/08/2009	TIME RECEIVED	11:59	UNITS	36 Loads	UNITS	720

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

SIGNATURE: *[Signature]*

**Bill of Lading**

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Under: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 11/25  
Time: 11:25  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES

0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	SHIP NO.	02150	SALES ORDER NO.	511053174
CUSTOMER NAME	USA Environment, LP						
SHIP NO.	113	DATE RECEIVED	M. Pulido	TRUCK NO.	9912	UNITS	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE RECEIVED	10/08/2009	TIME RECEIVED	11:54	UNITS	35 Loads	UNITS	700

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

SIGNATURE: *[Signature]*

**Bill of Lading**

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Under: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 11/20  
Time: 11:20  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	PO NUMBER	02150	TRUCK NO.	511053178
CUSTOMER NAME	USA Environment, LP				
HAZARDOUS NUMBER	113	HAZARDOUS NAME	M. Pulido	TRUCK NO.	P083
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/06/2009	TIME	12:16	WEIGHED BY	Jarend
TONS (SEE THIS CHECKBOX)	38	LOADS	750	UNITS	

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornish St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Essential  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 10/8  
Time: 11:30  
Carrier: [Signature]  
Customer: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	PO NUMBER	02150	TRUCK NO.	511053176
CUSTOMER NAME	USA Environment, LP				
HAZARDOUS NUMBER	113	HAZARDOUS NAME	M. Pulido	TRUCK NO.	P001
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/06/2009	TIME	12:03	WEIGHED BY	Jarend
TONS (SEE THIS CHECKBOX)	37	LOADS	740	UNITS	

DELIVER ADDRESS  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornish St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non-Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 10/8  
Time: 11:30  
Carrier: [Signature]  
Customer: [Signature]

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

0404

CUSTOMER COPY  
 MATERIAL CODES

Customer No.	888500	PO Number	2159-NR-H033	Bill of Lading No.	02150	Trailer No.	511053185
Sales Order No.	02150	Customer Name	USA Environment, LP	Carrier		Weight	20
Customer Name	USA Environment, LP	Address	2070 Genoa Red Bluff Houston, TX 77034	City	Houston	Units	Yard
Material Description	Soil - 1	Date	10/08/2009	Time	12:31	Carrier	J&B
Class 1 Material Former Cactus Pileyard, Houston		Truck No.	P007	Weight	40 Loads	Units	800

RECEIVED BY: **Class 1 Material Former Cactus Pileyard, Houston**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pileyard, Corner of Dorsett St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
 Date: 10/8  
 Time: 11:35  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

0404

CUSTOMER COPY  
 MATERIAL CODES

Customer No.	888500	PO Number	2159-NR-H033	Bill of Lading No.	02150	Trailer No.	511053181
Sales Order No.	02150	Customer Name	USA Environment, LP	Carrier		Weight	20
Customer Name	USA Environment, LP	Address	2070 Genoa Red Bluff Houston, TX 77034	City	Houston	Units	Yard
Material Description	Soil - 1	Date	10/08/2009	Time	12:25	Carrier	J&B
Class 1 Material Former Cactus Pileyard, Houston		Truck No.	P322	Weight	39 Loads	Units	780

RECEIVED BY: **Class 1 Material Former Cactus Pileyard, Houston**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pileyard, Corner of Dorsett St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
 Date: 10/8  
 Time: 11:35  
 Carrier Signature: *[Signature]*

122  
 84  
 10

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Box No.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053188
Sales Order No.	02150	Customer Name	USA Environment, LP	DATE	10/08/2009 12:41	WEIGHT	20
Customer Name	USA Environment, LP	Carrier	M. Pulido	UNIT	Yard	WEIGHT	jaend
Material Description	Soil - 1	Carrier Signature	M. Pulido	TOTAL FROM THIS ORDER TODAY	4.2 LOADS	UNITS	840

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipelineyard, Houston, TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

**Bill of Lading**

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipelineyard, Corner of Donsett St. and Marquet St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 340  
Carrier Signature: *Bon*

Customer Signature: *Bon*

Customer Use: PO Number 2159-NR-H033  
Yards 2.0  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/8/09  
Time: 12:41  
Carrier Signature: *M. Pulido*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Box No.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053187
Sales Order No.	02150	Customer Name	USA Environment, LP	DATE	10/08/2009 12:39	WEIGHT	20
Customer Name	USA Environment, LP	Carrier	M. Pulido	UNIT	Yard	WEIGHT	jaend
Material Description	Soil - 1	Carrier Signature	M. Pulido	TOTAL FROM THIS ORDER TODAY	4.1 LOADS	UNITS	820

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipelineyard, Houston, TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

**Bill of Lading**

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipelineyard, Corner of Donsett St. and Marquet St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 820  
Carrier Signature: *Bon*

Customer Signature: *Bon*

Customer Use: PO Number 2159-NR-H033  
Yards  
RRC Material  
Non DOT Regulated, Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/8/09  
Time: 12:39  
Carrier Signature: *M. Pulido*

12V  
30  
40

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	2159-NR-H033	02150	511053190
Sales Order No.	02150			
Customer Name:	USA Environment, LP			
Material Description:	113	M. Pulido	P777	
Class 1 Material	Former Cactus Pipeyard, Houston TX			
Carrier	M. Pulido			
Date	10/08/2009 12:52			
Weight	44 tons			
Volume	880 units			

Signature: *[Signature]*

Carrier Signature: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



Bill of Lading

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: \_\_\_\_\_  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 (L128)

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 32007 Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications  
 Truck #: 777  
 Customer Signature: *[Signature]*

Non DOT Regulated Non Hazardous  
 Date: 10/8/09  
 Time: 12:20  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	2159-NR-H033	02150	511053189
Sales Order No.	02150			
Customer Name:	USA Environment, LP			
Material Description:	113	M. Pulido	P019	
Class 1 Material	Former Cactus Pipeyard, Houston TX			
Carrier	M. Pulido			
Date	10/08/2009 12:47			
Weight	4.3 tons			
Volume	860 units			

Signature: *[Signature]*

Carrier Signature: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



Bill of Lading

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 (L122)

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 32007 Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications  
 Truck #: 19  
 Customer Signature: *[Signature]*

Non DOT Regulated Non Hazardous  
 Date: 10/8/09  
 Time: 12:20  
 Carrier Signature: *[Signature]*

126  
 89

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

04404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888500	Invoice No.	2159-NR-H033	Invoice Date	02150	Invoice No.	511053195	
Customer Name	USA Environment, LP							
Material Description	113	M. Pulldo	P198	DATE	10/08/2009	TIME	13:10	
MATERIAL DESCRIPTION: Soil - 1				TOTAL NET WT. THIS ORDER (LBS)				920
				UNITS				46 Loads

RECEIVED BY:  
**CLASS 1 Material  
Former Cactus Pipeyard, Houston**



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *MEM*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 2500T Spec Item #247, #276, #3157, #400 under other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier reserves materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8

Truck #: 148  
Time: 12:30  
Carrier Signature: *M.G. Lyons*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

04404

CUSTOMER COPY  
MATERIAL CODES

Customer No.	888500	Invoice No.	2159-NR-H033	Invoice Date	02150	Invoice No.	511053195	
Customer Name	USA Environment, LP							
Material Description	113	M. Pulldo	P370	DATE	10/08/2009	TIME	13:10	
MATERIAL DESCRIPTION: Soil - 1				TOTAL NET WT. THIS ORDER (LBS)				920
				UNITS				46 Loads

RECEIVED BY:  
**CLASS 1 Material  
Former Cactus Pipeyard, Houston**



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *ROM*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 2500T Spec Item #247, #276, #3157, #400 under other appropriate specification.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier reserves materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/8

Truck #: 375  
Time: 12:30  
Carrier Signature: *Rom*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

PROVIDER NO.	PO NUMBER	QTY NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	511053197
CUSTOMER NAME USA Environment, LP				

QUANTITY	UNIT	TRUCK NO.
113	M. Pailido	P944

MATERIAL DESCRIPTION:  
S011 - 1

DATE	TIME	WEIGHED BY	UNITS
10/08/2009	13:18	Jwend	48 LBS
TOTAL FROM THIS ORDER ONLY			960 UNITS

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: JAMES

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Matlock St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83137, 8400 and/or other appropriate specifications

Truck #: 999  
Customer Signature: Ryan

Customer Use

PO Number: 2159-NR-H033 L132  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants products transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/8  
Time: 12:40  
Center Signature: Louis

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

PROVIDER NO.	PO NUMBER	QTY NUMBER	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033		02150	511053196
CUSTOMER NAME USA Environment, LP				

QUANTITY	UNIT	TRUCK NO.
113	M. Pailido	P212

MATERIAL DESCRIPTION:  
S011 - 1

DATE	TIME	WEIGHED BY	UNITS
10/08/2009	13:11	Jwend	47 LBS
TOTAL FROM THIS ORDER ONLY			940 UNITS

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: R. Arnold

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Matlock St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83137, 8400 and/or other appropriate specifications

Truck #: 812  
Customer Signature: Ryan

Customer Use

PO Number: 2159-NR-H033 L131  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants products transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/8  
Time: 12:35  
Center Signature: R. Arnold

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	NO. LOADS	PO NUMBER	PAID ORDER NO.	TRUCK NO.
888500	2159-NR-H033		02150	511053200
CARRIER NAME: USA Environment, LP				
DATE RECEIVED	QUANTITY	UNITS	WEIGHT	UNITS
113	M. Pulido	P063	20	Yard
MATERIAL DESCRIPTION: Soil - 1				
DATE	TIME	UNLOADED BY		
10/08/2009	13:30	Jwend		
TOTAL TONS FOR THIS ORDER TODAY: 50 LOADS 1000 UNITS				

RECEIVED BY: **Class 1 Mayer's Pipeline, Houston**  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Salinas*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeline, Corner of Danneberg St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: **L134**

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 085  
Customer Signature: *Robyn*

Non DOT Regulated, Not Hazardous  
Date: 10/8  
Time: 1:50  
Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched...  
HPP. The carrier shall save and hold SCC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier and customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Complete instructions are non-negotiable and are not to be repudiated in any way.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	NO. LOADS	PO NUMBER	PAID ORDER NO.	TRUCK NO.
888500	2159-NR-H033		02150	511053199
CARRIER NAME: USA Environment, LP				
DATE RECEIVED	QUANTITY	UNITS	WEIGHT	UNITS
113	M. Pulido	P061	20	Yard
MATERIAL DESCRIPTION: Soil - 1				
DATE	TIME	UNLOADED BY		
10/08/2009	13:20	Jwend		
TOTAL TONS FOR THIS ORDER TODAY: 49 LOADS 980 UNITS				

RECEIVED BY: **Class 1 Mayer's Pipeline, Houston**  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87897, Houston, TX 77287  
Former Cactus Pipeline, Corner of Danneberg St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Customer Use: **L133**

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 001  
Customer Signature: *[Signature]*

Non DOT Regulated, Not Hazardous  
Date: 10/8  
Time: 1:50  
Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched...  
HPP. The carrier shall save and hold SCC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier and customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Complete instructions are non-negotiable and are not to be repudiated in any way.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Job Number	2159-NR-H033	Invoice Number	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			Invoice No.	511053210	Invoice Date	5/11/05
Material Description	113	M. Pulido	P340	Yard	20	Yard	
Material Description	S011 - 1			Weighted by	Jwend	Units	10/08/2009 13:56
Material Description	S011 - 1			Volume for this order	52	Units	1040

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

**Bill of Lading**

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75007 Spec Item 8217, 8276, 8317, 4400 and/or other appropriate specification.

Truck #: 340  
Customer Signature: *Ken*

Time: 1:25  
Center Signature: *M. Pulido*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Job Number	2159-NR-H033	Invoice Number	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			Invoice No.	511053203	Invoice Date	5/11/05
Material Description	113	M. Pulido	P007	Yard	20	Yard	
Material Description	S011 - 1			Weighted by	Jwend	Units	10/08/2009 13:42
Material Description	S011 - 1			Volume for this order	51	Units	1020

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Ken*

**Bill of Lading**

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75007 Spec Item 8217, 8276, 8317, 4400 and/or other appropriate specification.

Truck #: 007  
Customer Signature: *Ken*

Time: 1:05  
Center Signature: *Ken*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053212
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P019	DATE	10/08/2009	TIME	14:00
Material Description	Soil - 1		WEIGHED BY	Jmend		YARD	
			YARDS FROM THE GREEN ROOM	54	LOADS		1080

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston, TX



CARRIER SIGNATURE: *Gyrcia*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Container ID: L138

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/8/09  
Time: 1:30 P  
Carrier Signature: *Allegre*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053211
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P825	DATE	10/08/2009	TIME	13:59
Material Description	Soil - 1		WEIGHED BY	Jmend		YARD	
			YARDS FROM THE GREEN ROOM	53	LOADS		1060

RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston, TX



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Container ID: L136

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/8/09  
Time: 1:30 P  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053215
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	TIME	14:09	WEIGHED BY	Jwend
TOTAL TONNAGE ORDERED	56 Loads				1120 UNITS

DELIVER ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX



SIGNATURE: *Lommo*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Lommo*

**Bill of Lading**  
Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
Customer No. 888500  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number 2159-NR-H033  
Yards 20 L140  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crated Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier's various materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications  
Truck #: 375  
Customer Signature: \_\_\_\_\_

Non DOT Regulated, Non Hazardous  
Date: 10/10  
Time: 1:30  
Carrier Signature: *Jesus Romo*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053214
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	QUANTITY	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/08/2009	TIME	14:02	WEIGHED BY	Jwend
TOTAL TONNAGE ORDERED	55 Loads				1100 UNITS

DELIVER ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *Jesus Romo*

**Bill of Lading**  
Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
Customer No. 888500  
Sales Order No. 02150

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number 2159-NR-H033  
Yards 20 L139  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crated Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier's various materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications  
Truck #: 777  
Customer Signature: \_\_\_\_\_

Non DOT Regulated, Non Hazardous  
Date: 10/10  
Time: 1:35  
Carrier Signature: *Jesus Romo*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053222
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	113	ORDER DATE	10/08/2009	ORDER TIME	14:25
MATERIAL DESCRIPTION:	So11 - 1				
ORDER NUMBER	113	ORDER DATE	10/08/2009	ORDER TIME	14:25
MATERIAL DESCRIPTION:	So11 - 1				

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall leave and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *R. Morales*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Denzot St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
L143

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 8317, 8400 and/or other appropriate specification.

Truck #: 212  
Customer Signature: *[Signature]*

Time: 1:50  
Center Signature: *R. Morales*

Non DOT Regulated Non-Hazardous  
Date: 10/8/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053220
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	113	ORDER DATE	10/08/2009	ORDER TIME	14:17
MATERIAL DESCRIPTION:	So11 - 1				
ORDER NUMBER	113	ORDER DATE	10/08/2009	ORDER TIME	14:17
MATERIAL DESCRIPTION:	So11 - 1				

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall leave and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. P. [Signature]*

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Denzot St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
L141

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 8317, 8400 and/or other appropriate specification.

Truck #: # 198  
Customer Signature: *[Signature]*

Time: 1:40  
Center Signature: *M.G. Suarez*

Non DOT Regulated Non-Hazardous  
Date: 10/8/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDER NO.	02150	TICKET NO.	511053226
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009	TIME	14:37	WEIGHTED BY	Jwend
UNITS	Yard	WEIGHTED BY	Jwend	UNITS	Yard
DATE	10/08/2009	TIME	14:37	WEIGHTED BY	Jwend
UNITS	60 LOADS	WEIGHTED BY	Jwend	UNITS	1200 UNITS

ORDER NO.	2159-NR-H033	DATE ORDER NO.	02150	TICKET NO.	511053226
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009	TIME	14:37	WEIGHTED BY	Jwend
UNITS	Yard	WEIGHTED BY	Jwend	UNITS	Yard
DATE	10/08/2009	TIME	14:37	WEIGHTED BY	Jwend
UNITS	60 LOADS	WEIGHTED BY	Jwend	UNITS	1200 UNITS

DELIVER ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Marquet St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 0247, 0276, 03157, 0400 and/or other appropriate specification.

Truck #: 001  
Customer Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

Non DOT Regulated Non Hazardous  
Date: [Signature]  
Time: [Signature]

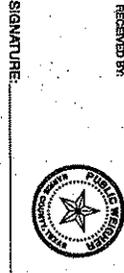
**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDER NO.	02150	TICKET NO.	511053226
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009	TIME	14:32	WEIGHTED BY	Jwend
UNITS	Yard	WEIGHTED BY	Jwend	UNITS	Yard
DATE	10/08/2009	TIME	14:32	WEIGHTED BY	Jwend
UNITS	56 LOADS	WEIGHTED BY	Jwend	UNITS	1180 UNITS

ORDER NO.	2159-NR-H033	DATE ORDER NO.	02150	TICKET NO.	511053226
CUSTOMER NAME	USA Environment, LP				
DATE	10/08/2009	TIME	14:32	WEIGHTED BY	Jwend
UNITS	Yard	WEIGHTED BY	Jwend	UNITS	Yard
DATE	10/08/2009	TIME	14:32	WEIGHTED BY	Jwend
UNITS	56 LOADS	WEIGHTED BY	Jwend	UNITS	1180 UNITS

DELIVER ADDRESS  
Class 1 Material  
Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
CARRIER SIGNATURE: [Signature]

**Bill of Lading**

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Marquet St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to T2DOT Spec Item 0247, 0276, 03157, 0400 and/or other appropriate specification.

Truck #: 944  
Customer Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete and/or HPP. The carrier/customer shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Generators warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: [Signature]  
Time: [Signature]

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

SHIPMENT NO.	PO NUMBER	SHIP NUMBER	DATE SHIPPED	SHIP TO	SHIP FROM
888500	2159-NR-H033	02150	511053233		

CUSTOMER NAME:  
 JSH Environment, LP

QUANTITY	UNIT	WEIGHT	UNITS
113	M. Pail/100	20	YARD

MATERIAL DESCRIPTION:  
 Soil - 1

Class 1 Material  
 Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

DATE	TIME	WEIGHTED BY	UNITS
10/08/2009	15:04	Jwend	
TOTAL WEIGHT (GROSS TONNAGE)			62 LOADS
			1240 UNITS

**Bill of Lading**

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to TSD/OT Spec Item 8317, 8317A, 83157, #400 and/or other appropriate specification.

Truck #: 3110  
 Customer Signature: *[Signature]*

Customer Use

PO Number: 2189-NR-H033

Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all non-hazardous materials, and we are a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
 Date: 10/8  
 Time: 1:25  
 Carrier Signature: *[Signature]*

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

SHIPMENT NO.	PO NUMBER	SHIP NUMBER	DATE SHIPPED	SHIP TO	SHIP FROM
888500	2159-NR-H033	02150	511053231		

CUSTOMER NAME:  
 JSH Environment, LP

QUANTITY	UNIT	WEIGHT	UNITS
113	M. Pail/100	20	YARD

MATERIAL DESCRIPTION:  
 Soil - 1

Class 1 Material  
 Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

DATE	TIME	WEIGHTED BY	UNITS
10/08/2009	14:52	Jwend	
TOTAL WEIGHT (GROSS TONNAGE)			51 LOADS
			1220 UNITS

**Bill of Lading**

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to TSD/OT Spec Item 8317, 8317A, 83157, #400 and/or other appropriate specification.

Truck #: 0074  
 Customer Signature: *[Signature]*

Customer Use

PO Number: 2189-NR-H033

Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all non-hazardous materials, and we are a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
 Date: 10/8  
 Time: 2:10  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

BOOKING NO.	PO NUMBER	DATE ORDERED	ORDER NO.	TRUCK NO.
888500	2159-NR-H033	02150	511053237	
CUSTOMER NAME	USA Environment, LP			
QUANTITY	UNIT	WEIGHT	WEIGHT	WEIGHT
113	M. Pallets	20	Yard	
MATERIAL DESCRIPTION:		Soil - 1		
TOTAL FOR THIS ORDER ONLY:		64 LOADS 1280 UNITS		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *David Cooper*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 73207 Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
7149

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern United Coaches and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Government warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10-8  
Time: 2:45  
Carrier Signature: *David Cooper*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

BOOKING NO.	PO NUMBER	DATE ORDERED	ORDER NO.	TRUCK NO.
888500	2159-NR-H033	02150	511053236	
CUSTOMER NAME	USA Environment, LP			
QUANTITY	UNIT	WEIGHT	WEIGHT	WEIGHT
113	M. Pallets	20	Yard	
MATERIAL DESCRIPTION:		Soil - 1		
TOTAL FOR THIS ORDER ONLY:		53 LOADS 1060 UNITS		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *David Cooper*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 73207 Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
7148

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern United Coaches and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Government warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10-8  
Time: 1:30  
Carrier Signature: *David Cooper*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053246
Customer Name	USA Environment, LP						
Carrier Name	USA Environment	Truck No.	113	Weight	20	Unit	Yard
Material Description	S011 - 1						
Carrier Name	USA Environment	Truck No.	113	Weight	20	Unit	Yard
Material Description	S011 - 1						

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kemper Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

L152

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: #108 P  
Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 2:55  
Date: 10/08/2009

Non DOT Regulated, Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053239
Customer Name	USA Environment, LP						
Carrier Name	USA Environment	Truck No.	113	Weight	20	Unit	Yard
Material Description	S011 - 1						
Carrier Name	USA Environment	Truck No.	113	Weight	20	Unit	Yard
Material Description	S011 - 1						

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kemper Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

L150

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 375  
Customer Signature: *[Signature]*

Carrier Signature: *[Signature]*

Time: 2:50  
Date: 10/08/2009

Non DOT Regulated, Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Truck No.	2159-NR-H033	Scale Order No.	02150	Truck No.	511053248
Customer Name	USA Environment, LP						
Material Description	113	Material Name	M. Pulido	Truck No.	P001	Scale	Yard
Material Description	Soil - 1						
DATE	10/08/2009	TIME	15:45	WEIGHED BY	Jarend	SCALE	Yard
TOTAL WEIGHT FROM THIS ORDER TODAY	68 Loads				1360	UNITS	

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *JAVIER*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Truck #: 001  
Customer Signature: *From*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 11/8  
Time: 3:22  
Carrier Signature: *DD115*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Truck No.	2159-NR-H033	Scale Order No.	02150	Truck No.	511053244
Customer Name	USA Environment, LP						
Material Description	113	Material Name	M. Pulido	Truck No.	P944	Scale	Yard
Material Description	Soil - 1						
DATE	10/08/2009	TIME	15:41	WEIGHED BY	Jarend	SCALE	Yard
TOTAL WEIGHT FROM THIS ORDER TODAY	57 Loads				1340	UNITS	

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *JAVIER*

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Truck #: 944  
Customer Signature: *From*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 11/8  
Time: 3:05  
Carrier Signature: *JAVIER*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Ship to State	TX	Ship to City	Houston	Ship to Zip	77034
Customer Name	USA Environment, LP								
Material Description	113	M. Pulido	P826	Weight	20	Units	Yard		
Material Description	Soil - 1								
TOTAL FOR THIS ORDER TOTAL				Weight	1400	Units	70 Loads		

RECEIVED BY:   
CLASS I MATERIAL  
Former Cactus Pipeyard, Houston, TX

SIGNATURE:   
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L151

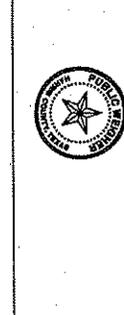
Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains liable for transportation of materials in accordance with applicable laws and regulations.

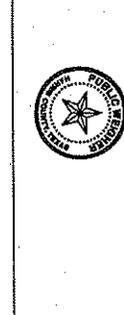
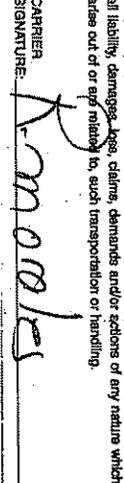
Non DOT Regulated Non-Hazardous  
Date: 10/08/2009  
Time: 2:50  
Center Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Ship to State	TX	Ship to City	Houston	Ship to Zip	77034
Customer Name	USA Environment, LP								
Material Description	113	M. Pulido	P812	Weight	20	Units	Yard		
Material Description	Soil - 1								
TOTAL FOR THIS ORDER TOTAL				Weight	1380	Units	69 Loads		

RECEIVED BY:   
CLASS I MATERIAL  
Former Cactus Pipeyard, Houston, TX

SIGNATURE:   
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

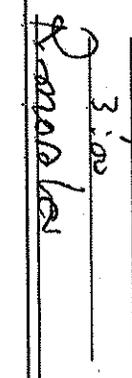
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L153

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains liable for transportation of materials in accordance with applicable laws and regulations.

Non DOT Regulated Non-Hazardous  
Date: 10/08/2009  
Time: 3:00  
Center Signature: 



**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	SALES CODES	02150	TOTAL WT	511053258
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P340				
DATE	10/08/2009	16:20	J&Bend				
TOTALS FOR THIS ORDER ONLY				74	LOADS	4	1480
							UNITS

Class 1 Material  
 Former Cactus Pipeyard, Houston TX

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Misc...*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to TxDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: *A340*

Customer Signature: \_\_\_\_\_

Carrier Signature: *M*

**Customer Use**

PO Number: 2159-NR-H033

Yards: *20*

RRC Material

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous

Date: *10/16*

Time: *3:44*

Carrier Signature: *Misc...*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	SALES CODES	02150	TOTAL WT	511053257
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P007				
DATE	10/08/2009	16:18	J&Bend				
TOTALS FOR THIS ORDER ONLY				73	LOADS	0	1460
							UNITS

Class 1 Material  
 Former Cactus Pipeyard, Houston TX

RECEIVED BY: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *App...*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to TxDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: *A007*

Customer Signature: \_\_\_\_\_

Carrier Signature: *P*

**Customer Use**

PO Number: 2159-NR-H033

Yards: *20*

RRC Material

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous

Date: *10/16*

Time: *3:25*

Carrier Signature: *Al...*



**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888508 2159-NR-H033  
Customer Name: USA Environment, LP  
Material Description: Soil - 1  
113 M. Pulido R322

DATE	TIME	WEIGHED BY	UNITS
10/09/2009	08:05	J Bend	20 Yard
TOTAL FOR THIS ORDER TODAY			40 UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888590  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dezeret St. and Market St.  
HOUSTON, TX

Material Description: Gravel and Soil  
Process to 7500T Spec from 8247, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 222  
Customer Signature: *[Signature]*

**Bill of Lading**

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L162

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier reserves the right to transport any non-hazardous recyclables, and any not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9  
Time: 7:05  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888508 2159-NR-H033  
Customer Name: USA Environment, LP  
Material Description: Soil - 1  
113 M. Pulido P001

DATE	TIME	WEIGHED BY	UNITS
10/09/2009	07:57	J Bend	20 Yard
TOTAL FOR THIS ORDER TODAY			20 UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888590  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dezeret St. and Market St.  
HOUSTON, TX

Material Description: Gravel and Soil  
Process to 7500T Spec from 8247, 8276, 83157, 8400 under other appropriate specifications.

Truck #: 001  
Customer Signature: *[Signature]*

**Bill of Lading**

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L161

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier reserves the right to transport any non-hazardous recyclables, and any not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9  
Time: 7:00  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053280
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NUMBER	M. Pulido	TRACKING NO.	P375
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	08:12	WEIGHT BY	Jand
UNITS	4	LOADS	80	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *Jesse Romo*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 732007 Spec Item #242, #276, #3137, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated Non Hazardous  
Date: 10/9/09  
Time: 7:20  
Center Signature: *Jesse Romo*

Truck #: 375  
Customer Signature: *Romy*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053277
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER NUMBER	M. Pulido	TRACKING NO.	P198
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	08:08	WEIGHT BY	Jand
UNITS	3	LOADS	50	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *Approved*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 732007 Spec Item #242, #276, #3137, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated Non Hazardous  
Date: 10/9/09  
Time: 7:10  
Center Signature: *M. C. Lewis*

Truck #: 108  
Customer Signature: *Romy*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	Scale Order No.	02150	Ticket No.	511053282
Customer Name	USA Environment	Customer Name	USA Environment, LP	Scale Order No.	02150	Weight	20
Customer Address	P.O. Box 81687, Houston, TX 77287	Customer Address	Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX	Scale Order No.	02150	Unit	Yard
Material Description	Gravel and Soil	Material Description	Gravel and Soil	Scale Order No.	02150	Weight	20
Process to TSDOT Spec Item 8247, 8376, 83157, 8400 and/or other appropriate specifications.		Process to TSDOT Spec Item 8247, 8376, 83157, 8400 and/or other appropriate specifications.		Scale Order No.	02150	Weight	20
Truck #	194	Truck #	194	Scale Order No.	02150	Weight	20
Carrier Signature	<i>[Signature]</i>	Carrier Signature	<i>[Signature]</i>	Scale Order No.	02150	Weight	20



Class 1 Material  
 Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Customer No. 888500  
 Sales Order No. 02150

Truck #: 194  
 Carrier Signature: *[Signature]*

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
 Date: 10/9/09  
 Time: 7:30  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	Scale Order No.	02150	Ticket No.	511053281
Customer Name	USA Environment	Customer Name	USA Environment, LP	Scale Order No.	02150	Weight	20
Customer Address	P.O. Box 81687, Houston, TX 77287	Customer Address	Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX	Scale Order No.	02150	Unit	Yard
Material Description	Gravel and Soil	Material Description	Gravel and Soil	Scale Order No.	02150	Weight	20
Process to TSDOT Spec Item 8247, 8376, 83157, 8400 and/or other appropriate specifications.		Process to TSDOT Spec Item 8247, 8376, 83157, 8400 and/or other appropriate specifications.		Scale Order No.	02150	Weight	20
Truck #	83	Truck #	83	Scale Order No.	02150	Weight	20
Carrier Signature	<i>[Signature]</i>	Carrier Signature	<i>[Signature]</i>	Scale Order No.	02150	Weight	20



Class 1 Material  
 Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Customer No. 888500  
 Sales Order No. 02150

Truck #: 83  
 Carrier Signature: *[Signature]*

Customer Use  
 PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
 Date: 10/9/09  
 Time: 7:25  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hppcycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

INVOICE NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	S11953285
CUSTOMER NAME	USA Environment, LP				
DATE	11/3	TIME	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	08:36	UNIT	jaend
WEIGHT	8	LOADS	150	UNIT	UMTS



Class 1 Material  
 Former Cactus Pipeyard, Houston  
 TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *R. Morley*

Bill of Lading

Customer Name: USA Environment  
 P.O. Box 87887, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Doreget St. and Market St., Houston, TX

Transport for: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

PO Number: 2159-NR-H033

Customer Use  
**L169**

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous in-packaging, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous

Date: 10/9/2009  
 Time: 7:40  
 Carrier Signature: *R. Morley*

Truck #: 212  
 Customer Signature: *18. Yong*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hppcycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

INVOICE NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	S11953283
CUSTOMER NAME	USA Environment, LP				
DATE	11/3	TIME	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	08:33	UNIT	jaend
WEIGHT	7	LOADS	140	UNIT	UMTS



Class 1 Material  
 Former Cactus Pipeyard, Houston  
 TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Javier*

Bill of Lading

Customer Name: USA Environment  
 P.O. Box 87887, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Doreget St. and Market St., Houston, TX

Transport for: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

PO Number: 2159-NR-H033

Customer Use  
**L167**

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous in-packaging, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous


Date: 10/9/2009  
 Time: 7:35  
 Carrier Signature: *Javier*

Truck #: 944  
 Customer Signature: *Ray*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecyclers.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	S11053287
CUSTOMER NAME	USA Environment, LP						
SHIP TO	113	SHIP VALUE	M. Pulido	INVOICE DATE	10/09/2009	WEIGHT BY	Jmend
MATERIAL DESCRIPTION	Soil - 1						
UNITS	10	LOADS	200	YARD	200	UNITS	

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 97687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Market St.  
Houston, TX


Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator reserves materials transported as non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9  
Time: 7:45  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecyclers.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	S11053286
CUSTOMER NAME	USA Environment, LP						
SHIP TO	113	SHIP VALUE	M. Pulido	INVOICE DATE	10/09/2009	WEIGHT BY	Jmend
MATERIAL DESCRIPTION	Soil - 1						
UNITS	9	LOADS	180	YARD	20	UNITS	

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 97687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Market St.  
Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator reserves materials transported as non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9  
Time: 7:20  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work


CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	811053293
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/09/2009	TIME RECEIVED	09:05	WEIGHED BY	Jwend
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	12 LBS	WEIGHT	240	UNITS	UNITS

RECEIVED BY: **Class 1 Material Forsey Cactus Pileyard, Houston TX**

RECEIVED BY: 


NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687 Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Market St. Houston, TX

Material Description: Gravel and Soil  
Process to 750DOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 007  
Customer Signature: 

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L173

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Government permits materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9/09

Time: 8:10  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053290
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/09/2009	TIME RECEIVED	09:00	WEIGHED BY	Jwend
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	11 LBS	WEIGHT	220	UNITS	UNITS

RECEIVED BY: **Class 1 Material Forsey Cactus Pileyard, Houston TX**

RECEIVED BY: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687 Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Market St. Houston, TX

Material Description: Gravel and Soil  
Process to 750DOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 715  
Customer Signature: 

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L175

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Government permits materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/9/09

Time: 8:25  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053296
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	113	PALETTES	M. Puidido	TRUCK NO.	P777
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/09/2009	WEIGHED BY	Jmend		
UNITS	14 LOADS	WEIGHT	280	UNITS	280



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall serve and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Diana Cooper*

**Bill of Lading**

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 8/15  
Time: 8:15  
Carrier Signature: *Diana Cooper*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053296
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	113	PALETTES	M. Puidido	TRUCK NO.	P856
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/09/2009	WEIGHED BY	Jmend		
UNITS	13 LOADS	WEIGHT	260	UNITS	260



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall serve and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 8/15  
Time: 8:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

STANDARD LINE	PO#	QUANTITY	UNIT	SALES ORDER NO.	WEIGHT NO.
888500	2159-NR-H033			02150	S11053302
CUSTOMER NAME: USA Environment, LP					
CLASSIFICATION	QUANTITY	WEIGHT	UNIT		
113	M. Pulido	20	Yard		
MATERIAL DESCRIPTION: 5011 - 1					
DATE	TIME	WEIGHTED BY			
10/09/2009	09:28	Jmend			
TOTALS FOR THIS ORDER ONLY			15	LOADS	320
			UNITS		



SIGNATURE:

CARRIER SIGNATURE: *Garcia*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dyerest St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Truck #: 19  
Customer Signature: *Brown*

Bill of Lading

Customer Use  
PO Number: 2159-NR-H033  
Yards: \_\_\_\_\_  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/09/09  
Time: 8:30  
Carrier Signature: *Garcia*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

STANDARD LINE	PO#	QUANTITY	UNIT	SALES ORDER NO.	WEIGHT NO.
888500	2159-NR-H033			02150	S11053301
CUSTOMER NAME: USA Environment, LP					
CLASSIFICATION	QUANTITY	WEIGHT	UNIT		
113	M. Pulido	20	Yard		
MATERIAL DESCRIPTION: 5011 - 1					
DATE	TIME	WEIGHTED BY			
10/09/2009	09:28	Jmend			
TOTALS FOR THIS ORDER ONLY			15	LOADS	300
			UNITS		



SIGNATURE:

CARRIER SIGNATURE: *Duarte*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dyerest St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 8317, 8400 and/or other appropriate specifications.

Truck #: 332  
Customer Signature: *Brown*

Bill of Lading

Customer Use  
PO Number: 2159-NR-H033  
Yards: \_\_\_\_\_  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/09/09  
Time: 8:30  
Carrier Signature: *Garcia*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	ORDER DATE	02150	ORDER NO.	511053305
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/05/2009 09:41	WEIGHTED BY	jsmend		
MATERIAL DESCRIPTION	Soil - 1	TONS FOR THIS ORDER	18.0000	UNITS	350

RECEIVED BY: M. Pulido  
CLASS 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Hill of Liding**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Emerick Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 324

Customer Signature: *[Signature]*

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notice: This certificate is provided in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/11/09  
Time: 8:55

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	ORDER DATE	02150	ORDER NO.	511053304
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/05/2009 09:33	WEIGHTED BY	jsmend		
MATERIAL DESCRIPTION	Soil - 1	TONS FOR THIS ORDER	17.0000	UNITS	340

RECEIVED BY: M. Pulido  
CLASS 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Hill of Liding**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Emerick Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 15 374

Customer Signature: *[Signature]*

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

Notice: This certificate is provided in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/11/09  
Time: 8:50

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRUCK #	511053310
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	UNIT NUMBER	M. Pulido	TRUCK NO.	0001
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	09:54	WEIGHT BY	Jwend
WEIGHT	20	UNITS	Yard		
WEIGHT FROM THE PREVIOUS ORDER	20	LOADS	400	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Perez*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornest St. and Markler St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 6247, 6276, 63157, 6400 and/or other appropriate specification.

Truck #: 001  
Customer Signature: *From*

PO Number: 2159-NR-H033  
Yards: 2D  
RRC Material  
Non DOT Regulated Non Hazardous  
L181

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9/15/09  
Time: 9:15  
Carrier Signature: *M. Pulido*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRUCK #	511053305
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	UNIT NUMBER	M. Pulido	TRUCK NO.	0198
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/09/2009	TIME	09:42	WEIGHT BY	Jwend
WEIGHT	19	UNITS	Yard		
WEIGHT FROM THE PREVIOUS ORDER	19	LOADS	380	UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornest St. and Markler St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 6247, 6276, 63157, 6400 and/or other appropriate specification.

Truck #: 148  
Customer Signature: *From*

PO Number: 2159-NR-H033  
Yards: 2D  
RRC Material  
Non DOT Regulated Non Hazardous  
L179

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9/15/09  
Time: 9:00  
Carrier Signature: *M. Pulido*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
04404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053313
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P083	DATE	10/09/2009	WEIGHTED BY	Jsend
MATERIAL DESCRIPTION				SOIL - 1	UNITS	20	Yard
				TOTAL FROM THIS ORDER ONLY	22	LOADS	440
				UNITS			

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston, TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *SHPAC*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnet St. and Market St.  
HOUSTON, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to 3500T Spec from 8247, 8376, 83157, 8400 and/or other appropriate specification.

Truck #: 83

Customer Signature: *Bony*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9-25  
Time: 9:25  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
04404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053311
Customer Name	USA Environment, LP						
Material Description	113	M. Pulido	P375	DATE	10/09/2009	WEIGHTED BY	Jsend
MATERIAL DESCRIPTION				SOIL - 1	UNITS	21	LOADS
				TOTAL FROM THIS ORDER ONLY	21	LOADS	420
				UNITS			

RECEIVED BY:  **Class 1 Material**  
Former Cactus Pipeyard, Houston, TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnet St. and Market St.  
HOUSTON, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to 3500T Spec from 8247, 8376, 83157, 8400 and/or other appropriate specification.

Truck #: 375

Customer Signature: *Bony*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9-10  
Time: 9:10  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
04-04

INVENTORY NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053319
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	11/3	UNITS	20	WEIGHT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE RECEIVED	10/09/2009	TIME	10:15	WEIGHED BY	Jwend
UNITS	24	LOADS		WEIGHT	480 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *JAVIER*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 944  
Customer Signature: *Benny*

Customer Use: **L184**

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9/30  
Time: 9:30  
Carrier Signature: *Javier Ramirez*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
04-04

INVENTORY NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053317
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	11/3	UNITS	20	WEIGHT	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE RECEIVED	10/09/2009	TIME	10:12	WEIGHED BY	Jwend
UNITS	23	LOADS		WEIGHT	450 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *Red Wine*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 194  
Customer Signature: *Benny*

Customer Use: **L182**

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 9:20  
Time: 9:20  
Carrier Signature: *Red Wine*

**HPP**  
 Sustainability at Work

2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

**HPP**  
 Sustainability at Work

2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES

CUSTOMER COPY  
 MATERIAL CODES

0404

0404

ORDER NO.	2155-NR-H033	PO NUMBER	02150	INVOICE NO.	511053325
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	DATE ORDERED	10/09/2009	QUANTITY	20 Yards
MATERIAL DESCRIPTION	5611 - 1				
WEIGHTED BY	Jwend				
UNITS	26 LBS				

ORDER NO.	2155-NR-H033	PO NUMBER	02150	INVOICE NO.	511053325
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	DATE ORDERED	10/09/2009	QUANTITY	20 Yards
MATERIAL DESCRIPTION	5611 - 1				
WEIGHTED BY	Jwend				
UNITS	25 LBS				

RECEIVED BY:  M. Pulido

RECEIVED BY:  M. Pulido

SIGNATURE: \_\_\_\_\_

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *M. Pulido*

CARRIER SIGNATURE: *M. Pulido*

**Bill of Lading**

**Customer Use**



Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2155-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

7186

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former: Cactus Placenta, Center of Donest St. and Market St., Houston, TX

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former: Cactus Placenta, Center of Donest St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T32007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Material Description: Gravel and Soil  
 Process to T32007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 2112  
 Customer Signature: *Bron*

Truck #: 2112  
 Customer Signature: *Marcelo Vallores*

**Bill of Lading**

**Customer Use**



Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2155-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

7185

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former: Cactus Placenta, Center of Donest St. and Market St., Houston, TX

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former: Cactus Placenta, Center of Donest St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T32007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Material Description: Gravel and Soil  
 Process to T32007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 2112  
 Customer Signature: *Bron*

Truck #: 2112  
 Customer Signature: *K. Morales*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053329
CUSTOMER NAME	USA Environment, LP				
DATE	10/09/2009	TIME	10:43	WEIGHTED BY	Jaend
TRUCK #	113	DRIVER NAME	M. Pulido	TRUCK NO.	P713
MATERIAL DESCRIPTION	Soil - 1				
TOTAL FEET IN ORDER TODAY			28	LOADS	560
				UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Jaend*



**HPP Corp**  
 Transport for: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

**Bill of Lading**

Customer Use  
**L189**  
 PO Number: 2159-NR-H033  
 Yards \_\_\_\_\_  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donost St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T300T Spec Item 8247, 8276, 8312, 8400 and/or other appropriate specifications.

Track #: 713  
 Customer Signature: *Bern*

Non DOT Regulated Non Hazardous  
 Date: 10/20  
 Time: 10:20  
 Carrier Signature: *Jaend*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053327
CUSTOMER NAME	USA Environment, LP				
DATE	10/09/2009	TIME	10:38	WEIGHTED BY	Jaend
TRUCK #	113	DRIVER NAME	M. Pulido	TRUCK NO.	PS11
MATERIAL DESCRIPTION	Soil - 1				
TOTAL FEET IN ORDER TODAY			27	LOADS	540
				UNITS	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Jaend*



**HPP Corp**  
 Transport for: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

**Bill of Lading**

Customer Use  
**L188**  
 PO Number: 2159-NR-H033  
 Yards \_\_\_\_\_  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment, P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donost St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T300T Spec Item 8247, 8276, 8312, 8400 and/or other appropriate specifications.

Track #: 511  
 Customer Signature: *Bern*

Non DOT Regulated Non Hazardous  
 Date: 9/50  
 Time: 9:50  
 Carrier Signature: *Jaend*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PRO NUMBER	2159-NR-H033	WATER CODES NO.	02150	TICKET NO.	511053334
CUSTOMER NAME	USA Environment, LP						
DATE	10/09/2009	TIME	10:53	WEIGHED BY	Jwend	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1						
UNITS	30 LOADS	WEIGHT	500	UNITS			



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

L190

Customer Name: USA Environment  
P.O. Box 67687, Houston, TX 77287  
Kemper Center Recycled Center of Donkey St. and Market St.  
Houston, TX

Material Description: Gravel and Soil

Process to TADOT Spec Item 8247, 8276, 8315, 8400 and/or other appropriate specification.

Truck #: 007

Customer Signature: *[Signature]*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous

Date: 10/10  
Time: 10:10  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	888500	PRO NUMBER	2159-NR-H033	WATER CODES NO.	02150	TICKET NO.	511053331
CUSTOMER NAME	USA Environment, LP						
DATE	10/09/2009	TIME	10:46	WEIGHED BY	Jwend	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1						
UNITS	29 LOADS	WEIGHT	580	UNITS			



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

L18L

Customer Name: USA Environment  
P.O. Box 67687, Houston, TX 77287  
Kemper Center Recycled Center of Donkey St. and Market St.  
Houston, TX

Material Description: Gravel and Soil

Process to TADOT Spec Item 8247, 8276, 8315, 8400 and/or other appropriate specification.

Truck #: 826

Customer Signature: *[Signature]*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous

Date: 10/10  
Time: 9:45  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-H033	DATE OF SHIPMENT	02150	INVOICE NO.	611053336
CUSTOMER NAME	USA Environment, LP				
SHIPMENT TYPE	113	UNIT TYPE	M. PULIDO	TRUCK NO.	P332
MATERIAL DESCRIPTION	So11 - 1				
DATE	10/09/2009	TIME	11:05	DRIVER	Jarend
UNITS	32 LOADS	WEIGHT	640	UNITS	



RECEIVED BY: **Class 1 Materials  
Former Cactus Pileyard, Houston**

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Margard St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L192

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Cactus and/or HPP. The carrier shall save and hold SOCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous non-polluting, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/28  
Time: 10:28  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-H033	DATE OF SHIPMENT	02150	INVOICE NO.	611053336
CUSTOMER NAME	USA Environment, LP				
SHIPMENT TYPE	113	UNIT TYPE	M. PULIDO	TRUCK NO.	P777
MATERIAL DESCRIPTION	So11 - 1				
DATE	10/09/2009	TIME	11:05	DRIVER	Jarend
UNITS	31 LOADS	WEIGHT	620	UNITS	



RECEIVED BY: **Class 1 Materials  
Former Cactus Pileyard, Houston**

SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dorsett St. and Margard St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Customer Use  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L191

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Cactus and/or HPP. The carrier shall save and hold SOCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous non-polluting, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10:20  
Time: 10:20  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

24 HOURS  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES

0404

PRODUCT NO.	Q2150	INVOICE NO.	511053767
Q2150	2159-NR-H033	SALES ORDER NO.	02150
CUSTOMER NAME:		USA Environment, LP	
QUANTITY	UNIT	WEIGHTED BY	YARD
401	MTZ	20	Yard
MATERIAL DESCRIPTION:			
Soil - 1			
TOTAL FOR THIS ORDER		20	
UNITS		YARD	

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Edgar M*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

L194

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St.  
Houston, TX

Material Description: Gravel and Soil

Process to 32DOT Spec Item #212, #276, #3157, #400 and/or other appropriate specification.

Truck #: 586

Customer Signature: *Romy*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all transportation regulations, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous

Date: 10/10

Time: 7:30

Carrier Signature: *Edgar M*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

24 HOURS  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES

0404

PRODUCT NO.	Q2150	INVOICE NO.	511053767
Q2150	2159-NR-H033	SALES ORDER NO.	02150
CUSTOMER NAME:		USA Environment, LP	
QUANTITY	UNIT	WEIGHTED BY	YARD
113	M. PULIDA	20	Yard
MATERIAL DESCRIPTION:			
Soil - 1			
TOTAL FOR THIS ORDER		20	
UNITS		YARD	

**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *Edgar M*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Use

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

L193

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St.  
Houston, TX

Material Description: Gravel and Soil

Process to 32DOT Spec Item #212, #276, #3157, #400 and/or other appropriate specification.

Truck #: 14

Customer Signature: *Romy*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier remains responsible for all transportation regulations, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous

Date: 10/10

Time: 7:30

Carrier Signature: *Edgar M*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	QUANTITY	02150	UNIT NO.	S11053769
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	401	TRUCK NO.	MTZ	566	
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/16/2009	WEIGHTED BY	agarc		
TOTALS FOR THIS ORDER TODAY	3	LOADS		EQ	UNITS

DELIVERY ADDRESS:  
Class 1 Material  
Former Cactus Playyard, Houston TX

RECEIVED BY: [Signature]  
CARRIER SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-1033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L196

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Playyard, Corner of Dorsett St. and Mariner St., Houston, TX

Material Description: Gravel and Soil  
Process to 2-3/8" Spec from #2 1/2, #1 1/2, #1 1/4, #1 1/8 and/or other appropriate specifications.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 7:40  
Truck #: 566  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	QUANTITY	02150	UNIT NO.	S11053768
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	401	TRUCK NO.	MTZ	579	
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/16/2009	WEIGHTED BY	agarc		
TOTALS FOR THIS ORDER TODAY	2	LOADS		40	UNITS

DELIVERY ADDRESS:  
Class 1 Material  
Former Cactus Playyard, Houston TX

RECEIVED BY: [Signature]  
CARRIER SIGNATURE: [Signature]

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Use  
PO Number: 2159-NR-1033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous  
L195

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Playyard, Corner of Dorsett St. and Mariner St., Houston, TX

Material Description: Gravel and Soil  
Process to 2-3/8" Spec from #2 1/2, #1 1/2, #1 1/4, #1 1/8 and/or other appropriate specifications.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 7:35  
Truck #: 579  
Carrier Signature: [Signature]


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	S11053772
CUSTOMER NAME	USA Environment, LP				
SHIP TO	401 MTZ	QUANTITY	20	UNIT	YARD
DATE	10/16/2009 08:29	WEIGHT	AGRIC		
MATERIAL DESCRIPTION	S011 - 1				
	5	LOADS	1000 UNITS		

RECEIVED BY:  Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are caused by such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Customer No. 888300  
Sales Order No. 02150

Customer Use: **L198**

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 587

Customer Signature: 

Carrier Signature: 

Time: 1:50

Date: 10/16/09

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	S11053771
CUSTOMER NAME	USA Environment, LP				
SHIP TO	401 MTZ	QUANTITY	20	UNIT	YARD
DATE	10/16/2009 08:21	WEIGHT	AGRIC		
MATERIAL DESCRIPTION	S011 - 1				
	4	LOADS	800 UNITS		

RECEIVED BY:  Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are caused by such transportation or handling.

CARRIER SIGNATURE: 

**Bill of Lading**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Customer No. 888300  
Sales Order No. 02150


Customer Use: **L197**


PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 526

Customer Signature: 

Carrier Signature: 

Time: 7:45

Date: 10/16/09

Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE OF ORDER	02150	ESTIMATE NO.	S11053778
CUSTOMER NAME	USA Environment, LP						
QUANTITY	401	UNIT	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE				10/16/2009	TIME	08:44	AGENCY
MATERIAL DESCRIPTION				Soil - 1			
TOTAL FOR THIS ORDER TODAY				7	LOADS	140	UNITS



DELIVER ADDRESS  
**Class 1 Material  
Former Cactus Pileyard, Houston**

RECEIVED BY: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

CARRIER USE  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dowsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75DOT Spec Item #271, #276, #3157, #400 and/or other appropriate specification.  
Truck #: 572  
Time: 8:20  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

CUSTOMER NO.	888500	PO NUMBER	2159-NR-H033	DATE OF ORDER	02150	ESTIMATE NO.	S11053775
CUSTOMER NAME	USA Environment, LP						
QUANTITY	401	UNIT	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1						
DATE				10/16/2009	TIME	08:36	AGENCY
MATERIAL DESCRIPTION				Soil - 1			
TOTAL FOR THIS ORDER TODAY				6	LOADS	120	UNITS



DELIVER ADDRESS  
**Class 1 Material  
Former Cactus Pileyard, Houston**

RECEIVED BY: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Bill of Lading**  
HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

CARRIER USE  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dowsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75DOT Spec Item #271, #276, #3157, #400 and/or other appropriate specification.  
Truck #: 574  
Time: 7:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name	USA Environment, LP	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	511053783
Material Description	401 MTZ	Weight	571	Volume	20	Unit	Yard
Material Description	5011 - 1	Weight	9	Volume	180	Unit	UNITS

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kramer Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 571  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cracked Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 11/16  
Time: 8:10

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name	USA Environment, LP	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	511053781
Material Description	401 MTZ	Weight	593	Volume	20	Unit	Yard
Material Description	5011 - 1	Weight	B	Volume	160	Unit	UNITS

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Kramer Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specifications.

Truck #: 523  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cracked Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 11/16  
Time: 8:05

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

CUSTOMER COPY

MATERIAL CODES

SHIPMENT NO.	2159-NR-H033	SCALE CODE	02150	TRUCK NO.	511053788
CUSTOMER NAME	USA Environment, LP				
CLASSIFICATION	401	TRUCK NO.	MTZ	561	
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/16/2009	TIME	09:21	AGENCY	agarc
WEIGHT	12000	UNITS	240		

Class 1 Material  
Former Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: *M Alvarez*

NOTICE: The carrier/customer involved in the transportation or handling of material covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of material covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87867, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornett St. and Market St., Houston, TX

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 8:15  
Carrier Signature: *M Alvarez*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

CUSTOMER COPY

MATERIAL CODES

SHIPMENT NO.	2159-NR-H033	SCALE CODE	02150	TRUCK NO.	511053785
CUSTOMER NAME	USA Environment, LP				
CLASSIFICATION	401	TRUCK NO.	MTZ	578	
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/16/2009	TIME	09:07	AGENCY	agarc
WEIGHT	11000	UNITS	220		

Class 1 Material  
Former Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of material covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of material covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87867, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dornett St. and Market St., Houston, TX

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 8:25  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	PO NUMBER	SHIP TO	SHIP TO CONTACT NO.	SHIP TO PHONE NO.
888500	2159-NR-H033		02150	511053793
CUSTOMER NAME: USA Environment, LP				

ALLEN NUMBER	MATERIAL NAME	QUANTITY	UNIT
401	MTZ	566	Yard

DATE	TIME	WEIGHT	BR	AGAVE
10/16/2009	09:35			
TOTAL WEIGHT THIS TRUCK LOAD				280 UNITS

CLASS 1 Material  
 Former Cactus Pipeyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall assume and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donner St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.  
 Non DOT Regulated, Non-Hazardous  
 Date: 10/16/09  
 Time: 9:45  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	PO NUMBER	SHIP TO	SHIP TO CONTACT NO.	SHIP TO PHONE NO.
888500	2159-NR-H033		02150	511053798
CUSTOMER NAME: USA Environment, LP				

ALLEN NUMBER	MATERIAL NAME	QUANTITY	UNIT
401	MTZ	562	Yard

DATE	TIME	WEIGHT	BR	AGAVE
10/16/2009	09:25			
TOTAL WEIGHT THIS TRUCK LOAD				260 UNITS

CLASS 1 Material  
 Former Cactus Pipeyard, Houston TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall assume and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donner St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.  
 Non DOT Regulated, Non-Hazardous  
 Date: 10/16/09  
 Time: 8:30  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Job Number	2159-NR-H033	SOI No.		SOI Order No.	02150	Truck No.	511053797
Sales Order No.	02150	Customer Name	USA Environment, LP	Carrier		Weight	20	Units	Yard
Material Description	Soil - 1	Carrier		Date	10/16/2009 09:58	Weighted By	ABARC	Units	
TOTALS FOR THIS ORDER/TOTAL		Units	15 Loads	Units	320	Units		Units	



Class 1 Material  
Former Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77281  
Former Cactus Pipeyard, Corner of Dunnett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 1200T Spec Item 8247, 8276, 8315, 8400 under other appropriate specification

Truck #: 529  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: \_\_\_\_\_  
Time: \_\_\_\_\_  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Job Number	2159-NR-H033	SOI No.		SOI Order No.	02150	Truck No.	511053796
Sales Order No.	02150	Customer Name	USA Environment, LP	Carrier		Weight	20	Units	Yard
Material Description	Soil - 1	Carrier		Date	10/16/2009 09:50	Weighted By	ABARC	Units	
TOTALS FOR THIS ORDER/TOTAL		Units	15 Loads	Units	300	Units		Units	



Class 1 Material  
Former Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77281  
Former Cactus Pipeyard, Corner of Dunnett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 1200T Spec Item 8247, 8276, 8315, 8400 under other appropriate specification

Truck #: 586  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: \_\_\_\_\_  
Time: \_\_\_\_\_  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404  
*Ray*

STATION NO.	2159-NR-H033	DATE	02150	TRUCK NO.	511053803
CUSTOMER NAME	USA Environment, LP				
DATE	10/16/2009	TIME	10:19	WEIGHT BY	agarc
UNIT	401	MTZ	573	TONS FOR THE OPERATION	18 loads
UNITS	360 UNITS				



RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: \_\_\_\_\_

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of HPP Corporation (HPP). The carrier shall save and hold HPP harmless from all liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: \_\_\_\_\_  
Time: 9:35  
Center Signature: *Quelk Roy*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

STATION NO.	2159-NR-H033	DATE	02150	TRUCK NO.	511053802
CUSTOMER NAME	USA Environment, LP				
DATE	10/16/2009	TIME	10:18	WEIGHT BY	agarc
UNIT	401	MTZ	576	TONS FOR THE OPERATION	17 loads
UNITS	340 UNITS				



RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: \_\_\_\_\_

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of HPP Corporation (HPP). The carrier shall save and hold HPP harmless from all liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/16  
Time: 9:35  
Center Signature: *Ray*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	587
CUSTOMER NAME	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHTED BY	agarc
DATE	10/16/2009	TIME	10:37	UNITS	20 Yards
MATERIAL DESCRIPTION	Soil - 1				
UNITS	20 LBS	UNITS	400	UNITS	

Class 1 Material  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87667, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Barrett St. and Market St.  
Houston, TX 77034

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #317, #376, #3157, #400 and/or other appropriate specification.

Truck #: 587  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier verifies materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 4:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	574
CUSTOMER NAME	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHTED BY	agarc
DATE	10/16/2009	TIME	10:25	UNITS	19 Yards
MATERIAL DESCRIPTION	Soil - 1				
UNITS	19 LBS	UNITS	380	UNITS	

Class 1 Material  
Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87667, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Barrett St. and Market St.  
Houston, TX 77034

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #317, #376, #3157, #400 and/or other appropriate specification.

Truck #: 574  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier verifies materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 5:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order Number	2159-NR-H033	Invoice No.	511053812
Sales Order No.	02150	Customer Name	USA Environment, LP	Units	20 Yard
Material Description	Soil - 1	Weight	10/16/2009 10:49	Agaric	
		Volume for this Order Today	21 Loads	420	UNITS

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.


CARRIER SIGNATURE: 

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Danette St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to T200T Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 583  
Customer Signature: 

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crashed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 20:10  
Carrier Signature: 


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order Number	2159-NR-H033	Invoice No.	511053811
Sales Order No.	02150	Customer Name	USA Environment, LP	Units	20 Yard
Material Description	Soil - 1	Weight	10/16/2009 10:47	Agaric	
		Volume for this Order Today	20 Loads	400	UNITS

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Danette St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to T200T Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 572  
Customer Signature: 

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crashed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 10:00  
Carrier Signature: 

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 Sustainability at Work  
 www.hpprecycles.com

0404

CUSTOMER COPY  
 MATERIAL CODES

ORDER NO.	888500	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TRACK NO.	S11053819
CUSTOMER NAME	USA Environment, LP						
CARRIER NUMBER	401	PLATE NUMBER	MTZ	TRUCK NO.	578	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1		DATE	10/16/2009	TIME	11:07	agarc
			YARDS FOR THIS ORDER ONLY	23.0000	WEIGHT	460	UNITS

Class 1 Material  
 Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
 SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

Bill of Lading

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8241, 8276, 88315, H100 and/or other appropriate specification.

Truck #: 578  
 Customer Signature: [Signature]

Bill of Lading

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8241, 8276, 88315, H100 and/or other appropriate specification.

Truck #: 578  
 Customer Signature: [Signature]

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SOC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
 Date: 10/16/09

Time: 10:39  
 Carrier Signature: [Signature]

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 Sustainability at Work  
 www.hpprecycles.com

0404

CUSTOMER COPY  
 MATERIAL CODES

ORDER NO.	888500	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TRACK NO.	S11053818
CUSTOMER NAME	USA Environment, LP						
CARRIER NUMBER	401	PLATE NUMBER	MTZ	TRUCK NO.	571	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1		DATE	10/16/2009	TIME	10:58	agarc
			YARDS FOR THIS ORDER ONLY	22.0000	WEIGHT	440	UNITS

Class 1 Material  
 Former Cactus Pipeyard, Houston TX



RECEIVED BY: [Signature]  
 SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

Bill of Lading

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8241, 8276, 88315, H100 and/or other appropriate specification.

Truck #: 571  
 Customer Signature: [Signature]

Bill of Lading

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 81687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8241, 8276, 88315, H100 and/or other appropriate specification.

Truck #: 571  
 Customer Signature: [Signature]

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SOC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
 Date: 10/16/09

Time: 10:55  
 Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053823
CUSTOMER NAME	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHT	562
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/16/2009	TIME	11:28	WEIGHT BY	4891C
TOTAL FROM THIS ORDER/TOTAL			20	Yard	500

Class 1 Material  
Former Cactus Pipeyard, Houston, TX



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dwyer St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer versus materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.  
Truck #: 562  
Customer Signature: *[Signature]*

Non DOT Regulated Non Hazardous  
Date: 10-15  
Time: 10:45  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053821
CUSTOMER NAME	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHT	561
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/16/2009	TIME	11:21	WEIGHT BY	4891C
TOTAL FROM THIS ORDER/TOTAL			24	LODS	480

Class 1 Material  
Former Cactus Pipeyard, Houston, TX



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dwyer St. and Market St., Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Customer versus materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.  
Truck #: 561  
Customer Signature: *[Signature]*

Non DOT Regulated Non Hazardous  
Date: 10-16  
Time: 10:40  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hppcycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

CLASSIFICATION	2159-NR-4033	SALES ORDER NO.	02150	TICKET NO.	511053829
CUSTOMER NAME	USA Environment, LP				
PLATE NUMBER	401	PLATE NAME	MTZ	WEIGHT	20
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/16/2009	TIME	11:43	WEIGHTED BY	agarc
UNITS	27 Loads		540 UNITS		



RECEIVED BY: **Class 1 Material Former Cactus Pipeline, Houston TX**

SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Bill of Lading  
 PO Number: 2159-NR-4033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 220

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Eastern Cactus Pipeline, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 72DOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 586  
 Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer reserves materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
 Date: 11/00  
 Time: 11:00  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hppcycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

CLASSIFICATION	2159-NR-4033	SALES ORDER NO.	02150	TICKET NO.	511053826
CUSTOMER NAME	USA Environment, LP				
PLATE NUMBER	401	PLATE NAME	MTZ	WEIGHT	20
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/16/2009	TIME	11:32	WEIGHTED BY	agarc
UNITS	26 Loads		520 UNITS		



RECEIVED BY: **Class 1 Material Former Cactus Pipeline, Houston TX**

SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Bill of Lading  
 PO Number: 2159-NR-4033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 219

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Eastern Cactus Pipeline, Corner of Dorsett St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 72DOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 586  
 Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer reserves materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
 Date: 10/30  
 Time: 10:30  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACK NO.	S11053839
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/16/2009	TIME RECEIVED	12:02	WEIGHTED BY	agawc
UNIT NO.	401	UNIT TYPE	MTZ	UNIT QTY	20
MATERIAL DESCRIPTION	5011 - 1				
UNIT WEIGHT	29 LBS	UNIT VOLUME	580	UNIT TYPE	UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRACK NO.	S11053837
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/16/2009	TIME RECEIVED	12:02	WEIGHTED BY	agawc
UNIT NO.	401	UNIT TYPE	MTZ	UNIT QTY	20
MATERIAL DESCRIPTION	5011 - 1				
UNIT WEIGHT	28 LBS	UNIT VOLUME	560	UNIT TYPE	UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 5716  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier/customer shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier retains materials transported as non-hazardous materials and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 11/15  
Time: 11:15  
Carrier Signature: *[Signature]*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 5719  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier/customer shall save and hold HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier retains materials transported as non-hazardous materials and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 11/10  
Time: 11:10  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Doretti St. and Marlene St., Houston, TX

Material Description: Gravel and Soil  
Process to 72007 Spec Item #242, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 224  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete (HPP). The carrier/customer shall save and hold HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 11/24/10

Truck #: 574  
Time: 11:24  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

ORDER NO.	PROJ. NO.	SHIP DATE	SHIP QTY	TOTAL QTY
888500	2159-NR-H033	02150	20	511053843

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Doretti St. and Marlene St., Houston, TX

Material Description: Gravel and Soil  
Process to 72007 Spec Item #242, #276, #3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 224  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete (HPP). The carrier/customer shall save and hold HPP harmless from liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 11/25/10

Truck #: 573  
Time: 11:25  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	
CUSTOMER NAME	USA Environment, LP				
ORDER DATE	4/01	TRUCK MAKE	MTZ	TRUCK NO.	571
MATERIAL DESCRIPTION	Soil - 1				

DATE	10/16/2009	TIME	12:36	WEIGHT BY	agarc
DRIVER		NET WT	20	UNIT	Yard
TOTAL WEIGHT ON TRUCK					
TOTAL WEIGHT ON ORDER					
TOTAL WEIGHT ON TRUCK			33	LOADS	560
					UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Danvers St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 571  
Customer Signature: *[Signature]*

Hill Country Authority

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 11:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	
CUSTOMER NAME	USA Environment, LP				
ORDER DATE	4/01	TRUCK MAKE	MTZ	TRUCK NO.	583
MATERIAL DESCRIPTION	Soil - 1				

DATE	10/16/2009	TIME	12:25	WEIGHT BY	agarc
DRIVER		NET WT	20	UNIT	Yard
TOTAL WEIGHT ON TRUCK					
TOTAL WEIGHT ON ORDER					
TOTAL WEIGHT ON TRUCK			32	LOADS	640
					UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Danvers St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 583  
Customer Signature: *[Signature]*

Hill Country Authority

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16/09  
Time: 11:45  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	SOI NO.	SALES ORDER NO.	TRUCK NO.
888504	2159-NR-H033		02150	511053853
CUSTOMER NAME: USA Environment, LP				
DATE	TIME	WEIGHTED BY	UNITS	
10/16/2009	12:49	agarc	20	Yard
MATERIAL DESCRIPTION: Soil - 1			35 LOADS	700 UNITS



Class 1 Material  
Former Cactus Pipeyard, Houston  
RECEIVED BY:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. D. [Signature]*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 522  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
228

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator permits materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 12-20  
Time: 12:20  
Carrier Signature: *F. D. [Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	SOI NO.	SALES ORDER NO.	TRUCK NO.
888504	2159-NR-H033		02150	511053852
CUSTOMER NAME: USA Environment, LP				
DATE	TIME	WEIGHTED BY	UNITS	
10/16/2009	12:47	agarc	20	Yard
MATERIAL DESCRIPTION: Soil - 1			34 LOADS	680 UNITS



Class 1 Material  
Former Cactus Pipeyard, Houston  
RECEIVED BY:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 589  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
227

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator permits materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10-16-09  
Time: 12:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	888504	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053858
CUSTOMER NAME				USA Environment, LP			
QUANTITY	401	UNIT	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION		S011 - 1					
DATE	10/16/2009	TIME	12:59	AGENCY			
MATERIAL DESCRIPTION		37 Loads		740 UNITS			



Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Mackie Steg*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 57687 Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St. Houston, TX

Material Description: Gravel and Soil

Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 561

Customer Signature: *BJ*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier waives material transported as non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous

Date: 11/18

Time: 12:30

Carrier Signature: *Mauna Sen*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	888504	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511053855
CUSTOMER NAME				USA Environment, LP			
QUANTITY	401	UNIT	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION		S011 - 1					
DATE	10/16/2009	TIME	12:54	AGENCY			
MATERIAL DESCRIPTION		36 Loads		720 UNITS			



Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 229  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 57687 Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St. Houston, TX

Material Description: Gravel and Soil

Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 578

Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier waives material transported as non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous

Date: 12/22

Time: 12:22

Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053861
CUSTOMER NAME:	USA Environment, LP				
UNIT NUMBER	401	UNIT NAME	MTZ	TRUCK NO.	566
MATERIAL DESCRIPTION:	9011 - 1				
DATE	10/16/2009	TIME	13:07	WEIGHT BY	agarc
TOTAL NET WT THIS CARRIER			39 Loads	780 UNITS	



Class 1 Material  
Former Cactus Pinyard, Houston TX

RECEIVED BY: \_\_\_\_\_  
SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Pinyard, Corner of Donnet St. and Maribel St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 566  
Customer Signature: \_\_\_\_\_

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: \_\_\_\_\_  
Time: 12:40  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053860
CUSTOMER NAME:	USA Environment, LP				
UNIT NUMBER	401	UNIT NAME	MTZ	TRUCK NO.	562
MATERIAL DESCRIPTION:	9011 - 1				
DATE	10/16/2009	TIME	13:06	WEIGHT BY	agarc
TOTAL NET WT THIS CARRIER			38 Loads	760 UNITS	



Class 1 Material  
Former Cactus Pinyard, Houston TX

RECEIVED BY: \_\_\_\_\_  
SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Pinyard, Corner of Donnet St. and Maribel St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item 8247, 8276, 83157, #400 and/or other appropriate specification.

Truck #: 562  
Customer Signature: \_\_\_\_\_

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: \_\_\_\_\_  
Time: 12:30  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

04404

CUSTOMER COPY  
MATERIAL CODES

INVOICE NO.	2159-NR-H033	PO NUMBER	02150	DATE	5/10/2009
CUSTOMER NAME	USA Environment, LP		SALES ORDER NO.	511053863	TRUCK NO.
PLATE NUMBER	401	HAULER NUMBER	MTZ	WEIGHTED BY	agarc
MATERIAL DESCRIPTION	Soil - 1		DATE	10/16/2009	TIME
	41	LOADS	13:19	UNITS	Yard
	41	LOADS		UNITS	820

RECEIVED BY: **Class 1 Material Former Cactus Pipeline, Houston TX**



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
RRC Material  
Yards: 20  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.  
Truck #: 5716  
Customer Signature: *[Signature]*  
Time: 12:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

04404

CUSTOMER COPY  
MATERIAL CODES

INVOICE NO.	2159-NR-H033	PO NUMBER	02150	DATE	5/10/2009
CUSTOMER NAME	USA Environment, LP		SALES ORDER NO.	511053862	TRUCK NO.
PLATE NUMBER	401	HAULER NUMBER	MTZ	WEIGHTED BY	agarc
MATERIAL DESCRIPTION	Soil - 1		DATE	10/16/2009	TIME
	40	LOADS	13:12	UNITS	Yard
	40	LOADS		UNITS	800

RECEIVED BY: **Class 1 Material Former Cactus Pipeline, Houston TX**



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
RRC Material  
Yards: 20  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87087, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.  
Truck #: 5886  
Customer Signature: *[Signature]*  
Time: 12:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053866
CUSTOMER NAME	USA Environment, LP			SHIP TO	20	YARD	
CLASS NUMBER	401	HAZARDOUS	MTZ	TRUCK NO.	573		
UNIFORM DESCRIPTION	Soil - 1			DATE	10/16/2009	TIME	13:32
				WEIGHT BY	AGAVIC		
				WEIGHTS FROM THIS ORDER TODAY	43	LOADS	860
				UNITS	YARD		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/consignor involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/consignor shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dobson St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 1579  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Registered Non Hazardous  
236

Notice: The carrier/consignor involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Consignor warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Registered, Non Hazardous  
Date: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	888500	PO NUMBER	2159-NR-H033	DATE ORDERED	02150	INVOICE NO.	511053864
CUSTOMER NAME	USA Environment, LP			SHIP TO	20	YARD	
CLASS NUMBER	401	HAZARDOUS	MTZ	TRUCK NO.	573		
UNIFORM DESCRIPTION	Soil - 1			DATE	10/16/2009	TIME	13:23
				WEIGHT BY	AGAVIC		
				WEIGHTS FROM THIS ORDER TODAY	42	LOADS	840
				UNITS	YARD		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/consignor involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/consignor shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87697, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dobson St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 573  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Registered Non Hazardous  
235

Notice: The carrier/consignor involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Consignor warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Registered, Non Hazardous  
Date: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CONTRACT NO.	888500	TRUCK NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053869
CUSTOMER NAME	USA Environment, LP						
HAZMAT NUMBER	401	HAZMAT NAME	MTZ	TRUCK NO.	574	DATE	10/16/2009
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/16/2009	TIME	13:45	WEIGHTS BY	20	UNITS	Yard
TOTALS FOR THIS ORDER ONLY				45	LOADS	900	UNITS



RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CONTRACT NO.	888500	TRUCK NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053867
CUSTOMER NAME	USA Environment, LP						
HAZMAT NUMBER	401	HAZMAT NAME	MTZ	TRUCK NO.	571	DATE	10/16/2009
MATERIAL DESCRIPTION	Soil - 1						
DATE	10/16/2009	TIME	13:40	WEIGHTS BY	20	UNITS	Yard
TOTALS FOR THIS ORDER ONLY				44	LOADS	880	UNITS



RECEIVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Borrett St. and Marquet St., Houston, TX

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer warrants transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/16/09  
Time: 1:15  
Carrier Signature: *[Signature]*

**Bill of Lading**

HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Borrett St. and Marquet St., Houston, TX

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cycled Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer warrants transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/16/09  
Time: 2:10  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIP TO NO.	SHIP TO NAME	SHIP TO ADDRESS	SHIP TO CITY	SHIP TO STATE	SHIP TO ZIP
888500	USA Environment, LP	2159-NR-H033			
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	401	MTZ	572		
MATERIAL DESCRIPTION	Soil - 1				
DATE	TIME	UNIT	WEIGHT	WEIGHT	WEIGHT
10/16/2009	14:05	agarc	20	Yard	
TOTAL WEIGHT (GROSS)			4.7	LOADS	940
TOTAL WEIGHT (NET)					



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. Cruz*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Ricker Cactus Pipeyard, Corner of Danbeck St. and Market St., Houston, TX

Process to T20DOT Spec Item #247, #276, #3125, #400 and/or other appropriate specification.

Truck #: *572*

Carrier Signature: *Bony*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: *10/16/09*  
Time: *1:25*  
Carrier Signature: *F. Cruz*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIP TO NO.	SHIP TO NAME	SHIP TO ADDRESS	SHIP TO CITY	SHIP TO STATE	SHIP TO ZIP
888500	USA Environment, LP	2159-NR-H033			
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	401	MTZ	587		
MATERIAL DESCRIPTION	Soil - 1				
DATE	TIME	UNIT	WEIGHT	WEIGHT	WEIGHT
10/16/2009	13:56	agarc	20	Yard	
TOTAL WEIGHT (GROSS)			4.6	LOADS	920
TOTAL WEIGHT (NET)					



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Ricker Cactus Pipeyard, Corner of Danbeck St. and Market St., Houston, TX

Process to T20DOT Spec Item #247, #276, #3125, #400 and/or other appropriate specification.

Truck #: *572*

Carrier Signature: *Bony*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: *10/16/09*  
Time: *1:25*  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053874
CUSTOMER NAME	USA Environment, LP				

CLASS	UNIT	QUANTITY
401	MTZ	561

MATERIAL DESCRIPTION:  
 Soil - 1

DATE	TIME	WEIGHED BY	UNIT
10/16/2009	14:15	ASAVC	Yard
TOTAL FOR THIS ORDER FROM:			980 UNITS

RECEIVED BY:  
 Class 1 Material  
 Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Markus Seg*



Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dunbar St. and Market St.  
 Houston, TX

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Houston Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Governor warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
 Proceed to TSDOT Spec Item #217, #218, #3157, #400 and/or other appropriate specifications.

Truck #: 561  
 Customer Signature: *Ben*

Non DOT Regulated, Non-Hazardous  
 Date: *10/16/09*  
 Time: *1:18*  
 Carrier Signature: *Markus Seg*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511053873
CUSTOMER NAME	USA Environment, LP				

CLASS	UNIT	QUANTITY
401	MTZ	578

MATERIAL DESCRIPTION:  
 Soil - 1

DATE	TIME	WEIGHED BY	UNIT
10/16/2009	14:08	ASAVC	Yard
TOTAL FOR THIS ORDER FROM:			560 UNITS

RECEIVED BY:  
 Class 1 Material  
 Former Cactus Pipeyard, Houston TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Markus Seg*



Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dunbar St. and Market St.  
 Houston, TX

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Houston Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Governor warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Material Description: Gravel and Soil  
 Proceed to TSDOT Spec Item #217, #218, #3157, #400 and/or other appropriate specifications.

Truck #: 578  
 Customer Signature: *Ben*

Non DOT Regulated, Non-Hazardous  
 Date: *10/16/09*  
 Time: *1:30*  
 Carrier Signature: *Markus Seg*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	S11053880
Customer Name:	USA Environment, LP			
Material Description:	401	MTZ	576	
Material Description:	Soil - 1			
Carrier	10/16/2009	14:35	agarc	
Units	51 Loads			1020

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 576  
Customer Signature:

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous non-polluting, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/16/09

Time: 1:00  
Carrier Signature:

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	S11053876
Customer Name:	USA Environment, LP			
Material Description:	401	MTZ	583	
Material Description:	Soil - 1			
Carrier	10/16/2009	14:21	agarc	
Units	50 Loads			1000

RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TADOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 583  
Customer Signature:

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous non-polluting, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/16/09

Time: 1:00  
Carrier Signature:

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-1033	DATE	02150	WEIGHT	511053883
Customer Name:		USA Environment, LP		DATE		WEIGHT	
Material Description:		Soil - 1		DATE		WEIGHT	
401	MTZ	573	DATE		WEIGHT		Yard
MATERIAL DESCRIPTION:		Soil - 1		DATE		WEIGHT	
53 loads		1060		DATE		WEIGHT	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

Signature: *[Signature]*

Carrier Signature: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Hill of Ladang**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 573  
Carrier Signature: *[Signature]*

PO Number: 2159-NR-1033  
Yards: 247  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 2:15

**Hill of Ladang**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 573  
Carrier Signature: *[Signature]*

PO Number: 2159-NR-1033  
Yards: 247  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 2:15

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-1033	DATE	02150	WEIGHT	511053882
Customer Name:		USA Environment, LP		DATE		WEIGHT	
Material Description:		Soil - 1		DATE		WEIGHT	
401	MTZ	562	DATE		WEIGHT		Yard
MATERIAL DESCRIPTION:		Soil - 1		DATE		WEIGHT	
52 loads		1040		DATE		WEIGHT	

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

Signature: *[Signature]*

Carrier Signature: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**Hill of Ladang**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 562  
Carrier Signature: *[Signature]*

PO Number: 2159-NR-1033  
Yards: 246  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 2:10

**Hill of Ladang**

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 562  
Carrier Signature: *[Signature]*

PO Number: 2159-NR-1033  
Yards: 246  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 2:10

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Bill of Lading No.	2159-NR-H033	Invoice No.	02150	Trailer No.	511053886
Customer Name:	USA Environment, LP						
Origin	401	Destination	MTZ	Weight	20	Unit	Yard
Date	10/16/2009		Time	15:01	Agency	agarc	
MATERIAL DESCRIPTION:				TOTALS (GROSS WEIGHT)			
Soil - 1				55 Loads 1100 UNITS			

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Bill of Lading No.	2159-NR-H033	Invoice No.	02150	Trailer No.	511053884
Customer Name:	USA Environment, LP						
Origin	401	Destination	MTZ	Weight	20	Unit	Yard
Date	10/16/2009		Time	14:54	Agency	agarc	
MATERIAL DESCRIPTION:				TOTALS (GROSS WEIGHT)			
Soil - 1				54 Loads 1080 UNITS			

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.


CARRIER SIGNATURE: 

**HPP** Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
244  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 32DOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 596  
Time: 1:58  
Carrier Signature: 

Non DOT Regulated, Non-Hazardous  
Date: 


**HPP** Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
248  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dewart St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to 32DOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 571  
Time: 2:20  
Carrier Signature: 

Non DOT Regulated, Non-Hazardous  
Date: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Customer Name	USA Environment
Sales Order No.	02150	Address	2159-NR-H033
Material Description	401 MTZ	Weight	20 Yards
Material Description	5011 - 1	Volume	57 Loads

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunnett St. and Marlett St. Houston, TX

Material Description: Gravel and Soil

Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 579

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crustal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/16/2009  
Time: 2:30 PM  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Customer Name	USA Environment
Sales Order No.	02150	Address	2159-NR-H033
Material Description	401 MTZ	Weight	20 Yards
Material Description	5011 - 1	Volume	56 Loads

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dunnett St. and Marlett St. Houston, TX

Material Description: Gravel and Soil

Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 579

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material

Non DOT Regulated Non-Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crustal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/16/2009  
Time: 2:30 PM  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/10/2009
Customer Name	USA Environment, LP			City	MTZ	State	TX
Material Description	Soil - 1			Weight	20	Unit	Yard
Class 1 Material	Former Cactus Pipeyard, Houston TX			Weight	15:24	Unit	agarc
Material Description	Soil - 1			Weight	59	Unit	lbs

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/10/2009
Customer Name	USA Environment, LP			City	MTZ	State	TX
Material Description	Soil - 1			Weight	20	Unit	Yard
Class 1 Material	Former Cactus Pipeyard, Houston TX			Weight	15:19	Unit	agarc
Material Description	Soil - 1			Weight	58	Unit	lbs

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil

Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 522

Customer Signature: 

Center Signature: \_\_\_\_\_

Time: 2:130

Date: 5/10/09

Non DOT Regulated, Non Hazardous

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

252

**HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil

Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 522

Customer Signature: 

Center Signature: \_\_\_\_\_

Time: 2:130

Date: 5/10/09

Non DOT Regulated, Non Hazardous

PO Number: 2159-NR-H033  
Yards: 20

RRC Material  
Non DOT Regulated Non Hazardous

251

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

SHIPMENT NO.	PO NUMBER	JOB NUMBER	REC NO.	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033			02150	511053900
CUSTOMER NAME USA Environment, LP					
QUANTITY	UNIT	WEIGHT	WEIGHT PER UNIT	UNIT	UNIT
401	MTZ		576	20	Yard
MATERIAL DESCRIPTION Soil - 1					
				DATE	TIME
				10/16/2009	15:42
				RECEIVED BY	agarc
				51 LOADS	1220 UNITS



CLASS 1 Material  
 Former Calcasieu Pipeyard, Houston TX  
 RECEIVED BY

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*



Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Calcasieu Pipeyard, Corner of Dornish St. and Market St., Houston, TX  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 Yards: \_\_\_\_\_  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Calcasieu Pipeyard, Corner of Dornish St. and Market St., Houston, TX  
 Material Description: Gravel and Soil  
 Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.  
 Truck #: 576  
 Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator remains liable for materials transported as non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
 Date: \_\_\_\_\_  
 Time: \_\_\_\_\_  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

SHIPMENT NO.	PO NUMBER	JOB NUMBER	REC NO.	SALES ORDER NO.	TICKET NO.
888500	2159-NR-H033			02150	511053899
CUSTOMER NAME USA Environment, LP					
QUANTITY	UNIT	WEIGHT	WEIGHT PER UNIT	UNIT	UNIT
401	MTZ		593	20	Yard
MATERIAL DESCRIPTION Soil - 1					
				DATE	TIME
				10/16/2009	15:37
				RECEIVED BY	agarc
				50 LOADS	1200 UNITS



CLASS 1 Material  
 Former Calcasieu Pipeyard, Houston TX  
 RECEIVED BY

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*



Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Calcasieu Pipeyard, Corner of Dornish St. and Market St., Houston, TX  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Calcasieu Pipeyard, Corner of Dornish St. and Market St., Houston, TX  
 Material Description: Gravel and Soil  
 Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.  
 Truck #: 588  
 Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator remains liable for materials transported as non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
 Date: \_\_\_\_\_  
 Time: \_\_\_\_\_  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	02150	511053903
CUSTOMER NAME: USA Environment, LP		20	Yard
401	MTZ	562	
MATERIAL DESCRIPTION: Soil - 1		10/16/2009 16:05	agarc
		63 LOADS	1260 UNITS

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Maribel St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, #400 under other appropriate specification.


Truck #: 562  
Customer Signature: 

Bill of Lading

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

256

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 3:00  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	02150	511053901
CUSTOMER NAME: USA Environment, LP		20	Yard
401	MTZ	561	
MATERIAL DESCRIPTION: Soil - 1		10/16/2009 15:50	agarc
		62 LOADS	1240 UNITS

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX

SIGNATURE: 


NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorett St. and Maribel St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, #400 under other appropriate specification.


Truck #: 561  
Customer Signature: 

Bill of Lading

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

253

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/16  
Time: 3:00  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

CUSTOMER NO.	2159-NR-H033	DATE RECEIVED	02150	TRACKING NO.	511053907
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/16/2009	TIME RECEIVED	16:15	WEIGHT BY TARE	20
UNIT	MTZ	TRUCK NO.	579	UNIT	Yard
MATERIAL DESCRIPTION	5011 - 1				
	65 LBS				1300 LBS


CUSTOMER NO.	2159-NR-H033	DATE RECEIVED	02150	TRACKING NO.	511053905
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/16/2009	TIME RECEIVED	16:07	WEIGHT BY TARE	20
UNIT	MTZ	TRUCK NO.	571	UNIT	Yard
MATERIAL DESCRIPTION	5011 - 1				
	64 LBS				1280 LBS

RECEIVED BY: **Class 1 Material Forster Cactus Pipeyard, Houston TX**

RECEIVED BY: **Class 1 Material Forster Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



CARRIER SIGNATURE: *[Signature]*

CARRIER SIGNATURE: *[Signature]*

**Bill of Lading**  
HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

**Bill of Lading**  
HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 8313, 8400 and/or other appropriate specifications.

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8241, 8276, 8313, 8400 and/or other appropriate specifications.

Truck #: 579  
Customer Signature: *[Signature]*

Truck #: 571  
Customer Signature: *[Signature]*

Time: 3:45  
Carrier Signature: *[Signature]*

Time: 3:40  
Carrier Signature: *[Signature]*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-1033	DATE ORDERED	02150	ORDER NO.	511053942
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	401	PLANT NAME	MTZ	TRUCK NO.	573
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/19/2009	TIME	07:59	WEIGHT BY	Jaend
TOTAL WEIGHT FOR THIS ORDER TODAY	1 LOADS		20 UNITS		



RESERVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX


NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Carol A. R...*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-1033	DATE ORDERED	02150	ORDER NO.	511053909
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	401	PLANT NAME	MTZ	TRUCK NO.	596
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/16/2009	TIME	16:18	WEIGHT BY	agarc
TOTAL WEIGHT FOR THIS ORDER TODAY	56 LOADS		1320 UNITS		



RESERVED BY:  
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *E. Garcia*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-1033  
Yards: \_\_\_\_\_  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process in TADOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 573  
Customer Signature: *Rmy*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: *10/19/09*  
Time: *7:50*  
Carrier Signature: *Carol A. R...*

**Bill of Lading**

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-1033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process in TADOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 586  
Customer Signature: *Rmy*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: *10/16/09*  
Time: *3:45*  
Carrier Signature: *E. Garcia*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/2009
Customer Name	USA Environment, LP			Carrier	20	Unit	Yard
Material Description	Soil - 1		Weight	10/19/2009 08:15		Driver	Jared
Class 1 Material	Former Cactus Pipeyard, Houston TX	Volume	3	Units	60	Units	

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

 HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards 22  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 5922  
Customer Signature: 

Non DOT Regulated, Non Hazardous  
Date: 7/15/09  
Time: 1:15 PM  
Carrier Signature: 


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/2009
Customer Name	USA Environment, LP			Carrier	20	Unit	Yard
Material Description	Soil - 1		Weight	10/19/2009 08:07		Driver	Jared
Class 1 Material	Former Cactus Pipeyard, Houston TX	Volume	2	Units	40	Units	

RECEIVED BY:   
Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

 HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards 22  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 589  
Customer Signature: 

Non DOT Regulated, Non Hazardous  
Date: 7/15/09  
Time: 7:35 PM  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053949
Customer Name:				USA Environment, LP			
Material Number	401	Material Name	Stz	Weight	20	Units	Yard
Material Description	Soil - 1						
DATE	10/19/2009	TIME	08:21	WEIGHTED BY	Jmend		
TOTAL FOR THIS ORDER ONLY				5	LOADS	100	

DELIVERY ADDRESS  
**Class 1 Material**  
Forner Cactus Pipeyard, Houston TX

RECEIVED BY:   
SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 5106  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Chemical Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants material transported are non-hazardous non-toxic, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19  
Time: 7:55  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	511053948
Customer Name:				USA Environment, LP			
Material Number	401	Material Name	MTZ	Weight	20	Units	Yard
Material Description	Soil - 1						
DATE	10/19/2009	TIME	08:20	WEIGHTED BY	Jmend		
TOTAL FOR THIS ORDER ONLY				4	LOADS	80	

DELIVERY ADDRESS  
**Class 1 Material**  
Forner Cactus Pipeyard, Houston TX

RECEIVED BY:   
SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 5100  
Customer Signature: 

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Chemical Company and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants material transported are non-hazardous non-toxic, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19  
Time: 7:45  
Carrier Signature: 

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRACK NO.	511053953
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	113	ORDER DATE	10/19/2009	ORDER TIME	08:34
ORDER BY	M. Pulido	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	7	LOADS	140	UNIT	UNITS

RECEIVED BY:   
 Class 1 Material  
 Foreign Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall have and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: 

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 87681, Houston, TX 77287  
 Foreign Cactus Pipeyard, Corner of Donnell St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 2x2007 Spec Item #241, #276, #3157, #400 and/or other appropriate specifications  
 Truck #: 574  
 Customer Signature: MW

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 266

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern United Concrete and/or HPP. The carrier shall have and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
 Date: \_\_\_\_\_  
 Time: \_\_\_\_\_  
 Carrier Signature: Marco A Hernandez

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	DATE ORDERED	02150	TRACK NO.	511053950
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	401	ORDER DATE	10/19/2009	ORDER TIME	08:25
ORDER BY	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	Soil - 1				
WEIGHT	5	LOADS	120	UNIT	UNITS

RECEIVED BY:   
 Class 1 Material  
 Foreign Cactus Pipeyard, Houston TX

SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall have and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
 P.O. Box 87681, Houston, TX 77287  
 Foreign Cactus Pipeyard, Corner of Donnell St. and Market St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to 2x2007 Spec Item #241, #276, #3157, #400 and/or other appropriate specifications  
 Truck #: 571  
 Customer Signature: MW

PO Number: 2159-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 265

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern United Concrete and/or HPP. The carrier shall have and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
 Date: \_\_\_\_\_  
 Time: \_\_\_\_\_  
 Carrier Signature: Marco A Hernandez

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	SHIP DATE	02150	SHIP NO.	S11053558
CUSTOMER NAME	USA Environment, LP		WEIGHT	20	YARD
ALTERNATE NO.	401	UNIT	MTZ	WEIGHT BY	jaend
MATERIAL DESCRIPTION	S011 - 1		DATE	10/19/2009	08:54
			UNITS	8	LOADS
					150

RESERVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston**  
TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *David L. Ray*

Bill of Lading  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards 22  
RRC Material  
Non DOT Regulated Non Hazardous  
268

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Maribel St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2x3007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 583

Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SOCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 8:54  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

0404

CUSTOMER COPY  
MATERIAL CODES

ORDER NO.	2159-NR-H033	SHIP DATE	02150	SHIP NO.	S11053557
CUSTOMER NAME	USA Environment, LP		WEIGHT	20	YARD
ALTERNATE NO.	401	UNIT	MTZ	WEIGHT BY	jaend
MATERIAL DESCRIPTION	S011 - 1		DATE	10/19/2009	08:54
			UNITS	8	LOADS
					150

RESERVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston**  
TX



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards 22  
RRC Material  
Non DOT Regulated Non Hazardous  
267

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Maribel St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2x3007 Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 583

Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SOCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 8:54  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053962
CUSTOMER NAME	USA Environment, LP				
DATE	10/19/2009	TIME	09:35	UNLADDED BY	J Brand
MATERIAL DESCRIPTION	S011 - 1				
UNITS	11 Loads	UNITS	220	UNITS	220

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 566  
Customer Signature: \_\_\_\_\_

Non DOT Regulated Non Hazardous  
Date: \_\_\_\_\_  
Time: 9:15  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION NO.	2159-NR-H033	SALES ORDER NO.	02150	TRUCK NO.	S11053959
CUSTOMER NAME	USA Environment, LP				
DATE	10/19/2009	TIME	09:26	UNLADDED BY	J Brand
MATERIAL DESCRIPTION	S011 - 1				
UNITS	10 Loads	UNITS	200	UNITS	200

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston**



SIGNATURE: \_\_\_\_\_ CARRIER SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 220  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specifications.

Truck #: 587  
Customer Signature: \_\_\_\_\_

Non DOT Regulated Non Hazardous  
Date: \_\_\_\_\_  
Time: 9:00  
Carrier Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name:	USA Environment, LP	Invoice No.:	2159-NR-H033	Invoice Date:	02/15/09	Invoice Total:	\$11053956
Material Description:	Soil - 1	Quantity:	401	Unit:	MTZ	Weight:	571
Carrier:	Jwend	Date:	10/19/2009	Time:	09:47	Location:	Yard
Material Description:	Soil - 1	Quantity:	13 Loads	Unit:		Weight:	260 UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *EJ Neorge*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #376, #3157, #400 and/or other appropriate specifications.

Truck #: 571  
Customer Signature: *Rony*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:20  
Carrier Signature: *Chris Williams*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name:	USA Environment, LP	Invoice No.:	2159-NR-H033	Invoice Date:	02/15/09	Invoice Total:	\$11053953
Material Description:	Soil - 1	Quantity:	401	Unit:	MTZ	Weight:	572
Carrier:	Jwend	Date:	10/19/2009	Time:	09:38	Location:	Yard
Material Description:	Soil - 1	Quantity:	12 Loads	Unit:		Weight:	240 UNITS



RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. Davis*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #376, #3157, #400 and/or other appropriate specifications.

Truck #: 572  
Customer Signature: *Rony*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:08  
Carrier Signature: *F. Davis*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	QTY	02150	UNIT	Yard
CUSTOMER NAME:	USA Environment, LP				
DATE	10/19/2009	TIME	09:45	DRIVER	Jasend
MATERIAL DESCRIPTION:	Soil - 1				
	15 Loads				300 UNITS

Class 1 Material  
Forster Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 57687, Houston, TX 77287  
Forster Cactus Pipeyard, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 730DOT Spec Item #217, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 5609

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:25  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	QTY	02150	UNIT	Yard
CUSTOMER NAME:	USA Environment, LP				
DATE	10/19/2009	TIME	09:49	DRIVER	Jasend
MATERIAL DESCRIPTION:	Soil - 1				
	14 Loads				280 UNITS

Class 1 Material  
Forster Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 57687, Houston, TX 77287  
Forster Cactus Pipeyard, Corner of Donnet St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 730DOT Spec Item #217, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 5600

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work.

**CUSTOMER COPY**  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	DATE ORDERED	ORDER NO.
888500	2159-NR-H033	02:150	S11053974
CUSTOMER NAME: USA Environment, LP			
ORDER NO.	PO NUMBER	DATE ORDERED	ORDER NO.
401	# 2	10/19/2009	10:29
MATERIAL DESCRIPTION: Soil - 1			
TOTAL FROM THIS ORDER		17 Loads	340 UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX  
RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

**NOTICE:** The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: [Signature]

**Hill of Landfill**  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 573  
Customer Signature: [Signature]

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:45  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work.

**CUSTOMER COPY**  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	DATE ORDERED	ORDER NO.
888500	2159-NR-H033	02:150	S11053969
CUSTOMER NAME: USA Environment, LP			
ORDER NO.	PO NUMBER	DATE ORDERED	ORDER NO.
401	MTZ	10/19/2009	10:05
MATERIAL DESCRIPTION: Soil - 1			
TOTAL FROM THIS ORDER		16 Loads	320 UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX  
RECEIVED BY: [Signature]  
SIGNATURE: [Signature]

**NOTICE:** The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: [Signature]

**Hill of Landfill**  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 583  
Customer Signature: [Signature]

Non DOT Regulated, Non-Hazardous  
Date: 10/19/09  
Time: 9:30  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053580	

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053580	

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053580	

Customer Name: USA Environment, LP  
 Material Description: 401 #12 566  
 5011 - 1  
 Class 1 Material Former Cactus Pipeyard, Houston TX  
 RECEIVED BY: [Signature]  
 SIGNATURE: [Signature]

Customer Name: USA Environment, LP  
 Material Description: 401 #12 567  
 5011 - 1  
 Class 1 Material Former Cactus Pipeyard, Houston TX  
 RECEIVED BY: [Signature]  
 SIGNATURE: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053578	

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053578	

ORDER NO.	PO NUMBER	DATE ORDERED	DATE DELIVERED	QUANTITY	UNIT
888500	2159-NR-H033	02150		511053578	

Customer Name: USA Environment, LP  
 Material Description: 401 #12 567  
 5011 - 1  
 Class 1 Material Former Cactus Pipeyard, Houston TX  
 RECEIVED BY: [Signature]  
 SIGNATURE: [Signature]



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
228

Customer Name: USA Environment, LP  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Donnet St. and Market St., Houston, TX  
Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 4400 and/or other appropriate specifications  
Truck #: 566  
Customer Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damage, loss claim, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.  
 Non DOT Regulated, Non Hazardous  
 Date: 11/19/09  
 Time: 11:05  
 Carrier Signature: [Signature]



Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
277

Customer Name: USA Environment, LP  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Center of Donnet St. and Market St., Houston, TX  
Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 4400 and/or other appropriate specifications  
Truck #: 587  
Customer Signature: [Signature]

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cactus Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damage, loss claim, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.  
 Non DOT Regulated, Non Hazardous  
 Date: 11/19/09  
 Time: 11:05  
 Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TOKEN NO.	511053985
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	401	TRUCK NO.	571	WEIGHTED BY	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/19/2009	TIME	11:14	WEEKEND	Jaend
TOTAL FOR THIS ORDER/TOTAL	21 LOADS				420 UNITS

RECEIVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *E. J. Negro*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
280

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8317, 8276, 8315, 8400 and/or other appropriate specification.

Truck #: \_\_\_\_\_  
Customer Signature: *Bony*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/25  
Time: \_\_\_\_\_  
Carrier Signature: *Chas Scott*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TOKEN NO.	511053982
CUSTOMER NAME	USA Environment, LP				
ORDER NUMBER	401	TRUCK NO.	572	WEIGHTED BY	Yard
MATERIAL DESCRIPTION	Soil - 1				
DATE	10/19/2009	TIME	11:10	WEEKEND	Jaend
TOTAL FOR THIS ORDER/TOTAL	20 LOADS				400 UNITS

RECEIVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *F. J. ...*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
279

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dowsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8317, 8276, 8315, 8400 and/or other appropriate specification.

Truck #: \_\_\_\_\_  
Customer Signature: *Bny*

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crutched Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer warrants materials transported are non-hazardous recyclable, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/25  
Time: \_\_\_\_\_  
Carrier Signature: *F. J. ...*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name	USA Environment, LP	SALES ORDER NO.	02150	TRUCK NO.	511053988
Customer No.	888500	2159-NR-H033			
Truck #	564				
Material Description	Soil - 1				
Class 1 Material	Former Cactus Pipeyard, Houston TX				
Carrier	M. Pulido	Weight	20	Yard	
Date	10/19/2009	Time	11:22	Driver	J Mend
Units	23 Loads				460 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dargatzis St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 564  
Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Cactus and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator remains strictly responsible for non-hazardous regulations, and any not a regulated hazardous waste.

Non DOT Regulated, Not Hazardous  
Date: 10/19/09  
Time: 11:22  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name	USA Environment, LP	SALES ORDER NO.	02150	TRUCK NO.	511053986
Customer No.	888500	2159-NR-H033			
Truck #	564				
Material Description	Soil - 1				
Class 1 Material	Former Cactus Pipeyard, Houston TX				
Carrier	MTZ	Weight	20	Yard	
Date	10/19/2009	Time	11:15	Driver	J Mend
Units	22 Loads				440 UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dargatzis St. and Market St.  
Houston, TX

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 564  
Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Cactus and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator remains strictly responsible for non-hazardous regulations, and any not a regulated hazardous waste.

Non DOT Regulated, Not Hazardous  
Date: 10/19/09  
Time: 11:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-H033	DATE OF SERVICE	02150	POCKET NO.	511053991
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/19/2009	TIME RECEIVED	11:46	WEIGHTED BY	Jared
MATERIAL DESCRIPTION	Soil - 1				
CLASSIFICATION	401	MTZ	573	TONS FOR THIS SHIPMENT	25.000
				UNITS	500

Class 1 Material  
Former Cactus Pipeyard, Houston, TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *David Key*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
284

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Marlene St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 573  
Customer Signature: *Bobby*

Non DOT Regulated, Non-hazardous  
Date: 10/19  
Time: 10:52  
Carrier Signature: *David Key*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycling.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	2159-NR-H033	DATE OF SERVICE	02150	POCKET NO.	511053989
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/19/2009	TIME RECEIVED	11:37	WEIGHTED BY	Jared
MATERIAL DESCRIPTION	Soil - 1				
CLASSIFICATION	401	MTZ	583	TONS FOR THIS SHIPMENT	24.000
				UNITS	480

Class 1 Material  
Former Cactus Pipeyard, Houston, TX



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *David Key*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
283

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Marlene St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 583  
Customer Signature: *Bobby*

Non DOT Regulated, Non-hazardous  
Date: 10/19  
Time: 10:55  
Carrier Signature: *David Key*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511054000
Customer Name:	USA Environment, LP			
Material Description:	401	MTZ	571	
Soil - 1				
Date:	10/19/2009	12:28	Jarend	
Time:	27 Loads		540	Units

Class 1 Material  
Former Cactus Bivoyard, Houston, TX

RECEIVED BY: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769


Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bivoyard, Corner of Dorsant St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to T2207 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 571  
Customer Signature: 

PO Number: 2159-NR-H033  
Yards: 287  
RRC Material  
Non DOT Regulated Non Hazardous

Date: 10/19/09  
Time: 12:00  
Carrier Signature: 

Non DOT Regulated Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511053593
Customer Name:	USA Environment, LP			
Material Description:	401	MTZ	587	
Soil - 1				
Date:	10/19/2009	11:56	Jarend	
Time:	26 Loads		520	Units

Class 1 Material  
Former Cactus Bivoyard, Houston, TX

RECEIVED BY: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.


Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Bivoyard, Corner of Dorsant St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to T2207 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 587  
Customer Signature: 

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Date: 10/19/09  
Time: 10:50  
Carrier Signature: 

Non DOT Regulated Non Hazardous

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES

0404

PROCESSED BY	DATE	QUANTITY	STATUS	LOCATION
888500	2159-NR-H033	02150		511054008
CUSTOMER NAME: USA Environment, LP				
DATE	TIME	WEIGHT	UNIT	
10/19/2009	12:45	1	Yard	
MATERIAL DESCRIPTION: Soil - 1				
29	LOADS	580	UNITS	

Class 1 Material  
 Former Cactus Pipeyard, Houston  
 RESERVED BY: TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Bill of Lading  
 PO Number: 2158-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 290

Customer Name: USA Environment  
 P.O. Box 87887, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
 Material Description: Gravel and Soil  
 Process to TSDOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specification.  
 Non DOT Regulated Non Hazardous  
 Date: *[Signature]*  
 Time: 12:02  
 Truck #: 560  
 Customer Signature: *[Signature]*  
 Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES

0404

PROCESSED BY	DATE	QUANTITY	STATUS	LOCATION
888500	2159-NR-H033	02150		511054005
CUSTOMER NAME: USA Environment, LP				
DATE	TIME	WEIGHT	UNIT	
10/19/2009	12:40	1	Yard	
MATERIAL DESCRIPTION: Soil - 1				
28	LOADS	560	UNITS	

Class 1 Material  
 Former Cactus Pipeyard, Houston  
 RESERVED BY: TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Bill of Lading  
 PO Number: 2158-NR-H033  
 Yards: 20  
 RRC Material  
 Non DOT Regulated Non Hazardous  
 288

Customer Name: USA Environment  
 P.O. Box 87887, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX  
 Material Description: Gravel and Soil  
 Process to TSDOT Spec Item #247, #276, #3157, #4100 and/or other appropriate specification.  
 Non DOT Regulated Non Hazardous  
 Date: *[Signature]*  
 Time: 12:05  
 Truck #: 560  
 Customer Signature: *[Signature]*  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

INVENTORY NO.	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054014
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/19/2009	TIME RECEIVED	13:02	WEIGHT	20 Yards
QUANTITY	401	UNIT	MTZ	WEIGHT	573
MATERIAL DESCRIPTION	Soil - 1				
UNITS	31 LOADS	WEIGHT	520		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *David L. Ray*

**HPP Corp**  
Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: \_\_\_\_\_  
RRC Material  
Non DOT Regulated Non Hazardous  
291

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 573

Customer Signature: *Romy*

Non DOT Regulated Non Hazardous  
Date: 10/19/09  
Time: 12:25  
Carrier Signature: *David L. Ray*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

INVENTORY NO.	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054012
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	10/19/2009	TIME RECEIVED	12:58	WEIGHT	20 Yards
QUANTITY	401	UNIT	MTZ	WEIGHT	563
MATERIAL DESCRIPTION	Soil - 1				
UNITS	30 LOADS	WEIGHT	500		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *David L. Ray*

**HPP Corp**  
Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
292

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Track #: 583

Customer Signature: *Romy*

Non DOT Regulated Non Hazardous  
Date: 10/19/09  
Time: 12:30  
Carrier Signature: *David L. Ray*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	SALES ORDER NO.	02150	ORDER NO.	511054020
CUSTOMER NAME	USA Environment, LP		NET WT	20	YARD
DATE	10/19/2009	TIME	13:31	J send	
MATERIAL DESCRIPTION:			33 LBS		
5011 - 1			660 UNITS		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE:

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-1033	SALES ORDER NO.	02150	ORDER NO.	511054015
CUSTOMER NAME	USA Environment, LP		NET WT	20	YARD
DATE	10/19/2009	TIME	13:11	J send	
MATERIAL DESCRIPTION:			36 LBS		
5011 - 1			640 UNITS		

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE:

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-1033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 4247, 4276, 43157, 4400 and/or other appropriate specification.

Truck #: 511  
Customer Signature:

Time: 1:00  
Carrier Signature:

Date: 10/19/09  
Non DOT Regulated, Non-Hazardous

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-1033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87887, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 4247, 4276, 43157, 4400 and/or other appropriate specification.

Truck #: 581  
Customer Signature:

Time: 12:41 PM  
Carrier Signature:

Date: 10/19/09  
Non DOT Regulated, Non-Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION	QUANTITY	WEIGHT	UNIT	DATE	TIME	LOCATION
888500	2159-NR-H033	02150	511054023			
CUSTOMER NAME: USA Environment, LP						
DATE	TIME	LOCATION	WEIGHT	UNIT		
10/19/2009	14:01	Jarend	20	Yard		
TOTAL FOR THIS RECEIPT			35	LOADS	700	UNITS

CLASSIFICATION: 888500  
QUANTITY: 2159-NR-H033  
WEIGHT: 02150  
UNIT: 511054023

CUSTOMER NAME: USA Environment, LP



RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

Customer Name: USA Environment  
P.O. Box 87867, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75207 Spec Item #247, #276, #3157, #4100 and/or other appropriate specification

Truck #: 5609  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
289

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Standard Container Corporation (HPP). The carrier/customer shall save and hold SCC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous in-cyber, and are not a regulated hazardous waste.

Date: 10/19/09  
Time: 12:25  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION	QUANTITY	WEIGHT	UNIT	DATE	TIME	LOCATION
888500	2159-NR-H033	02150	511054023			
CUSTOMER NAME: USA Environment, LP						
DATE	TIME	LOCATION	WEIGHT	UNIT		
10/19/2009	13:55	Jarend	20	Yard		
TOTAL FOR THIS RECEIPT			34	LOADS	680	UNITS

CLASSIFICATION: 888500  
QUANTITY: 2159-NR-H033  
WEIGHT: 02150  
UNIT: 511054023

CUSTOMER NAME: USA Environment, LP



RECEIVED BY: Class 1 Material Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No: 888500  
Sales Order No: 02150

Customer Name: USA Environment  
P.O. Box 87867, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Donnell St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 75207 Spec Item #247, #276, #3157, #4100 and/or other appropriate specification

Truck #: 5609  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
295

Notes: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Standard Container Corporation (HPP). The carrier/customer shall save and hold SCC and HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous in-cyber, and are not a regulated hazardous waste.

Date: 10/19/09  
Time: 1:15  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION	PO NUMBER	DATE ORDERED	ORDER NO.
888500	2159-NR-H033	02150	511054026
CUSTOMER NAME:	USA Environment, LP		
CLASSIFICATION	QUANTITY	UNIT	
401	mtz	20	Yard
MATERIAL DESCRIPTION:		Soil - 1	
		DATE ORDERED	ORDER NO.
		10/19/2009	14219
		Jbrand	
		37 LOADS	740
		UNITS	

RESERVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: *572*

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous  
296

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Consignor warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: *11/20*  
Time: *11:20*  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

CLASSIFICATION	PO NUMBER	DATE ORDERED	ORDER NO.
888500	2159-NR-H033	02150	511054024
CUSTOMER NAME:	USA Environment, LP		
CLASSIFICATION	QUANTITY	UNIT	
401	mtz	20	Yard
MATERIAL DESCRIPTION:		Soil - 1	
		DATE ORDERED	ORDER NO.
		10/19/2009	14105
		Jbrand	
		36 LOADS	720
		UNITS	

RESERVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item 8247, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: *508 573*

Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous  
286

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Consignor warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: *11/20*  
Time: *11:20*  
Center Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511054026
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	401	QUANTITY	MTZ	TRUCK NO.	597
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/19/2009	TIME	14:20	DRIVER	Jmend
UNITS	39	LOADS		WEIGHT	780

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 37887, Houston, TX 77237  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 under other appropriate specification.

Truck #: 587  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/19/09  
Time: 1:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	INVOICE NO.	511054026
CUSTOMER NAME:	USA Environment, LP				
ORDER NUMBER	401	QUANTITY	MTZ	TRUCK NO.	593
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/19/2009	TIME	14:23	DRIVER	Jmend
UNITS	38	LOADS		WEIGHT	750

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston, TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity, and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 37887, Houston, TX 77237  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 under other appropriate specification.

Truck #: 587  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/19/09  
Time: 1:50  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			City	20	State	TX
Material Description	Soil - 1			Weight	41000	Volume	820
Class 1 Material	Former Cactus Pipeyard, Houston TX			Date	10/19/2009	Time	15:05
Received By:	[Signature]			Weight	41000	Volume	820

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
300

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 580  
Customer Signature: [Signature]

Non DOT Regulated Non Hazardous  
Date: [Signature]  
Time: 2:10  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice Date	5/11/05
Customer Name	USA Environment, LP			City	20	State	TX
Material Description	Soil - 1			Weight	41000	Volume	800
Class 1 Material	Former Cactus Pipeyard, Houston TX			Date	10/19/2009	Time	14:41
Received By:	[Signature]			Weight	41000	Volume	800

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: [Signature]

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading  
PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
299

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 671  
Customer Signature: [Signature]


Non DOT Regulated Non Hazardous  
Date: [Signature]  
Time: [Signature]  
Carrier Signature: [Signature]


**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	QUANTITY	22150	ORDER NO.	511054042
CUSTOMER NAME	USA Environment, LP		UNIT	Yard	
ORDER DATE	10/19/2009	TIME	15:19	WEIGHTED BY	jmand
MATERIAL DESCRIPTION	Soil - 1		4.3 LBS	850	UNITS

RECEIVED BY: **Class 1 Material**  
**Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	QUANTITY	22150	ORDER NO.	511054041
CUSTOMER NAME	USA Environment, LP		UNIT	Yard	
ORDER DATE	10/19/2009	TIME	15:12	WEIGHTED BY	jmand
MATERIAL DESCRIPTION	Soil - 1		4.2 LBS	840	UNITS

RECEIVED BY: **Class 1 Material**  
**Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 173  
Center Signature: 

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer No. 888300  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 173  
Center Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycle.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	QUANTITY	22150	ORDER NO.	511054041
CUSTOMER NAME	USA Environment, LP		UNIT	Yard	
ORDER DATE	10/19/2009	TIME	15:12	WEIGHTED BY	jmand
MATERIAL DESCRIPTION	Soil - 1		4.2 LBS	840	UNITS

RECEIVED BY: **Class 1 Material**  
**Former Cactus Pipeyard, Houston TX**

SIGNATURE: 

CARRIER SIGNATURE: 


NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888300  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 301  
Center Signature: 

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer No. 888300  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSD/OT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: 301  
Center Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

CUSTOMER COPY  
MATERIAL CODES

888500	2159-NR-H033	Q2150	511054044
CUSTOMER NAME USA Environment, LP		20	Yard
401	atz	572	
MATERIAL DESCRIPTION Soil - 1		10/19/2009 15:144	Jmand
		45 TONS	900 UNITS

RECEIVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. D. V. V.*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

303

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2AD07 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications

Truck #: 572  
Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/19/09  
Time: 2:45  
Carrier Signature: *F. D. V. V.*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

0404

CUSTOMER COPY  
MATERIAL CODES

888500	2159-NR-H033	Q2150	511054043
CUSTOMER NAME USA Environment, LP		20	Yard
401	MTZ	583	
MATERIAL DESCRIPTION Soil - 1		10/19/2009 15:43	Jmand
		44 TONS	890 UNITS

RECEIVED BY:  
**Class 1 Material  
Former Cactus Pipeyard, Houston TX**



SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Bill of Lading

PO Number: 2159-NR-H033

Yards: 20

RRC Material

Non DOT Regulated Non Hazardous

304

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Durrett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2AD07 Spec Item #247, #276, #3157, #400 and/or other appropriate specifications

Truck #: 583  
Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non Hazardous  
Date: 10/19/09  
Time: 5:30  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	PHONE NO.	511054045
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	401	TRUCK NO.	MTZ	WEIGHT	20
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/19/2009	TIME	15:53	DRIVER	Jmend
UNITS	47	LOOSE		940	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

DELIVER ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Customer Name: **HPP Corp**  
 Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

PO Number: **2159-NR-H033**  
 Yards: **20**  
**RRC Material**  
**Non DOT Regulated Non Hazardous**

306

Customer Name: **USA Environment**  
 P.O. Box 97871, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: **Gravel and Soil**  
 Process to TADOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: **571**  
 Customer Signature: *[Signature]*

Time: **3:25**  
 Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated **Non Hazardous**  
 Date: \_\_\_\_\_

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com  
 Sustainability at Work

CUSTOMER COPY  
 MATERIAL CODES  
 0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	PHONE NO.	511054045
CUSTOMER NAME	USA Environment, LP				
ALLEN NUMBER	401	TRUCK NO.	MTZ	WEIGHT	20
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/19/2009	TIME	15:51	DRIVER	Jmend
UNITS	46	LOOSE		920	UNITS

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**

DELIVER ADDRESS: **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

Customer Name: **HPP Corp**  
 Transport to: **HPP Corp**  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

PO Number: **2159-NR-H033**  
 Yards: **20**  
**RRC Material**  
**Non DOT Regulated Non Hazardous**

305

Customer Name: **USA Environment**  
 P.O. Box 97871, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: **Gravel and Soil**  
 Process to TADOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: **589**  
 Customer Signature: *[Signature]*

Time: **3:30**  
 Carrier Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated **Non Hazardous**  
 Date: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	888506	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054060
CUSTOMER NAME	USA Environment, LP			DATE	10/19/2009	TIME	17:03
PLANT NUMBER	401	PLANT NAME	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	5011 - 1			DATE	10/19/2009	TIME	17:03
				WEIGHT	49	LOADS	980
				UNIT			

Class 1 Material  
Former Cactus Pipeline, Houston TX



SIGNATURE:

CARRIER SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall issue and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 5835  
Customer Signature: [Signature]

Non DOT Regulated Non Hazardous  
Date: 10/19/09  
Time: 4:30  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	888506	PO NUMBER	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054053
CUSTOMER NAME	USA Environment, LP			DATE	10/19/2009	TIME	16:18
PLANT NUMBER	401	PLANT NAME	MTZ	WEIGHT	20	UNIT	Yard
MATERIAL DESCRIPTION	5011 - 1			DATE	10/19/2009	TIME	16:18
				WEIGHT	49	LOADS	960
				UNIT			

Class 1 Material  
Former Cactus Pipeline, Houston TX



SIGNATURE:

CARRIER SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall issue and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Bill of Lading  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 8217, 8276, 83157, 8400 and/or other appropriate specification.

Truck #: 5860  
Customer Signature: [Signature]

Non DOT Regulated Non Hazardous  
Date: 10/19/09  
Time: 3:30  
Carrier Signature: [Signature]

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	988506	PO NUMBER	2159-NR-H033	DATE OF ORDER	02150	SHIPMENT NO.	511054075
CUSTOMER NAME	USA Environment, LP			WEIGHT	20	UNIT	Yard
PLATE NUMBER	401	PLATE STATE	Rtz	PLATE NO.	572	DATE	10/20/2009 08:18
MATERIAL DESCRIPTION	Soil - 1			WEIGHT	20	UNIT	Yards

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *David Ray*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: *573*

Customer Signature: *Buy*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.


Non DOT Regulated, Non-Hazardous  
Date: *10/19/09*  
Time: *7:45*  
Carrier Signature: *David Ray*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

SHIPMENT NO.	988506	PO NUMBER	2159-NR-H033	DATE OF ORDER	02150	SHIPMENT NO.	511054061
CUSTOMER NAME	USA Environment, LP			WEIGHT	20	UNIT	Yard
PLATE NUMBER	401	PLATE STATE	Rtz	PLATE NO.	572	DATE	10/19/2009 17:07
MATERIAL DESCRIPTION	Soil - 1			WEIGHT	50	UNIT	Yards

RECEIVED BY: **Class 1 Material Former Cactus Pipeyard, Houston TX**



CARRIER SIGNATURE: *F. Dwyer*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3157, #400 and/or other appropriate specification.

Truck #: *528*

Customer Signature: *David Ray*

PO Number: 2159-NR-H033  
Yards: *20*  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Central Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Operator warrants materials transported are non-hazardous materials, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: *10/19/09*  
Time: *4:35*  
Carrier Signature: *F. Dwyer*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511054063
Customer Name:	USA Environment, LP			
Truck #:	401	MTZ	564	
Material Description:	Soil 1			
Carrier	10/20/2009 08:42	20	Yard	
Weight	3	LOADS	EQ	UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
312

Customer Name: USA Environment  
P.O. Box 87657, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Borrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specification.

Truck #: 564  
Customer Signature: \_\_\_\_\_  
Carrier Signature: \_\_\_\_\_  
Time: 8:15  
Date: 10/20/09  
Non DOT Regulated, Non-Hazardous  
Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	2159-NR-H033	02150	511054077
Customer Name:	USA Environment, LP			
Truck #:	401	mtz	577	
Material Description:	Soil 1			
Carrier	10/20/2009 08:30	20	Yard	
Weight	2	LOADS	40	UNITS

Class 1 Material  
Former Cactus Pipeyard, Houston  
TX

RECEIVED BY:   
SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: \_\_\_\_\_

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
311

Customer Name: USA Environment  
P.O. Box 87657, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Borrett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #247, #276, #3137, #400 and/or other appropriate specification.

Truck #: 577  
Customer Signature: \_\_\_\_\_  
Carrier Signature: \_\_\_\_\_  
Time: \_\_\_\_\_  
Date: 10/20/09  
Non DOT Regulated, Non-Hazardous  
Signature: \_\_\_\_\_

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511054087
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	4Q1	TRUCK NO.	MTZ	WEIGHT	560
MATERIAL DESCRIPTION	Soil - 1				
DATE RECEIVED	10/20/2009 09:14	WEIGHTED BY	Jrand		
MATERIAL DESCRIPTION	Soil 1				
UNITS	5	LOADS	100	UNITS	



RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *See file*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Marquet St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item R241, R276, R3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
314

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator retains materials transported as non-hazardous inorganic, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/20/09  
Time: 8:35  
Carrier Signature: *See file*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	TICKET NO.	511054085
CUSTOMER NAME	USA Environment, LP				
DATE RECEIVED	4Q1	TRUCK NO.	MTZ	WEIGHT	572
MATERIAL DESCRIPTION	Soil 1				
DATE RECEIVED	10/20/2009 08:59	WEIGHTED BY	Jrand		
MATERIAL DESCRIPTION	Soil 1				
UNITS	4	LOADS	80	UNITS	



RECEIVED BY: **Class 1 Material**  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *See file*

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Marquet St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item R241, R276, R3157, #400 and/or other appropriate specification.

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
313

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Cement Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator retains materials transported as non-hazardous inorganic, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/20/09  
Time: 1:25  
Carrier Signature: *See file*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	SOI Number	2159-NR-H033	TRUCK NO.		DATE	
Customer Name	USA Environment, LP			SALES ORDER NO.	02150	TRUCK NO.	511054099
PLATE NUMBER	401	TRUCK NAME	MTZ	TRUCK NO.	572	DATE	10/20/2009 10:19
MATERIAL DESCRIPTION	Soil - 1			WEIGHT	20	UNIT	Yard
				LOADS	7	WEIGHT	140 UMS

Class 1 Material  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. Or...*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous  
316

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dwyett St. and Market St.  
Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier versus materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/20/09  
Time: 10:00 am  
Carrier Signature: *F. Or...*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	SOI Number	2159-NR-H033	TRUCK NO.		DATE	
Customer Name	USA Environment, LP			SALES ORDER NO.	02150	TRUCK NO.	511054093
PLATE NUMBER	401	TRUCK NAME	mtz	TRUCK NO.	577	DATE	10/20/2009 10:01
MATERIAL DESCRIPTION	Soil - 1			WEIGHT	20	UNIT	Yard
				LOADS	5	WEIGHT	120 UMS

Class 1 Material  
Former Cactus Pipeline, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous  
315

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeline, Corner of Dwyett St. and Market St.  
Houston, TX

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier versus materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
Date: 10/20/09  
Time: 5:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	Q2150	511054110
CUSTOMER NAME: USA Environment, LP		QTY	UNIT
401	MTZ	20	Yard
MATERIAL DESCRIPTION: Soil - 1		DATE	TIME
		10/20/2009	11:34
		DRIVER	Jmend
		LOADS	180

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



SIGNATURE: *F. D. W. [Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 23DOT Spec Item 8247, 8376, 83157, #400 and/or other appropriate specifications.

Truck #: 572  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 10/20/09

Time: 10:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hppcycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	Q2150	511054103
CUSTOMER NAME: USA Environment, LP		QTY	UNIT
401	MTZ	20	Yard
MATERIAL DESCRIPTION: Soil - 1		DATE	TIME
		10/20/2009	10:37
		DRIVER	Jmend
		LOADS	150

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Pipeyard, Houston TX



SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name:  
USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 23DOT Spec Item 8247, 8376, 83157, #400 and/or other appropriate specifications.

Truck #: 560  
Customer Signature: *[Signature]*

PO Number: 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Non DOT Regulated, Non-Hazardous  
Date: 10/20/09

Time: 10:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Invoice No.	02150	Order No.	S11054125
Customer Name	USA Environment, LP	Material Description	Soil - 1	Weight	20	Units	Yard
Carrier		Date	10/20/2009	Time	12:42	By	Jarend
TOTALS FOR THIS ORDER				11 Loads			220

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Ripyard, Houston TX



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Ripyard, Corner of Doughter St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
320

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Ripyard, Corner of Doughter St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 572  
Time: 11:30  
Carrier Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/20/09

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	Invoice No.	02150	Order No.	S11054112
Customer Name	USA Environment, LP	Material Description	Soil - 1	Weight	20	Units	Yard
Carrier		Date	10/20/2009	Time	11:43	By	Jarend
TOTALS FOR THIS ORDER				10 Loads			200

RECEIVED BY:  
**Class 1 Material**  
Former Cactus Ripyard, Houston TX



SIGNATURE: \_\_\_\_\_  
CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Ripyard, Corner of Doughter St. and Market St.  
Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
319

Customer No. 888500  
Sales Order No. 02150

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Ripyard, Corner of Doughter St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #347, #376, #3157, #400 and/or other appropriate specification.

Truck #: 560  
Time: 11:20  
Carrier Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
Date: 10/20/09

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	Weight	02150	Volume	511054133
Customer Name	USA Environment, LP			Weight	20	Volume	Yard
Material Description	401	RTZ	565	Date	10/26/2009	Time	13:33
Material Description	Soil - 1			Weight	13	Volume	260

Class 1 Material  
 Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number 2159-NR-H033  
 Yards 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donnell St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T320T Spec Item #24, #27, #31, #40 and/or other appropriate specifications.

Truck #: 565  
 Customer Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
 Date: 10/26  
 Time: 1:15  
 Carrier Signature: *[Signature]*

**HPP**  
 Sustainability at Work  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES  
 0404

Customer No.	888500	PO Number	2159-NR-H033	Weight	02150	Volume	511054126
Customer Name	USA Environment, LP			Weight	20	Volume	Yard
Material Description	401	MTZ	560	Date	10/20/2009	Time	12:54
Material Description	Soil - 1			Weight	12	Volume	240

Class 1 Material  
 Former Cactus Pipeyard, Houston



SIGNATURE: \_\_\_\_\_

CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

PO Number 2159-NR-H033  
 Yards 20  
 RRC Material  
 Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Donnell St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to T320T Spec Item #24, #27, #31, #40 and/or other appropriate specifications.

Truck #: 560  
 Customer Signature: *[Signature]*

Non DOT Regulated Non-Hazardous  
 Date: 10/20  
 Time: 12:30  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

04404

CUSTOMER COPY  
MATERIAL CODES

888500	2159-NR-H033	02150	511054138
CUSTOMER NAME: USA Environment, LP		WEIGHT	UNITS
401	MTZ	20	Yard
MATERIAL DESCRIPTION: So11 - 1		DATE	WEIGHTED BY
		10/20/2009	13:55
		J Brand	
		15 Lb/box	300
		UNITS	

Class 1 Material  
Forster Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: *F. Dr. W. W.*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Forster Cactus Pipeyard, Corner of Borsett St. and Marlett St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 572  
Customer Signature: *Bob*

Date: 10/20  
Time: 1:35  
Carrier Signature: *F. Dr. W. W.*

Non DOT Regulated Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

04404

CUSTOMER COPY  
MATERIAL CODES

888500	2159-NR-H033	02150	511054137
CUSTOMER NAME: USA Environment, LP		WEIGHT	UNITS
401	mtz	583	Yard
MATERIAL DESCRIPTION: So11 - 1		DATE	WEIGHTED BY
		10/20/2009	13:46
		J Brand	
		14 Lb/box	280
		UNITS	

Class 1 Material  
Forster Cactus Pipeyard, Houston TX



CARRIER SIGNATURE: *[Signature]*

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name:  
USA Environment  
P.O. Box 87687, Houston, TX 77287  
Forster Cactus Pipeyard, Corner of Borsett St. and Marlett St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 2x20' Spec Item #247, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 583  
Customer Signature: *By*

Date: 10/20  
Time: 1:00  
Carrier Signature: *[Signature]*

Non DOT Regulated Non Hazardous

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	02150	511054130
CUSTOMER NAME: USA Environment, LP		WEIGHT	20 Yard
401	MTZ	10/20/2009 14:36	jemd
MATERIAL DESCRIPTION: Soil - 1		TONS OF THE ORIGINAL LOAD	17 LOADS
			340 UNITS

RECEIVED BY:  **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

 **HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment, P.O. Box 87087, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TRBOT Spec Item 8247, 8276, 8315, 4400 under other appropriate specification

Truck #: 505  
Customer Signature: 

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
326

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous inorganic, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/20  
Time: 1:40  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

888500	2159-NR-H033	02150	511054139
CUSTOMER NAME: USA Environment, LP		WEIGHT	20 Yard
401	MTZ	10/20/2009 14:07	jemd
MATERIAL DESCRIPTION: Soil - 1		TONS OF THE ORIGINAL LOAD	16 LOADS
			320 UNITS

RECEIVED BY:  **Class 1 Material Former Cactus Pipeyard, Houston TX**

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

 **HPP Corp**  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment, P.O. Box 87087, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TRBOT Spec Item 8247, 8276, 8315, 4400 under other appropriate specification

Truck #: 500  
Customer Signature: 

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
325

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous inorganic, and are not a regulated hazardous waste.

Non DOT Regulated Non-Hazardous  
Date: 10/20  
Time: 1:40  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycled.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SHIP TO ORDER NO.	02150	INVOICE NO.	511054147
CUSTOMER NAME:	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHT	572
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/20/2009	TIME	15:06	WEIGHTED BY	jaend
UNITS	13 TONS	WEIGHTED	350	UNITS	

RECEIVED BY:   
Class 1 Material  
Former Cactus Pileyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 

Hill of Liding  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dwyer St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
328

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 592  
Customer Signature: 

Non DOT Regulated, Non Hazardous  
Date: 10/20/09  
Time: 2:40  
Carrier Signature: E. J. ...

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycled.com

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SHIP TO ORDER NO.	02150	INVOICE NO.	511054144
CUSTOMER NAME:	USA Environment, LP				
QUANTITY	401	UNIT	MTZ	WEIGHT	583
MATERIAL DESCRIPTION:	Soil - 1				
DATE	10/20/2009	TIME	14:54	WEIGHTED BY	jaend
UNITS	13 TONS	WEIGHTED	350	UNITS	

RECEIVED BY:   
Class 1 Material  
Former Cactus Pileyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: 


Hill of Liding  
HPP Corp  
Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pileyard, Corner of Dwyer St. and Market St.  
Houston, TX

Customer No. 888500  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous  
327

Material Description: Gravel and Soil  
Process to TxDOT Spec Item #217, #276, #3157, #400 and/or other appropriate specification.

Truck #: 583  
Customer Signature: 

Non DOT Regulated, Non Hazardous  
Date: 10/20/09  
Time: 2:15  
Carrier Signature: 

**HPP** 2070 Gamma Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054155
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	401	PLANT VALUE	MTZ	TRUCKS	583
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/20/2009	TIME	16:10	WEIGHTED BY	jsend
UNITS	21 Loads				420

RECEIVED BY:  Class 1 Material Forbear Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Gamma Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 6247, 6376, 63157, 6400 and/or other appropriate specifications.

Truck #: 575  
Customer Signature: 

Bill of Lading

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

330

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from all liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/20/09  
Time: 3:00  
Carrier Signature: 

**HPP** 2070 Gamma Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com  
Sustainability at Work

CUSTOMER COPY  
MATERIAL CODES  
0404

ORDER NO.	2159-NR-H033	SALES ORDER NO.	02150	ORDER NO.	511054149
CUSTOMER NAME	USA Environment, LP				
PLANT NUMBER	401	PLANT VALUE	MTZ	TRUCKS	560
MATERIAL DESCRIPTION	5011 - 1				
DATE	10/20/2009	TIME	15:18	WEIGHTED BY	jsend
UNITS	20 Loads				400

RECEIVED BY:  Class 1 Material Forbear Cactus Pipeyard, Houston TX

CARRIER SIGNATURE: 

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP Corp**  
Transport to: HPP Corp  
2070 Gamma Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
Process to TSDOT Spec Item 6247, 6376, 63157, 6400 and/or other appropriate specifications.

Truck #: 560  
Customer Signature: 

Bill of Lading

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

329

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Southern Combined Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from all liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous recyclables, and are not a regulated hazardous waste.

Non DOT Regulated Non Hazardous  
Date: 10/20/09  
Time: 2:50  
Carrier Signature: 

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

Standardity at Work

CUSTOMER COPY  
MATERIAL CODES

0404

INVOICE NO.	2159-NR-H033	ISSUE NO.	02150	TICKET NO.	511054171
CUSTOMER NAME	USA Environment, LP				
UNIT NUMBER	401	INVENTORY	MTZ	TRUCK NO.	564
DATE	10/21/2009	TIME	08:09	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1				
UNITS	1	LOADS	20	UNITS	20



Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

HPP Corp

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 72007 Spec Item #217, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 564  
Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains the material transporter and shall be responsible for all applicable regulations.

Non DOT Regulated, Non-Hazardous  
Date: 10/21/09  
Time: 7:30  
Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

Standardity at Work

CUSTOMER COPY  
MATERIAL CODES

0404

INVOICE NO.	2159-NR-H033	ISSUE NO.	02150	TICKET NO.	511054151
CUSTOMER NAME	USA Environment, LP				
UNIT NUMBER	401	INVENTORY	MTZ	TRUCK NO.	560
DATE	10/20/2009	TIME	16:33	WEIGHT	20
MATERIAL DESCRIPTION	Soil - 1				
UNITS	22	LOADS	440	UNITS	440



Class 1 Material  
Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

HPP Corp

Customer No. 888300  
Sales Order No. 02150

PO Number: 2159-NR-H033  
Yards 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Former Cactus Pipeyard, Corner of Dorsett St. and Market St.  
Houston, TX

Material Description: Gravel and Soil  
Process to 72007 Spec Item #217, #276, #3157, #400 and/or other appropriate specifications.

Truck #: 560  
Customer Signature: *[Signature]*

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crushed Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Customer remains the material transporter and shall be responsible for all applicable regulations.

Non DOT Regulated, Non-Hazardous  
Date: 10/20/09  
Time: 4:00  
Carrier Signature: *[Signature]*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES

0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice No.	511054184
Customer Name:				USA Environment, LP			
Material No.	401	Material Name	nrz	Truck No.	572		
Material Description:				Soil - 1			
Order	Net	Gross	Yard				
10/21/2009	03:02	Jmend					
Material Description:				Soil - 1			
3	LOADS	60	UNITS				



RECEIVED BY:  
 Class 1 Material  
 Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. Durkin*

**HPP**  
 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycles.com

CUSTOMER COPY  
 MATERIAL CODES

0404

Customer No.	888500	Order No.	2159-NR-H033	Invoice No.	02150	Invoice No.	511054178
Customer Name:				USA Environment, LP			
Material No.	401	Material Name	nrz	Truck No.	583		
Material Description:				Soil - 1			
Order	Net	Gross	Yard				
10/21/2009	08:41	Jmend					
Material Description:				Soil - 1			
2	LOADS	40	UNITS				



RECEIVED BY:  
 Class 1 Material  
 Former Cactus Pipeyard, Houston TX

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *[Signature]*

Bill of Lading

HPP Corp  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

Customer Name:  
 USA Environment  
 P.O. Box 87667, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Barnett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TxDOT Spec Item 8247, 8276, 83137, #400 and/or other appropriate specifications.

Truck #: 572  
 Customer Signature: *[Signature]*

Bill of Lading

PO Number: 2159-NR-H033  
 Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crated Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Southern Crated Concrete transports an non-hazardous materials, and we not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
 Date: *11/30*

Time: *11:30*  
 Carrier Signature: *F. Durkin*

Bill of Lading

HPP Corp  
 Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02150

Customer Name:  
 USA Environment  
 P.O. Box 87667, Houston, TX 77287  
 Former Cactus Pipeyard, Corner of Barnett St. and Market St., Houston, TX

Material Description: Gravel and Soil  
 Process to TxDOT Spec Item 8247, 8276, 83137, #400 and/or other appropriate specifications.

Truck #: 583  
 Customer Signature: *[Signature]*

Bill of Lading

PO Number: 2159-NR-H033  
 Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Crated Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Southern Crated Concrete transports an non-hazardous materials, and we not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
 Date: *11/30*

Time: *11:50*  
 Carrier Signature: *[Signature]*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	DATE	02150	TIME	511054381
Customer Name	USA Environment, LP			WEIGHT	20	YARD	
Carrier	401	HTZ	581	DATE	10/23/2009	TIME	13:42
Material Description	Soil - 1			WEIGHT BY	Jend		
				CONTRACT NUMBER	2 L008		
				UNITS	40		

RECEIVED BY: **Class 1 Material Former Cactus Pavedard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *Angel Wtz*

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Eddie Garcia Pavedard, Corner of Dorsett St. and Market St. Houston, TX

Truck #: 571  
Carrier Signature: *John*

Non DOT Regulated, Non-Hazardous  
Date: 10/23  
Time: 8:00  
Carrier Signature: *Angel Wtz*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer No.	888500	PO Number	2159-NR-H033	DATE	02150	TIME	511054350
Customer Name	USA Environment, LP			WEIGHT	20	YARD	
Carrier	401	HTZ	572	DATE	10/23/2009	TIME	09:10
Material Description	Soil - 1			WEIGHT BY	Jend		
				CONTRACT NUMBER	1 L008		
				UNITS	20		

RECEIVED BY: **Class 1 Material Former Cactus Pavedard, Houston TX**



NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

CARRIER SIGNATURE: *F. Garcia*

Transport to: **HPP Corp**  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Customer Name: USA Environment  
P.O. Box 87687, Houston, TX 77287  
Eddie Garcia Pavedard, Corner of Dorsett St. and Market St. Houston, TX

Truck #: 572  
Carrier Signature: *F. Garcia*

Non DOT Regulated, Non-Hazardous  
Date: 10/23  
Time: 7:00  
Carrier Signature: *F. Garcia*

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name:	USA Environment, LP	Bill No.:	2159-NR-H033	Ship Date:	02150	Ship No.:	S11055354	
Material Description:	401 mtz	Weight:	583	Units:	Yard	Volume:	20	
Material Description:	Spill - 1		Weight:	15:28	Units:	Yard	Volume:	18

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



CARRIER SIGNATURE: *[Signature]*

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeline, Center of Forest St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cleared Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeline, Center of Forest St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cleared Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
Houston, Texas 77034  
(281) 487-0766 Fax (281) 487-0769  
www.hpprecycles.com

CUSTOMER COPY  
MATERIAL CODES  
0404

Customer Name:	USA Environment, LP	Bill No.:	2159-NR-H033	Ship Date:	02150	Ship No.:	S11055349	
Material Description:	401 MTZ	Weight:	586	Units:	Yard	Volume:	18	
Material Description:	Spill - 1		Weight:	15:07	Units:	Yard	Volume:	18

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



CARRIER SIGNATURE: *[Signature]*

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeline, Center of Forest St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cleared Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

Customer Name: USA Environment  
P.O. Box 81687, Houston, TX 77287  
Former Cactus Pipeline, Center of Forest St. and Market St., Houston, TX

Transport to: HPP Corp  
2070 Genoa Red Bluff  
Houston, TX 77034  
(281) 487-0766 Fax (281) 487-0769

PO Number: 2159-NR-H033  
Yards: 20  
RRC Material  
Non DOT Regulated Non Hazardous

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of Houston Cleared Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.

**HPP** 2070 Genoa Red Bluff  
 Houston, Texas 77034  
 (281) 487-0766 Fax (281) 487-0769  
 www.hpprecycle.com

Responsible Party at Work

0404

Customer No.	888500	2159-NR-H033	02150	511053362
Customer Name:	USA Environment, LP			
Truck #:	5776		18	Yard

Material Description:	Spill	1
Class 1 Material	MTZ	585

Date:	11/05/2009	16:40	Jmend
Carrier:	3	LODS	56

Class 1 Material  
 Forster Cactus Pipeyard, Houston TX



SIGNATURE:

CARRIER SIGNATURE:

NOTICE: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent, or representative of HPP Corporation (HPP). The carrier/customer shall save and hold HPP harmless from all liability, damages, loss, claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling.



Transport to: HPP Corp  
 2070 Genoa Red Bluff  
 Houston, TX 77034  
 (281) 487-0766 Fax (281) 487-0769

Customer No. 888500  
 Sales Order No. 02159

Customer Name:  
 USA Environment  
 P.O. Box 87687, Houston, TX 77287  
 Buyer: Charles Roberg, Corner of Bonnett St. and Mariner St.  
 Houston, TX

Material Description: Gravel and Soil  
 Process to TSDOT Spec Item 8241, 8276, 83157, #400 and/or other appropriate specification.

Customer Signature: *Rae Boy*

PO Number: 2159-NR-H033  
 Yards: 20

RRC Material  
 Non DOT Regulated Non Hazardous

339

Notice: The carrier/customer involved in the transportation or handling of materials covered by this document is an independent entity and shall not be deemed for any purpose to be an employee, agent or representative of Southern Coastal Concrete and/or HPP. The carrier shall save and hold SCC and HPP harmless from liability, damages, loss claims, demands and/or actions of any nature which arise out of or are related to, such transportation or handling. Generator warrants materials transported are non-hazardous inorganic, and are not a regulated hazardous waste.

Non DOT Regulated, Non-Hazardous  
 Date: 11/5

Time: 2:15  
 Carrier Signature: *John H.*